DIVISION OF WASTEWATER SECTION

for ON-SITE WASTEWATER SYSTEM

OWNER: Dupont APPLICANT: _____

ADDRESS: _____ APPLICATION DATE: _____ DATE EVALUATED: 2/25/04

PROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): _____ PROPERTY SIZE: _____

LOCATION OF SITE: Lakeview Hts #11 PROPERTY RECORDED: _____

WATER SUPPLY: ☐ Private ☐ Public ☐ Well ☐ Spring ☐ Other _____

EVALUATION METHOD: ☐ Auger Boring ☐ Pit ☐ Cut

TYPE OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	A	0-3	Rd/Brw SCL	GR FR	SS, SP, SE, FI-FR				PS .2
		3-21	Rd/Brw C/CL	m-w SBK					
		21-38	Rd/Brw C/CL	w SBK	SS, SP, SE, FI-FR w/few				
			Yellow/Brw	mottles					
		38-58	Rd/Brw C	w-m SBK	SS, SP, SE, FI				
2	B Initial	0-3	Brw SCL	w/SBK					PS 3+
		3-16	Rd/Brw C/CL	m-w SBK	SS, SP, SE, FR		common mica flakes		
		16-46	Rd/Brw C	w SBK w/some SAP Inclus					
		46-58	SL/LS SAP	C mix					
3	C Repair	0-4	Brw SCL	GR FR					PS .3 to .25 to 38"
		4-18	Rd/Brw	m SBK	SS, SP, SE, FI-FR				
		18-38	Rd/Brw	m-w SBK	SS, SP, SE, FI-FR				
		38-57"	Rd/Brw	w SBK/SAP	/w Rock mix				
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		
System Type(s)		
Site LTAR		

OTHER FACTORS (.1946): _____

SITE CLASSIFICATION (.1948): _____

EVALUATED BY: _____

OTHER(S) PRESENT: _____

DEPARTMENT OF ENVIRONMENT, HEALTH, AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: _____
COUNTY: _____

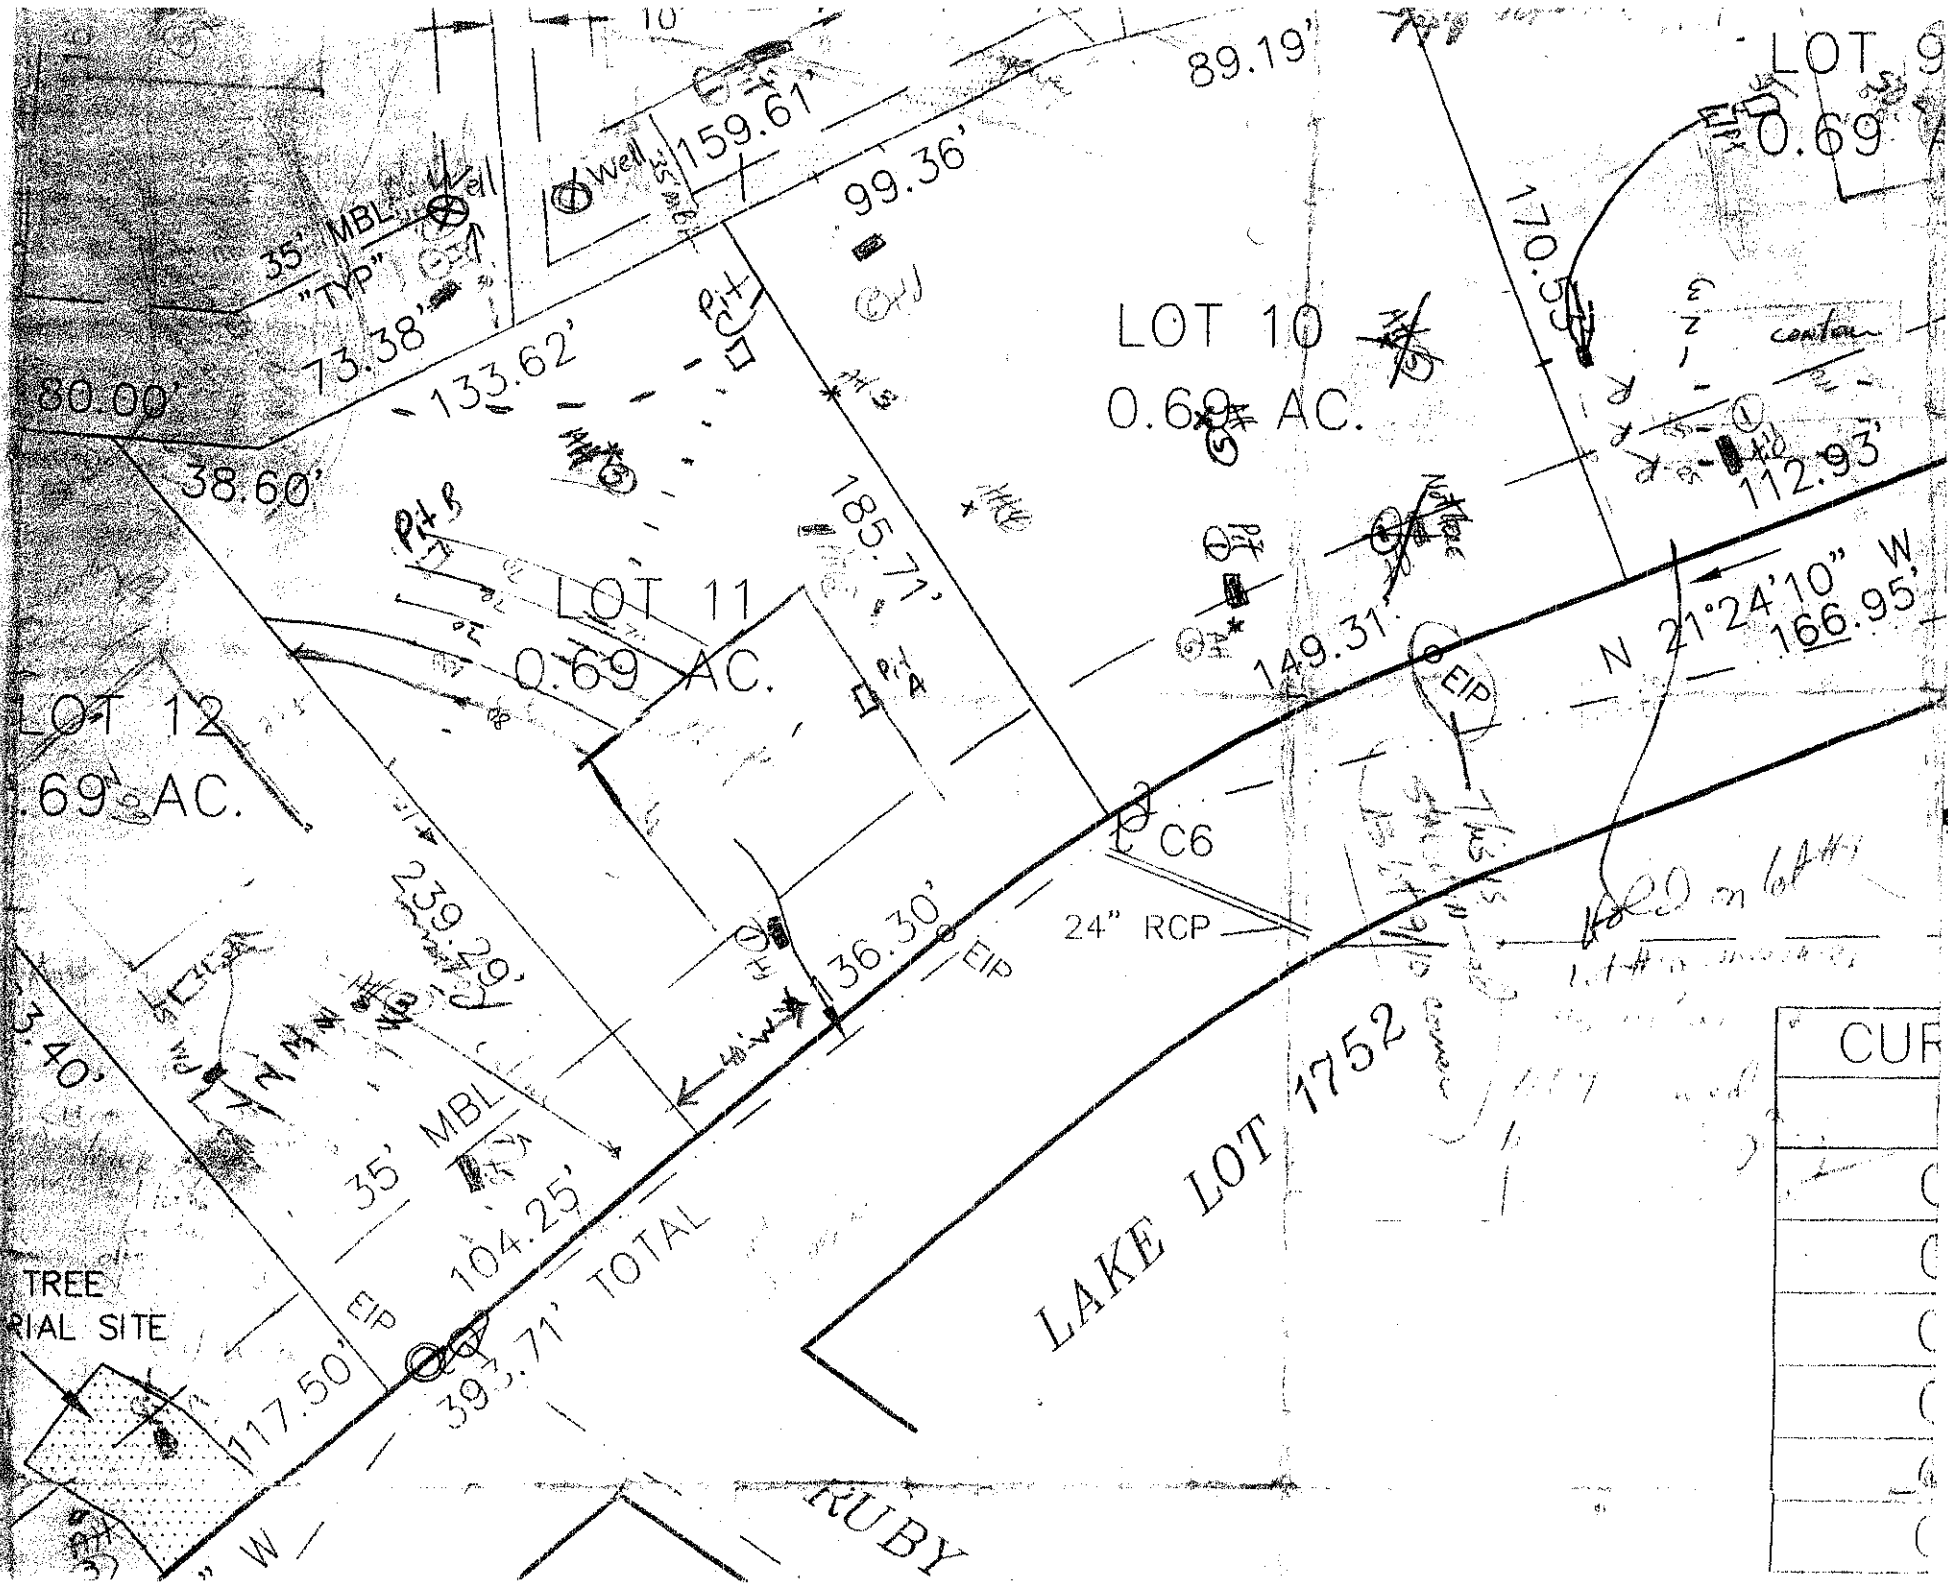
SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: M T Fox APPLICANT: _____
ADDRESS: _____ APPLICATION DATE: _____ DATE EVALUATED: 1-21-99
PROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): _____ PROPERTY SIZE: _____
LOCATION OF SITE: Lot 11 Lakeview Heights PROPERTY RECORDED: _____
WATER SUPPLY: ☐ Private ☐ Public ☐ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☐ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1		0-25	sb e-s/l-L	fr-sp-sssp-SS					LPP soil & site only, .12
		25-40	sb/AB yBRN c	fr-sp-mi-ss	common common	R mottles relic & drainage mottles			
		40+	~5" water in pit bottom						
2		0-21	sb e-s/l-L	fr-sp-sssp					(4)
		21-32	(Hiwater) mkfsab yBRN-L	fr-sp-sssp	numerous mottles some 2 abn 2				
		32-48	water in pit		(4)				
3	Initial	0-6	mkfsab brn-sl-fr						PS .3
		6-21	sb e-s/l-L	fr-sp					
		21-48 (BW)	mkfsab yBRN-L	fr-sp-ss-SS					
			few-common mi-sm						
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		
System Type(s)		
Site LTAR		

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): _____
EVALUATED BY: _____
OTHER(S) PRESENT: _____


LOT 9
0.69 AC.
89.19'
159.61'
99.36'
35' MBL "TYP"
73.38'
80.00'
38.60'
133.62'
LOT 10
0.69 AC.
170.55'
112.93'
N 21°24'10" W
166.95'
149.31'
185.71'
LOT 11
0.69 AC.
LOT 12
0.69 AC.
C6
36.30'
24" RCP
EIP
35' MBL
104.25'
117.50'
39.71' TOTAL
LAKE LOT 1752
TREE
RIAL SITE
RUBY