DEPARTMENT OF ENVIRONMENT, HEALTH, AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: _____
COUNTY: _____

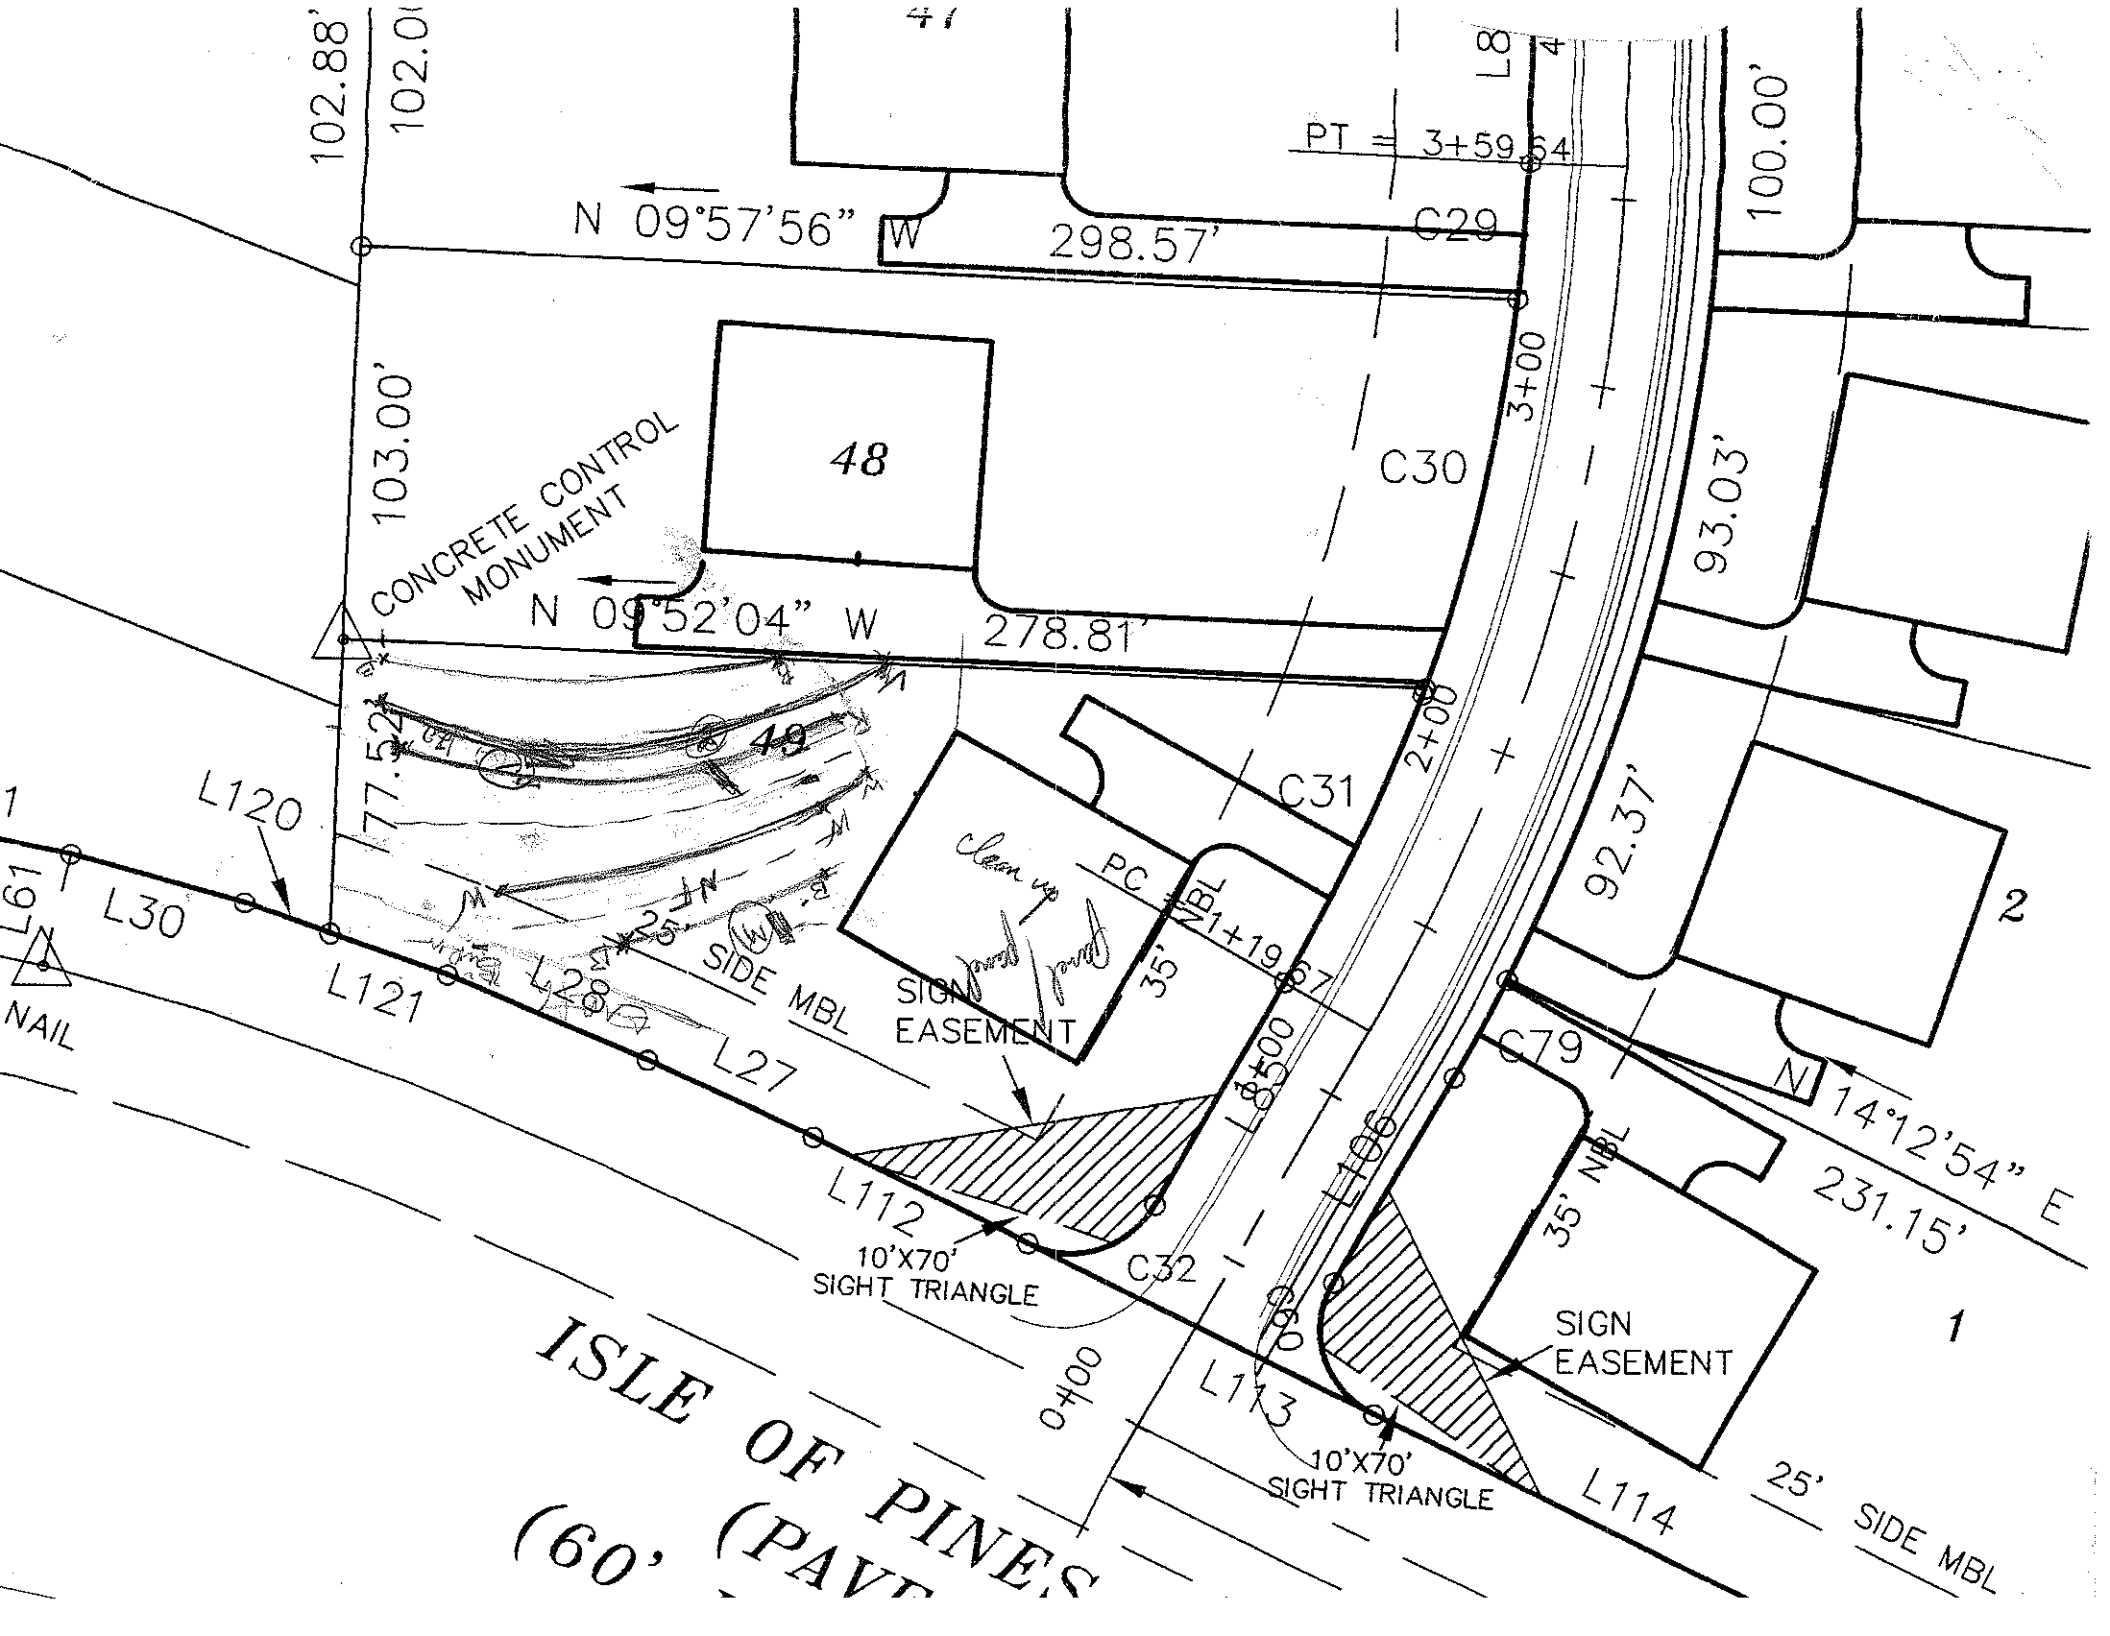
SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: Diesst APPLICANT: _____
ADDRESS: _____ APPLICATION DATE: _____ DATE EVALUATED: 7-16-04
PROPOSED FACILITY: SFR PROPOSED DESIGN FLOW (.1949): 480gpd PROPERTY SIZE: _____
LOCATION OF SITE: Lot 49 The Preserve PROPERTY RECORDED: _____
WATER SUPPLY: ☐ Private ☒ Public ☒ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☐ Auger Boring ☒ Pit ☐ Cut
TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LAND-SCAPE POSITION/ SLOPE %	HORI-ZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	OTHER PROFILE FACTORS .1943 SOIL DEPTH	OTHER PROFILE FACTORS .1956 SAPRO CLASS	OTHER PROFILE FACTORS .1944 RESTR HORIZ	PROFILE CLASS & LTAR
1		0-2	gr fsw SL	frssSp					.3
		2-28	mfsbk RC	frssSp	few incl SAp 22"+				
		28-55	massive yp LSAp	frssSp					
2	5%	0-4	gr fsw SL	frssSp					.3
		4-31	mfsbk RC	frssSp SAp					
		31-52	wkfsbk yp cl	frssSp	common mn stAp				
3	8-19-04	0-7	gr fsw scl	frssSp					.3
		7-22	mfsbk RC	frssSp SAp					
		22-36	wkfsbk Rysct	frssSp					
		36-55	massive rylLSAp	frssSp	few incl				
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	LPPPBPS	LPPPBPS
Site LTAR	.3	.3

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: [signature]
OTHER(S) PRESENT: Paul Pennington


102.88'
102.0
41
L8
PT = 3+59.64
100.00'
N 09°57'56" W
298.57'
C29
3+00
103.00'
48
C30
93.03'
CONCRETE CONTROL MONUMENT
N 09°52'04" W
278.81'
49
77.52'
C31
2+00
92.37'
2
L120
1
L61
L30
NAIL
L121
L28
L27
SIDE MBL
SIGN EASEMENT
35'
PC
1+19.67
1+00
C79
N 14°12'54" E
231.15'
L112
10'X70' SIGHT TRIANGLE
C32
L106
35' NBL
0+00
L113
10'X70' SIGHT TRIANGLE
SIGN EASEMENT
1
L114
25' SIDE MBL
ISLE OF PINES
(60'