DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: _____
COUNTY: _____

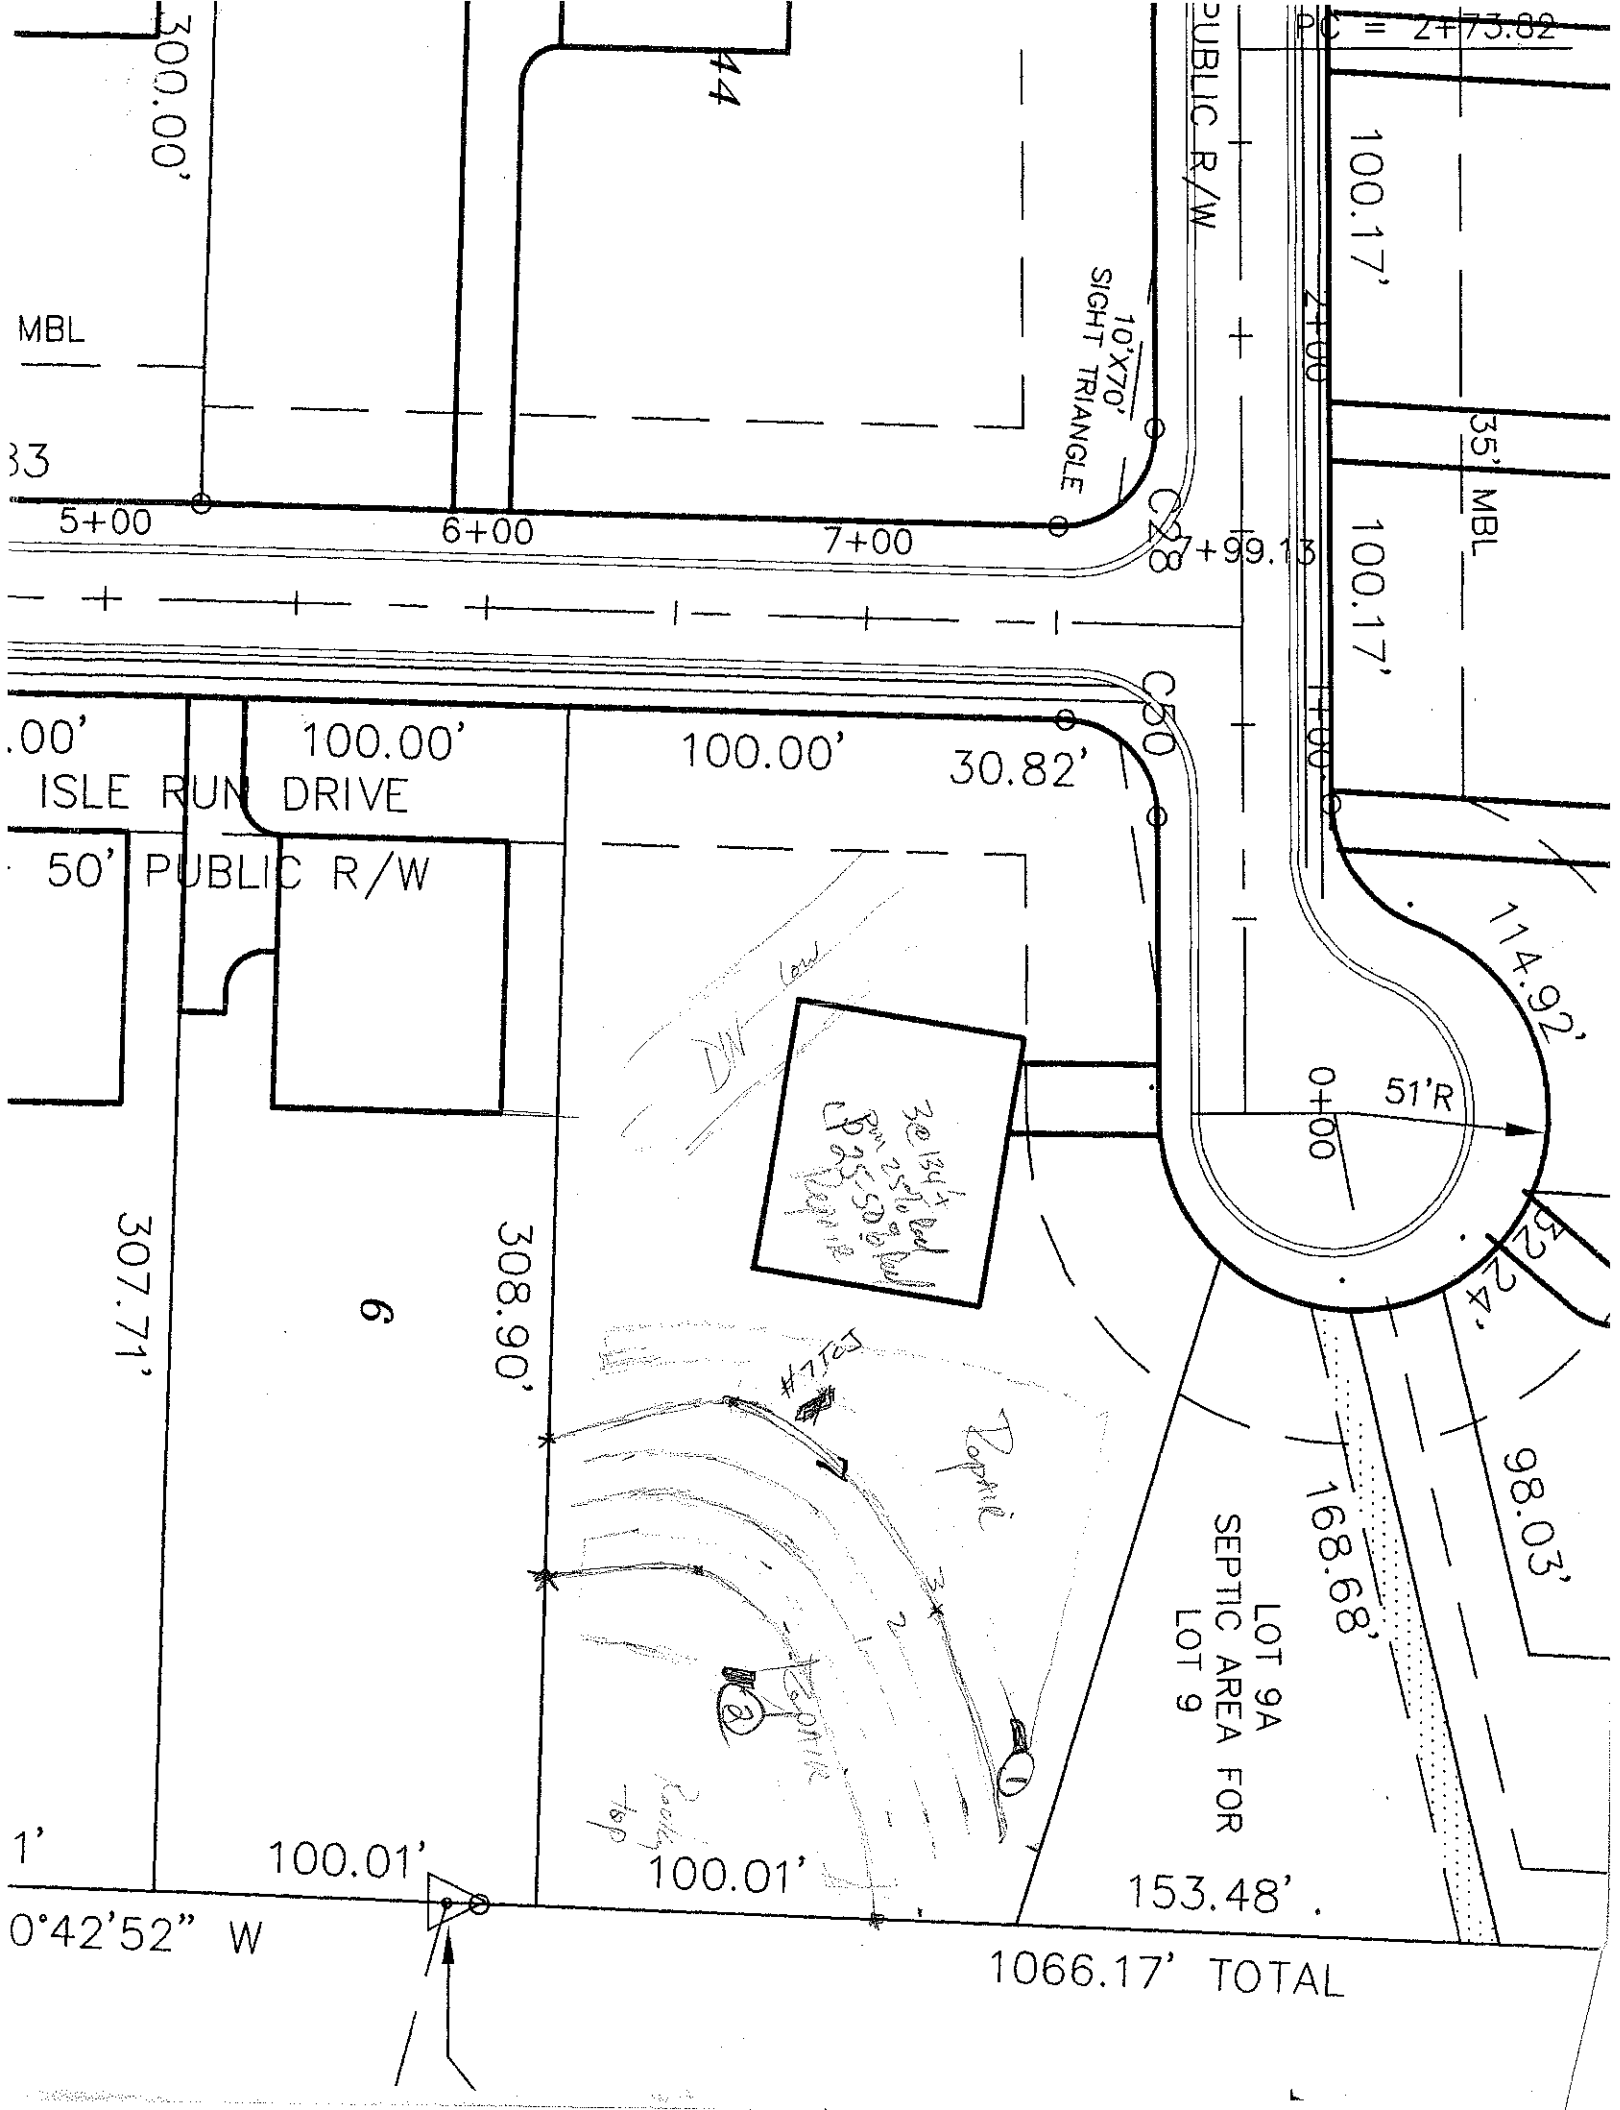
SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: Dienst APPLICANT: _____
ADDRESS: _____ APPLICATION DATE: _____ DATE EVALUATED: 7-16-04
PROPOSED FACILITY: SFR PROPOSED DESIGN FLOW (.1949): 480gpd PROPERTY SIZE: _____
LOCATION OF SITE: Lot 7 The Preserve PROPERTY RECORDED: _____
WATER SUPPLY: ☐ Private ☑ Public ☑ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☐ Auger Boring ☑ Pit ☐ Cut
TYPE OF WASTEWATER: ☑ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LAND-SCAPE POSITION/ SLOPE %	HORI-ZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1		0-7	gr brsl sl	FR SSSP	common gravel rock				.3
		7-29	m f SBK RC	FR SSSP					
		29-46	(B-C) WK f SBK grd L	FR SSSP	common ind SAP				
		46-54	massive RD SL SAP	FR SSSP					
2		0-3	gr brsl SL	FR SSSP					<.3
		3-18	m f SBK RC	FR SSSP SAP					
		18-34	(B-C) WK f SBK RCL	FR SSSP	common ind SAP				
		34-57	massive yR L SAP	FR SSSP					
3	#1 TCJ 14"/0 S	0-24	m f SBK RC	FR SSSP					.3
		24-32	WK f SBK RCL	FR SSSP	few gravelly, few ind SAP				
		32-50	massive RL SAP	FR SSSP					
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	Conv 15% Red	Same
Site LTAR	.3	.3

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: [signature]
OTHER(S) PRESENT: Paul Baumgartner


PC = 2+73.82
100.17'
2+00
35' MBL
100.17'
1+00
MBL
10'X70' SIGHT TRIANGLE
PUBLIC R/W
5+00
6+00
7+00
C28
+99.13
C50
100.00'
100.00'
30.82'
ISLE RUN DRIVE
50' PUBLIC R/W
114.92'
51'R
0+00
307.71'
308.90'
6
Septic
#1 Tank
LOT 9A
SEPTIC AREA FOR
LOT 9
168.68'
98.03'
100.01'
100.01'
153.48'
0°42'52" W
1066.17' TOTAL