DEPARTMENT OF ENVIRONMENT, HEALTH, AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: Dienst APPLICANT: _____
ADDRESS: _____ APPLICATION DATE: _____ DATE EVALUATED: 7-16-04
PROPOSED FACILITY: SFR PROPOSED DESIGN FLOW (.1949): 480 gpd PROPERTY SIZE: _____
LOCATION OF SITE: Lot 10 The Preserve PROPERTY RECORDED: _____
WATER SUPPLY: ☐ Private ☐ Public ☑ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☐ Auger Boring ☑ Pit ☐ Cut
TYPE OF WASTEWATER: ☑ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	OTHER PROFILE FACTORS .1943 SOIL DEPTH	OTHER PROFILE FACTORS .1956 SAPRO CLASS	OTHER PROFILE FACTORS .1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	#10A TCS	0-16	MI/sbk brn vfr	frsssp smp					.3
		16-43	wk fsbk rsdl	frsssp					
2	#10 TCS	0-7	gr brn sl/sbk	frsssp					.3
		7-37	m fsbk rc	fr sssp smp					
		39-48	wk fsbk rcl	frsssp					
3	5-10%	0-9	gr brn sl	frsssp					.3
		9-43	mk m fsbk re brn scl	fr sssp smp					
		43-53	m fsbk rc/cl	fr sssp smp					
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	RS	RS
System Type(s)	CAN 25%	LPPBS
Site LTAR	.3	.3

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): VS
EVALUATED BY: DMH
OTHER(S) PRESENT: David Greenough

COMMENTS: _____

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR	LPP .1957 LTAR	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	SI (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SICL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			**MOIST**	**WET**
S (Shoulder Slope)		SLC (Silt Loam Clay)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SIC (Silty Clay)			FI (Firm)	S (Sticky)
					VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None		EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)


NOTES


HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

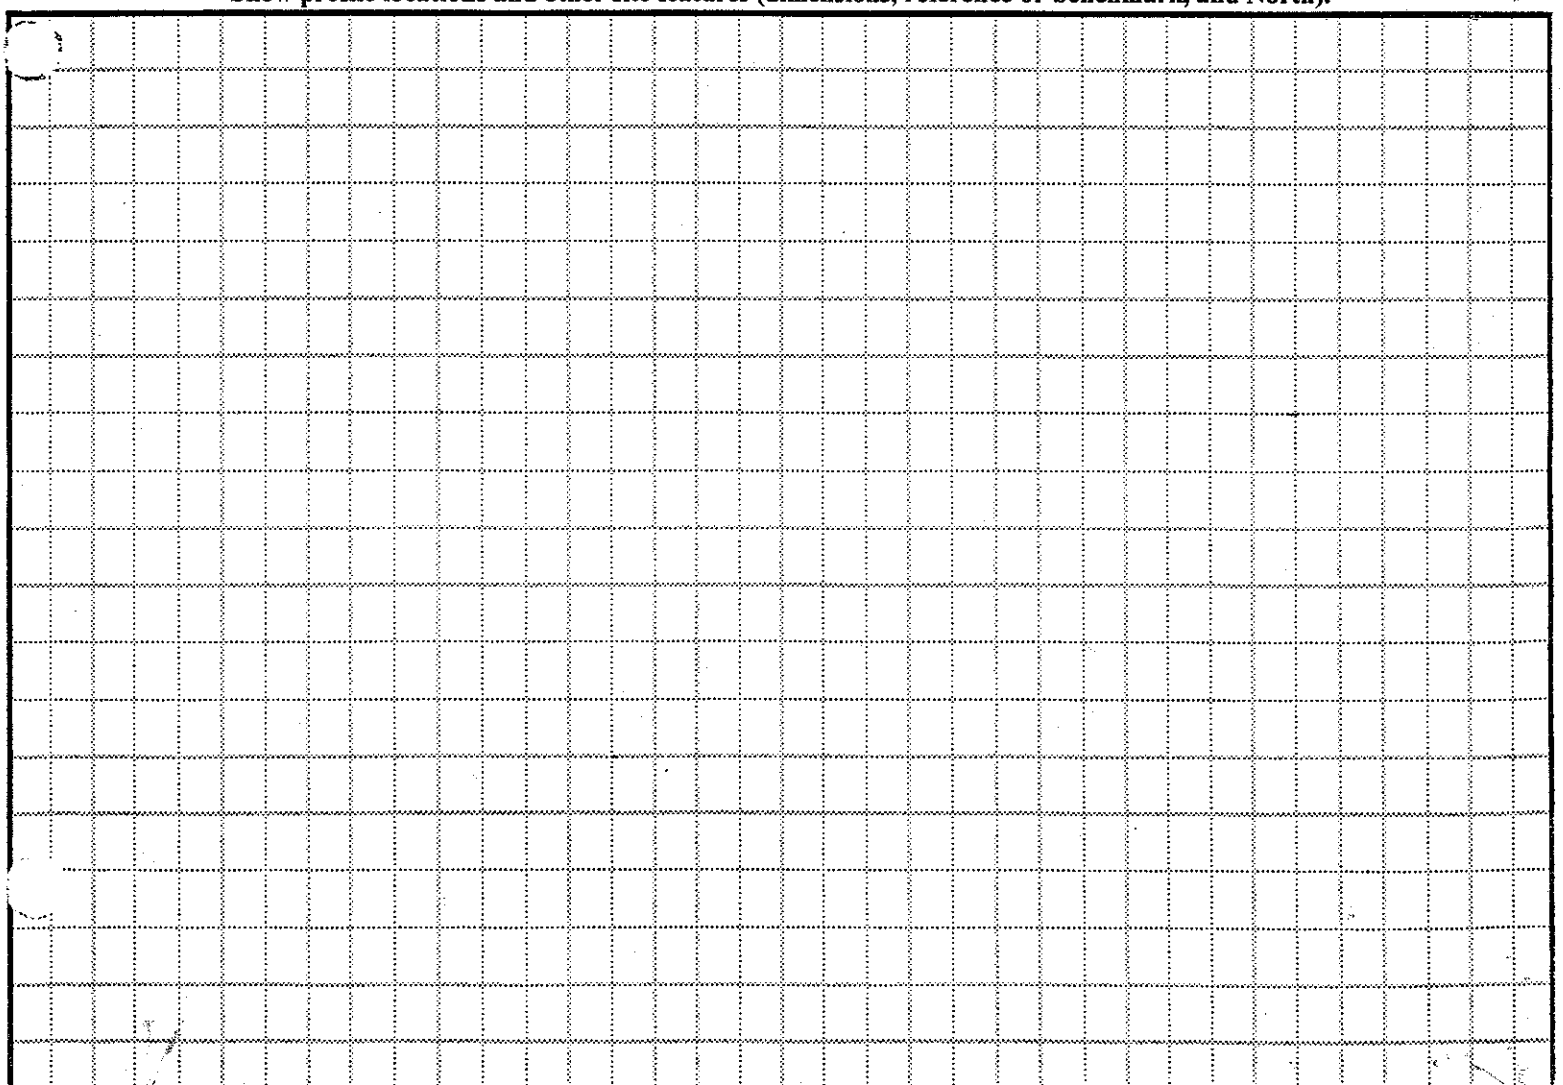

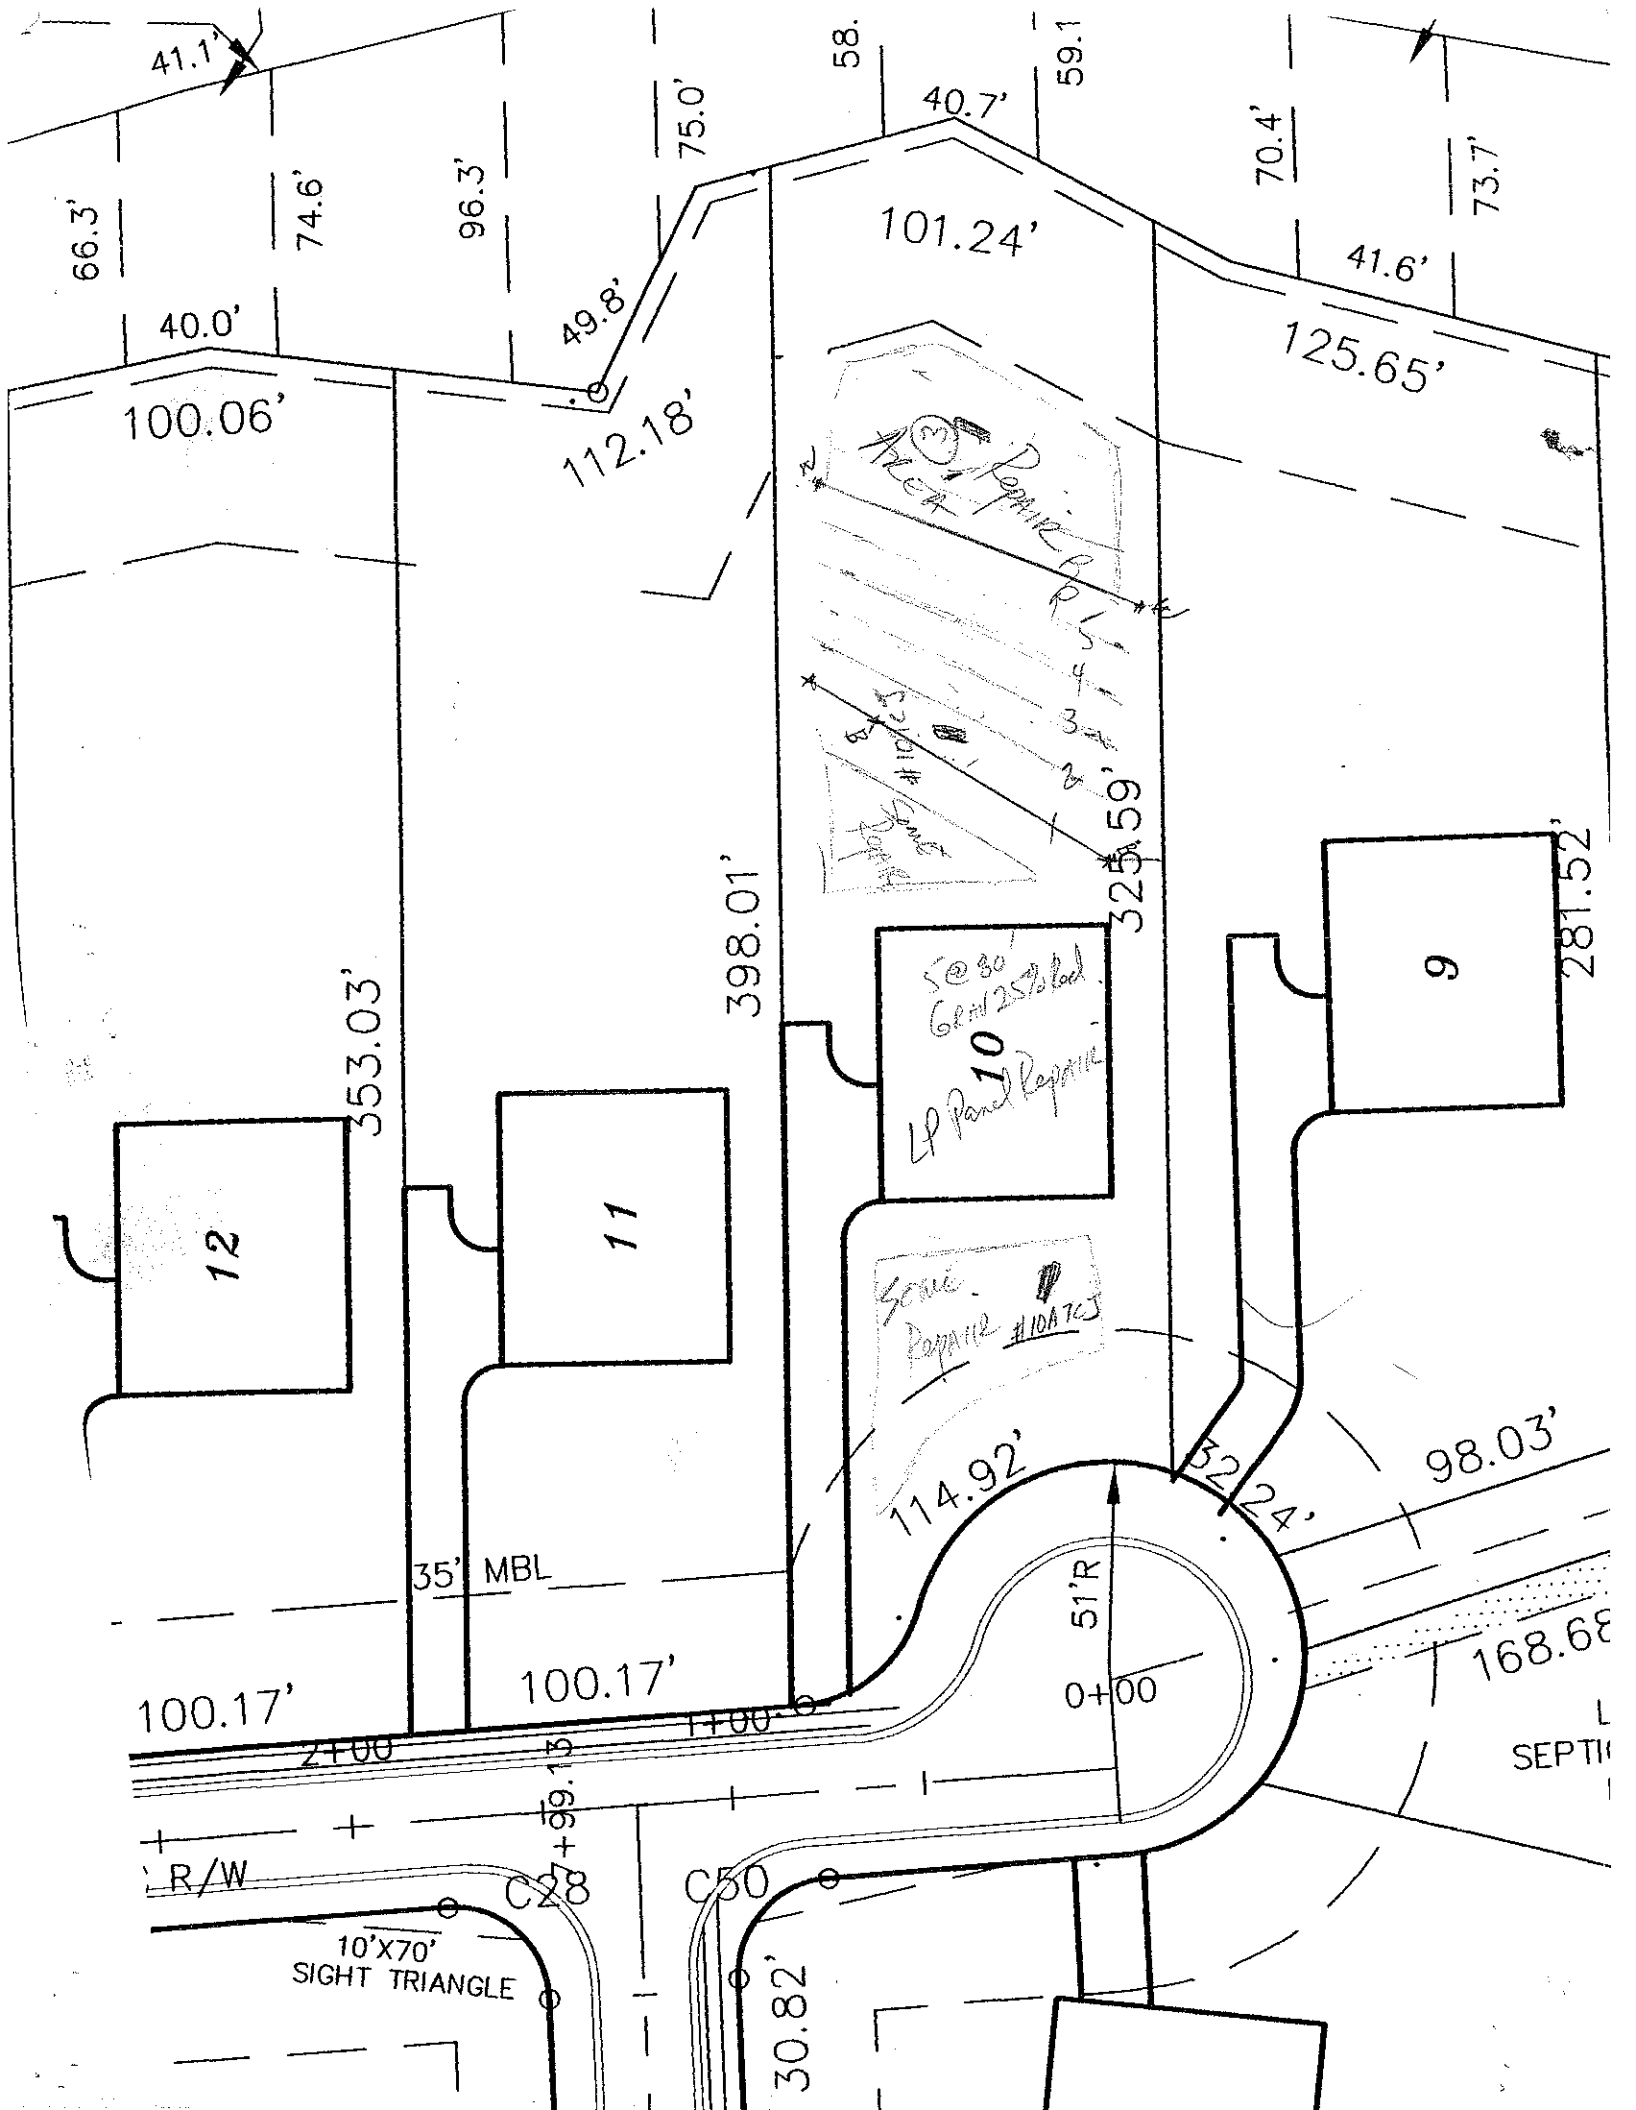
41.1'
66.3'
74.6'
96.3'
75.0'
58.
40.7'
59.1
70.4'
73.7'
101.24'
41.6'
40.0'
49.8'
125.65'
100.06'
112.18'
Repair Area
398.01'
325.59'
281.52'
353.03'
9
10
LP Panel Repair
12
11
Septic Repair
114.92'
32.24'
98.03'
35' MBL
100.17'
100.17'
51'R
0+00
1+00
2+00
99.15
168.68
SEPTI
R/W
C28
C50
10'X70'
SIGHT TRIANGLE
30.82'