DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: Mike Fox APPLICANT: _____
ADDRESS: _____ APPLICATION DATE: _____ DATE EVALUATED: 12/14
PROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): _____ PROPERTY SIZE: _____
LOCATION OF SITE: Stutts Cove Lot #25 PROPERTY RECORDED: _____
WATER SUPPLY: ☐ Private ☐ Public ☐ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☐ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed Complex Topo.

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	OTHER PROFILE FACTORS .1943 SOIL DEPTH	OTHER PROFILE FACTORS .1956 SAPRO CLASS	OTHER PROFILE FACTORS .1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	Pit #1	0-24	Brn Rd/Brn C/C m-w SBK	SS, SP, SE, FFR					PS .25
		24-42	Brn Rd/Brn C m w SBK	SS, SP, SE, FFR w/ many Fi Sap Indics					
2	Pit #2	0-12	Brn SL C/R FR						PS .3 to 40"
		12-32	Rd/Brn C m-w SBK	SS, SP, SE, FFR w/ many Fi Sap Indics					
		32-40	Rd/Brn C w SBK						
		40-42+	Sap/C mix						
3	Alt 1 2/16/99	0-26	Rd/Brn C/C m-w SBK	SS, SP, SE, FFR w/ 50% Yellow Chroma 2 Mottles to Glade					PS .25
		26"-45"	Brn-Gy/Brn C/C						
		45"+	Gy/Brn C w/ Chroma 1 Mottles						
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		
System Type(s)		
Site LTAR		

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): _____
EVALUATED BY: _____
OTHER(S) PRESENT: _____

DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: Mike Fox APPLICANT: _____

ADDRESS: _____ APPLICATION DATE: _____ DATE EVALUATED: 2/18/05

PROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): _____ PROPERTY SIZE: _____

LOCATION OF SITE: Stokes Cove Lot 284 PROPERTY RECORDED: _____

WATER SUPPLY: ☐ Private ☐ Public ☐ Well ☐ Spring ☐ Other _____

EVALUATION METHOD: ☐ Auger Boring ☐ Pit ☐ Cut

TYPE OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1		0-10	Rd Brn to Brn SiL		S-SS, SR, SG, Fi-PR many SP Indics SS, SR, SG PR				PS .3
		10-24	Rd/Brn CiL	mSBK					
		24-40	Rd/Brn Cl - w/few to						
2									
3									
4									

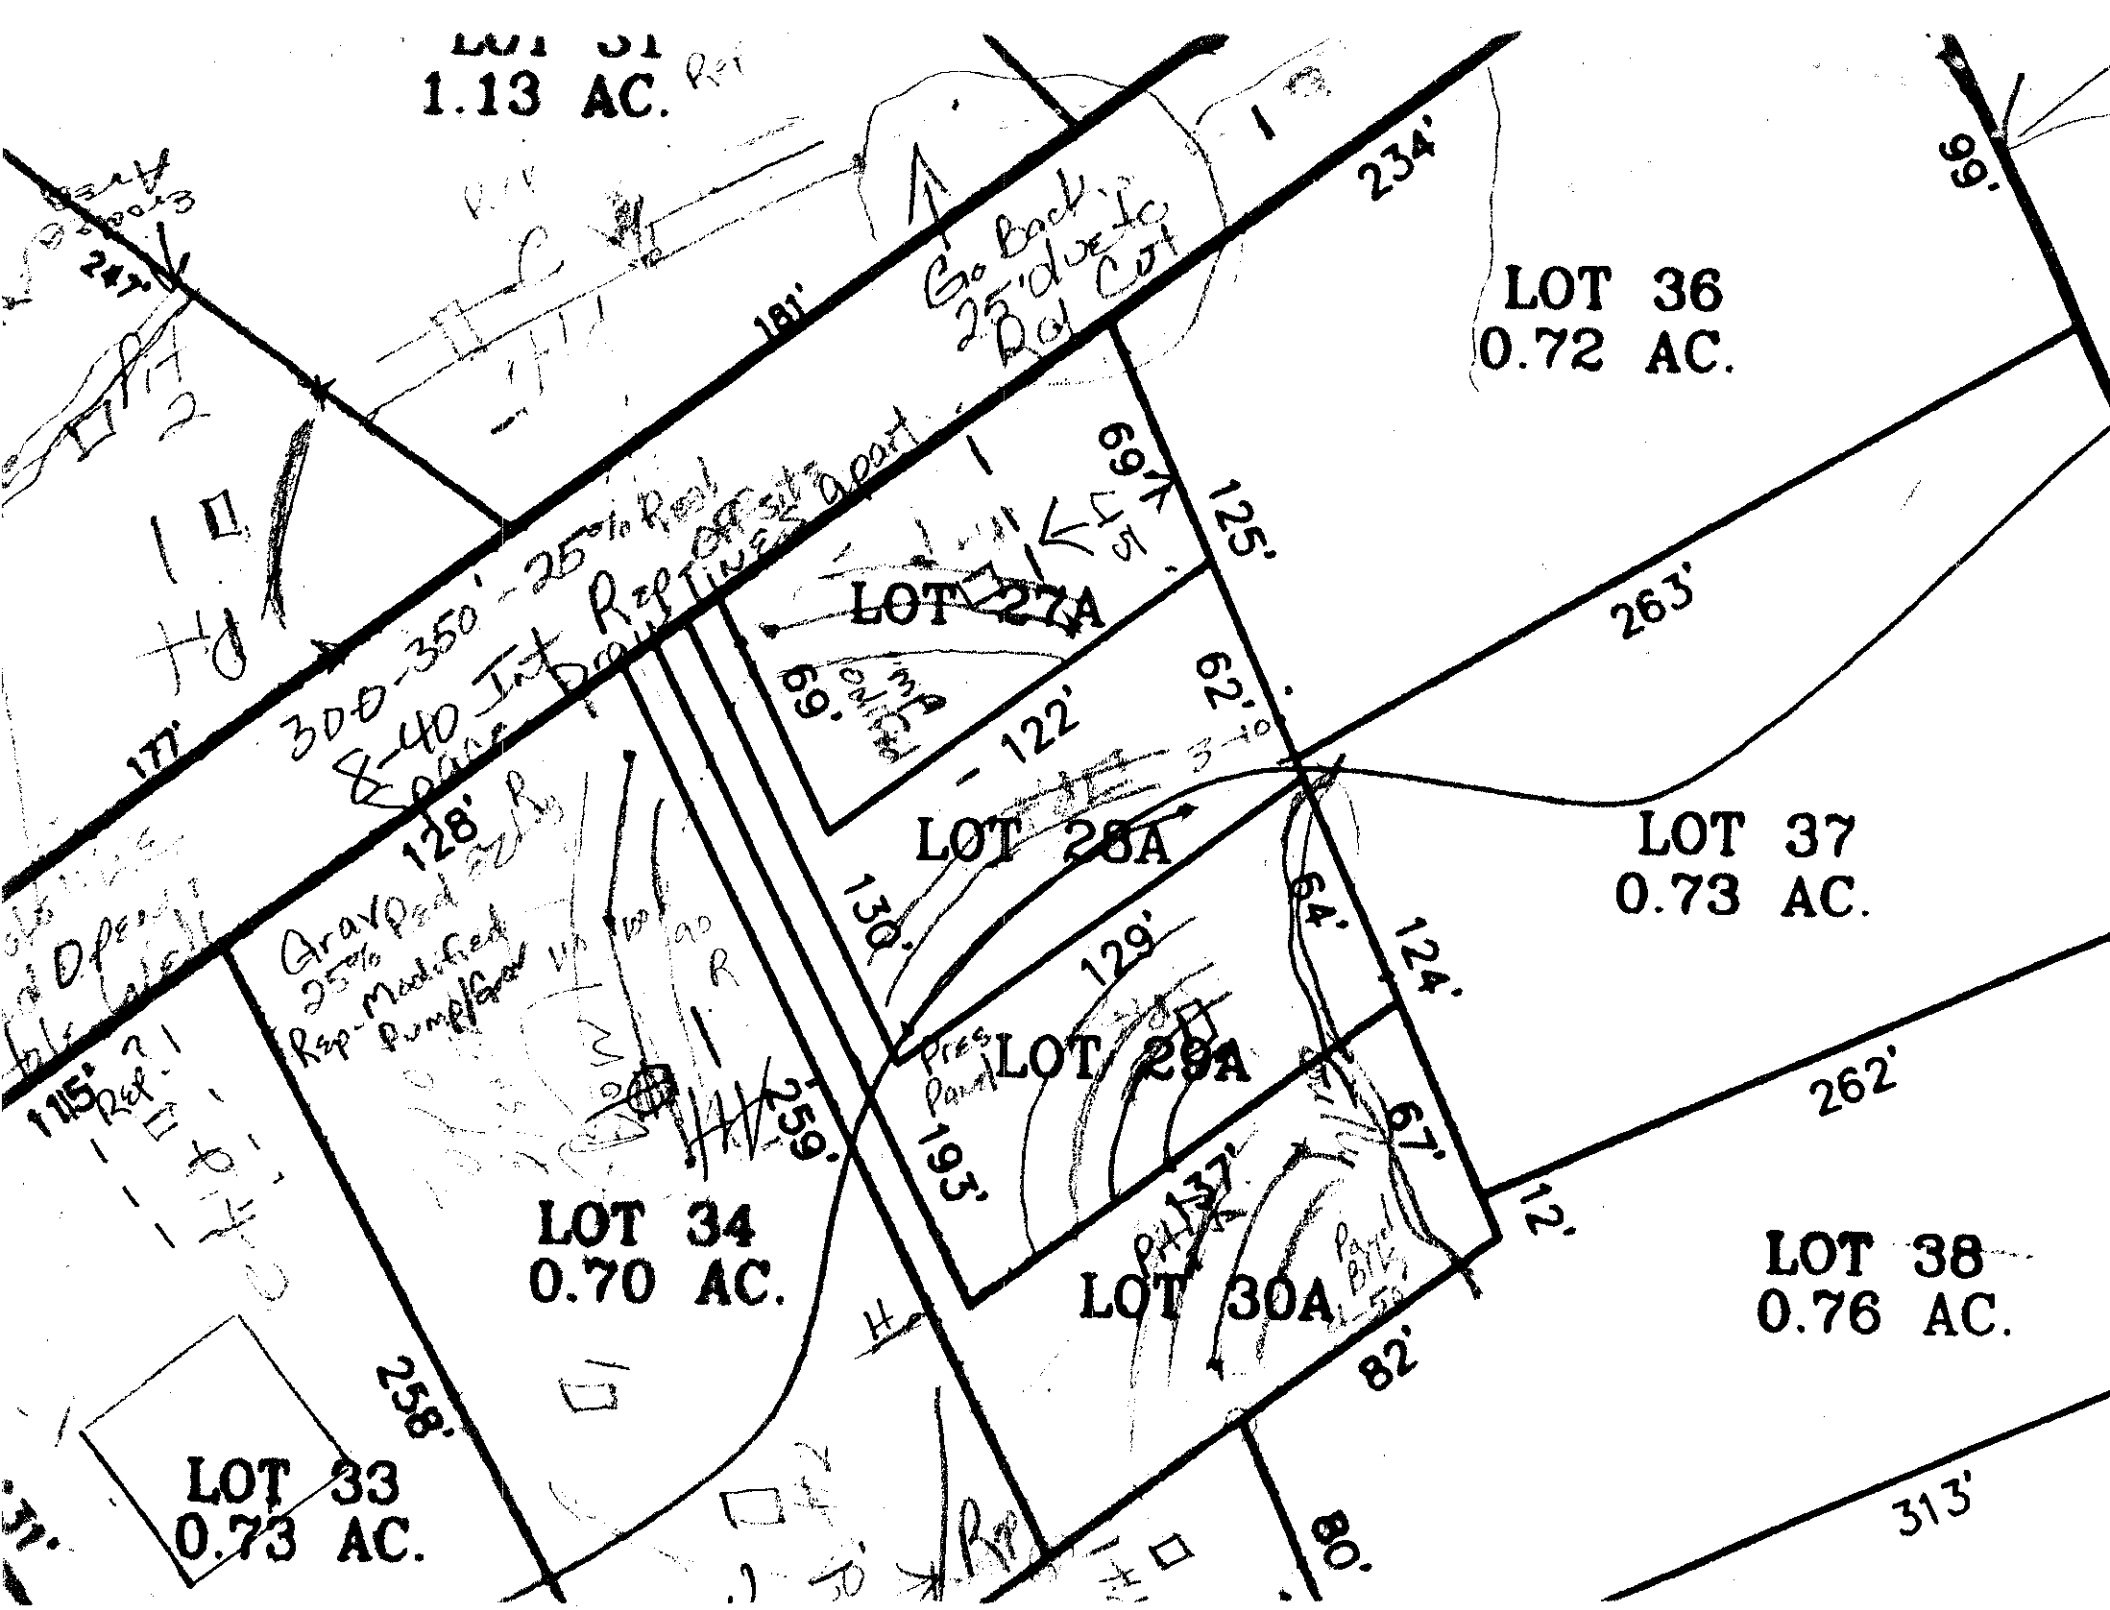
DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		
System Type(s)		
& LTAR		

OTHER FACTORS (.1946): _____

SITE CLASSIFICATION (.1948): _____

EVALUATED BY: _____

OTHER(S) PRESENT: _____


LOT 31
1.13 AC.
LOT 36
0.72 AC.
LOT 27A
LOT 28A
LOT 29A
LOT 30A
LOT 37
0.73 AC.
LOT 38
0.76 AC.
LOT 34
0.70 AC.
LOT 33
0.73 AC.
Go Back 25' to Ex Rd Cut
300-350' - 25% Real
& 40 Int Rep Off Site Board
Gravel 25% Rep-Mud Ged Pumpfloor
Press Panel
Pay Box
234'
99'
181'
177'
115'
125'
263'
69'
62'
64'
124'
130'
129'
128'
122'
259'
258'
193'
137'
67'
262'
82'
80'
313'