DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ *of* ___
PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

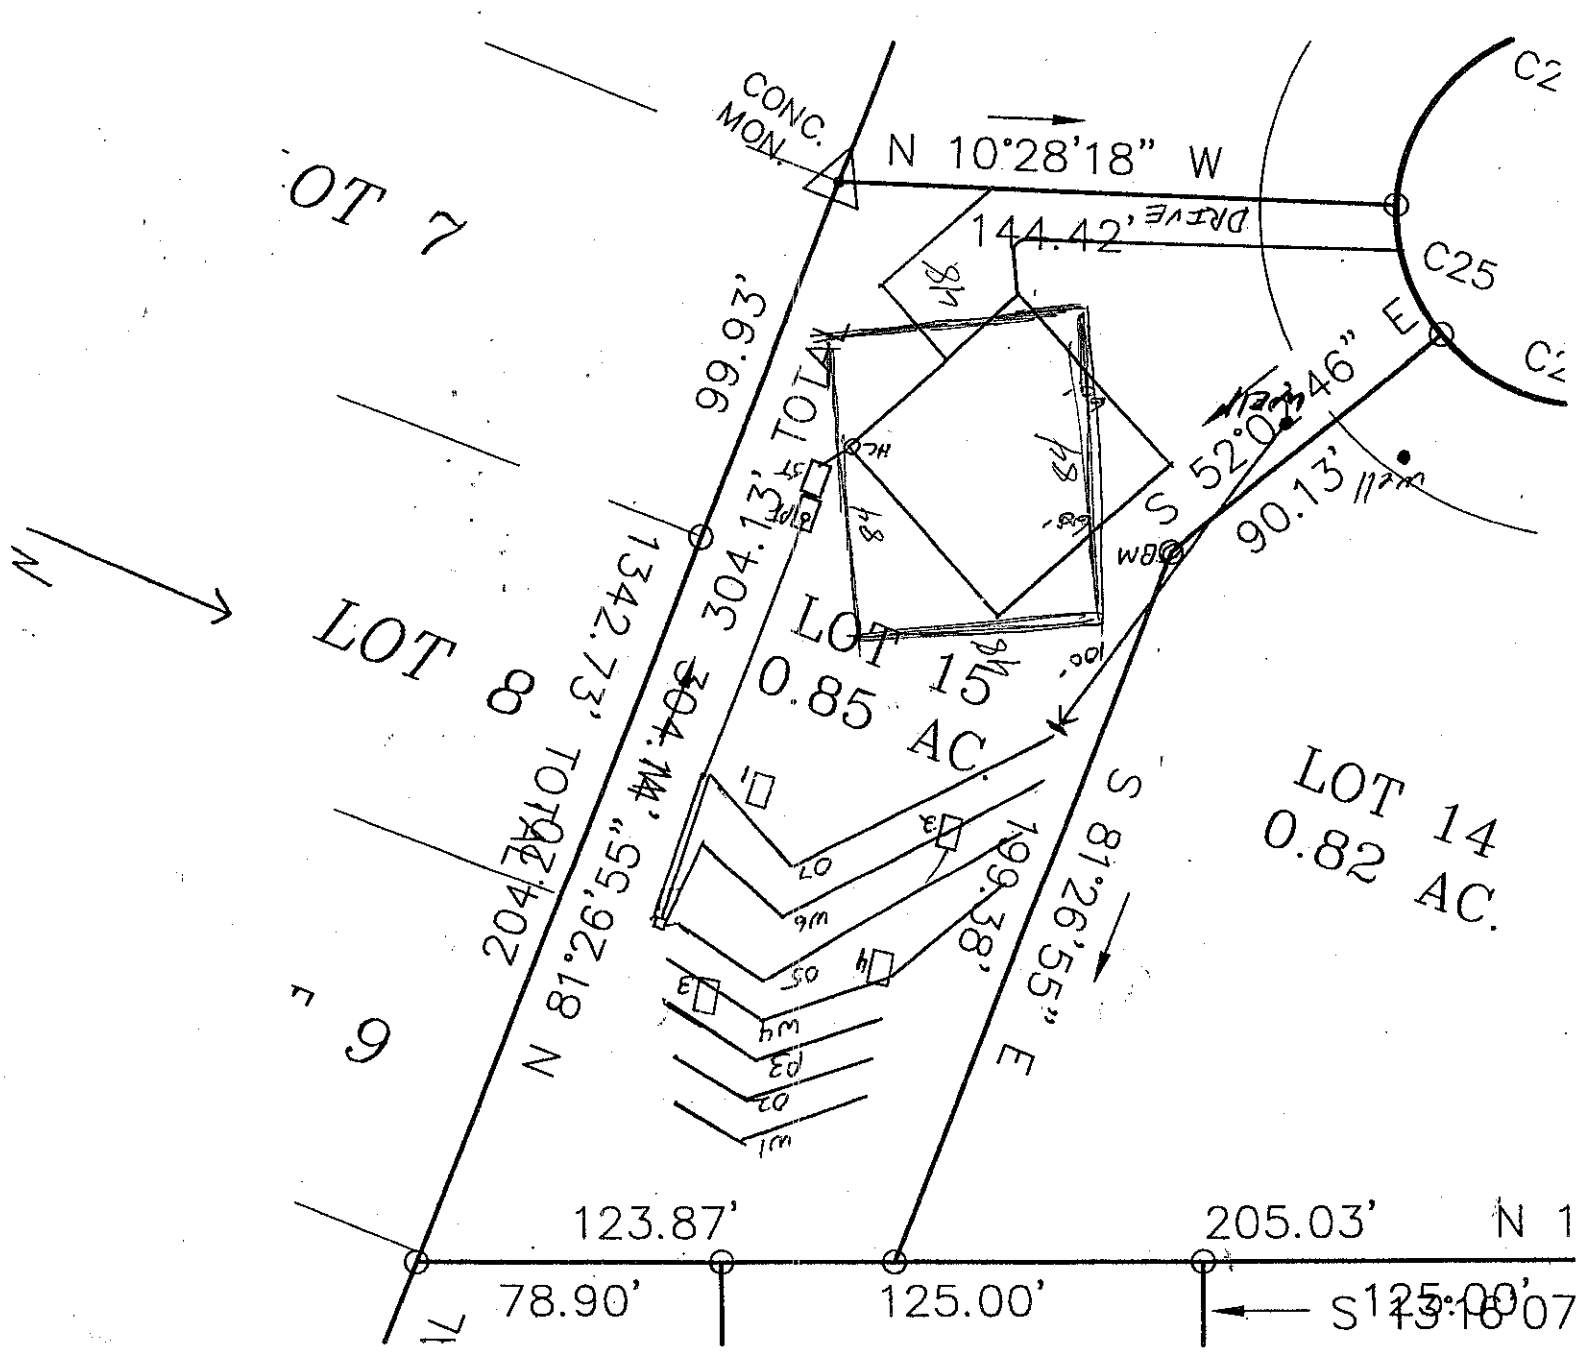
OWNER: _Mike Fox_____ APPLICATION DATE_____
ADDRESS:_____ DATE EVALUATED: _____
PROPOSED FACILITY: _4 bedroom_____ PROPOSED DESIGN FLOW (.1949): _480 GPD____ PROPERTY SIZE: _____
LOCATION OF SITE: _Stutts Cove lot 15_____ PROPERTY RECORDED: _____
WATER SUPPLY: ☒ Private ☐ Public ☒ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☐ Auger Boring ☒ Pit ☐ Cut TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941)		OTHER PROFILE FACTORS				PROFILE CLASS & LTAR
			.1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	.1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	
1	LS 3%	0-24	R CL WSBK	FR SS SP		24"	PS	Soils OK	PS 0.4-0.5
		24-60	Ver SL SAP M	VFR SS SP					
2	LS 3%	0-25	R CL WSBK	FR SS SP		25"	PS	CMK 9/14/13	PS 0.4-0.5
		25-62	Ver SL SAP M	VFR SS SP					
3	LS 3%	0-10	FILL				PS		PS 0.5
		10-67	Ver SL SAP M	VFR SS SP					
4	LS 3%	0-11	R CL WSBK	FR SS SP		11"	PS		PS 0.5
		11-72	Ver SL SAP M	VFR SS SP					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	900 FT2	400 FT2
System Type(s)	25% Reduction	PPBPS
Site LTAR	0.4	0.4

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): _____
EVALUATED BY: ___M A & Assoc_____
OTHER(S) PRESENT: _____

COMMENTS:_____


CONC. MON.
N 10°28'18" W
144.42'
DRIVE
C2
C25
C2
99.93'
TOTAL
304.13'
S 52°0
46" E
90.13'
LOT 15
0.85 AC.
LOT 8
LOT 7
LOT 14
0.82 AC.
1342.73' TOTAL
204.20'
N 81°26'55" W 304.14'
S 81°26'55" E
199.38'
123.87'
205.03'
N 1
78.90'
125.00'
S 13°18'07