Department of Environment, Health, and Natural Resources
Division of Environmental Health
On-site Wastewater Section

Sheet: 1 OF 1
PIN #: 4636-60-0510
Lot #: 7
Permit #: 207595
AppID:

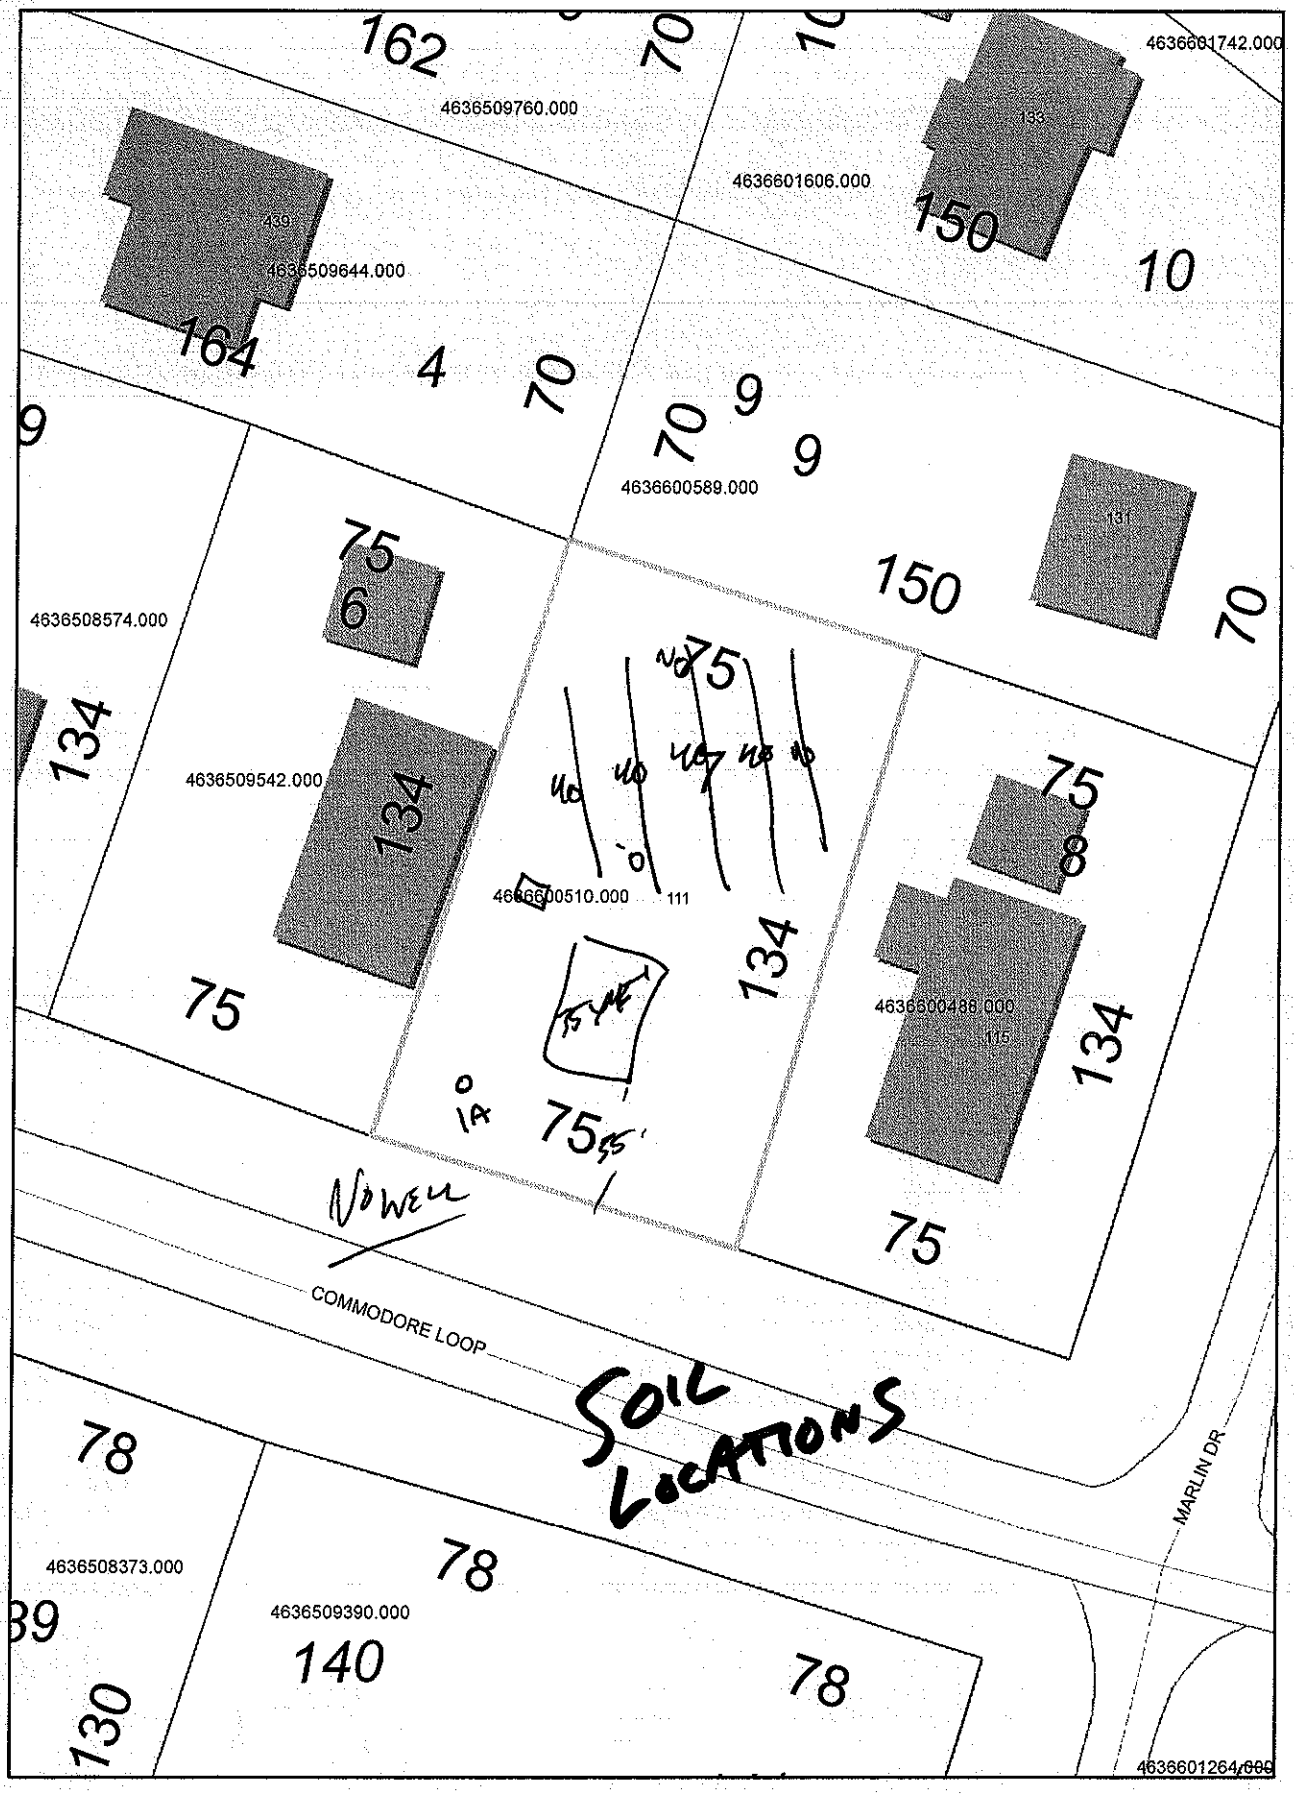
SOIL/SITE EVALUATION for ON-SITE WASTEWATER SYSTEM

Owner: WARREN GREENLEE
Applicant: SAME
Address: 136 MARINA LN.
Date Evaluated: 1/16/2015 (1A DONE 7-21-16)
Proposed Facility: SFR
Design Flow (.1949) 360
Property Size: .23 AC
Location of Site: COMMODORE PENNINSULA LOT 7
Property Recorded: YES
Water Supply: [X] Public [ ] Individual [X] Well [ ] Spring [ ] Other
Evaluation Method: [X] Auger Boring [ ] Pit [ ] Cut
Type of Wastewater: [X] Sewage [ ] Industrial Process [ ] Mixed

PROFILE #	.1940 Landscape Position/ Slope%	Horizon Depth (IN.)	SOIL MORPHOLOGY .1941 .1941 Structure/ Texture	.1941 Consistence Mineralogy	b PROFILE FACTORS .1942 Soil Wetness/ Color	.1943 Soil Depth (IN.)	.1956 Sapro Class	.1944 Restr Horiz	Profile Class & LTAR
AB 1	3% LINEAR	0-14	SCL,W,SBK	SS	NA	48"	NA	48"+	.3
		14-43	C,M,SBK	SS					
		43-48	CL,M,SBK	SS					
AB 2	3% LINEAR	0-36	C,M,SBK	SS	NA	46"	S	50"+	.3
		36-46	CL,M,SBK	SS					
		46-50	LSAP	NS					
AB 1A	3% LINEAR	0-12	CL,M,SBK	SS	NA	50"	NA MANY INC @ 20-50"	50"+	.3
		12-20	C,M,SBK	SS					
		20-50	CL,M,SBK	SS					

Description	Initial System	Repair System
Available Space (.1945)	PS	NA
System Type(s)	PANEL BLOCK	NA
Site LTAR	.3	NA

Other Factors (.1946): REPAIR NOT REQUIRED
Soil Evaluation By: BEN ALDRIDGE
Others Present: NONE
Site Classification (.1948): PS
Site Evaluation By: BEN ALDRIDGE
Others Present: NONE


4636601742.000
4636509760.000
4636601606.000
4636509644.000
4636600589.000
4636508574.000
4636509542.000
4636600510.000
4636600486.000
COMMODORE LOOP
MARLIN DR
SOIL LOCATIONS
4636508373.000
4636509390.000
4636601264.000