DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ____ of ____
PROPERTY ID #: ____
COUNTY: ____

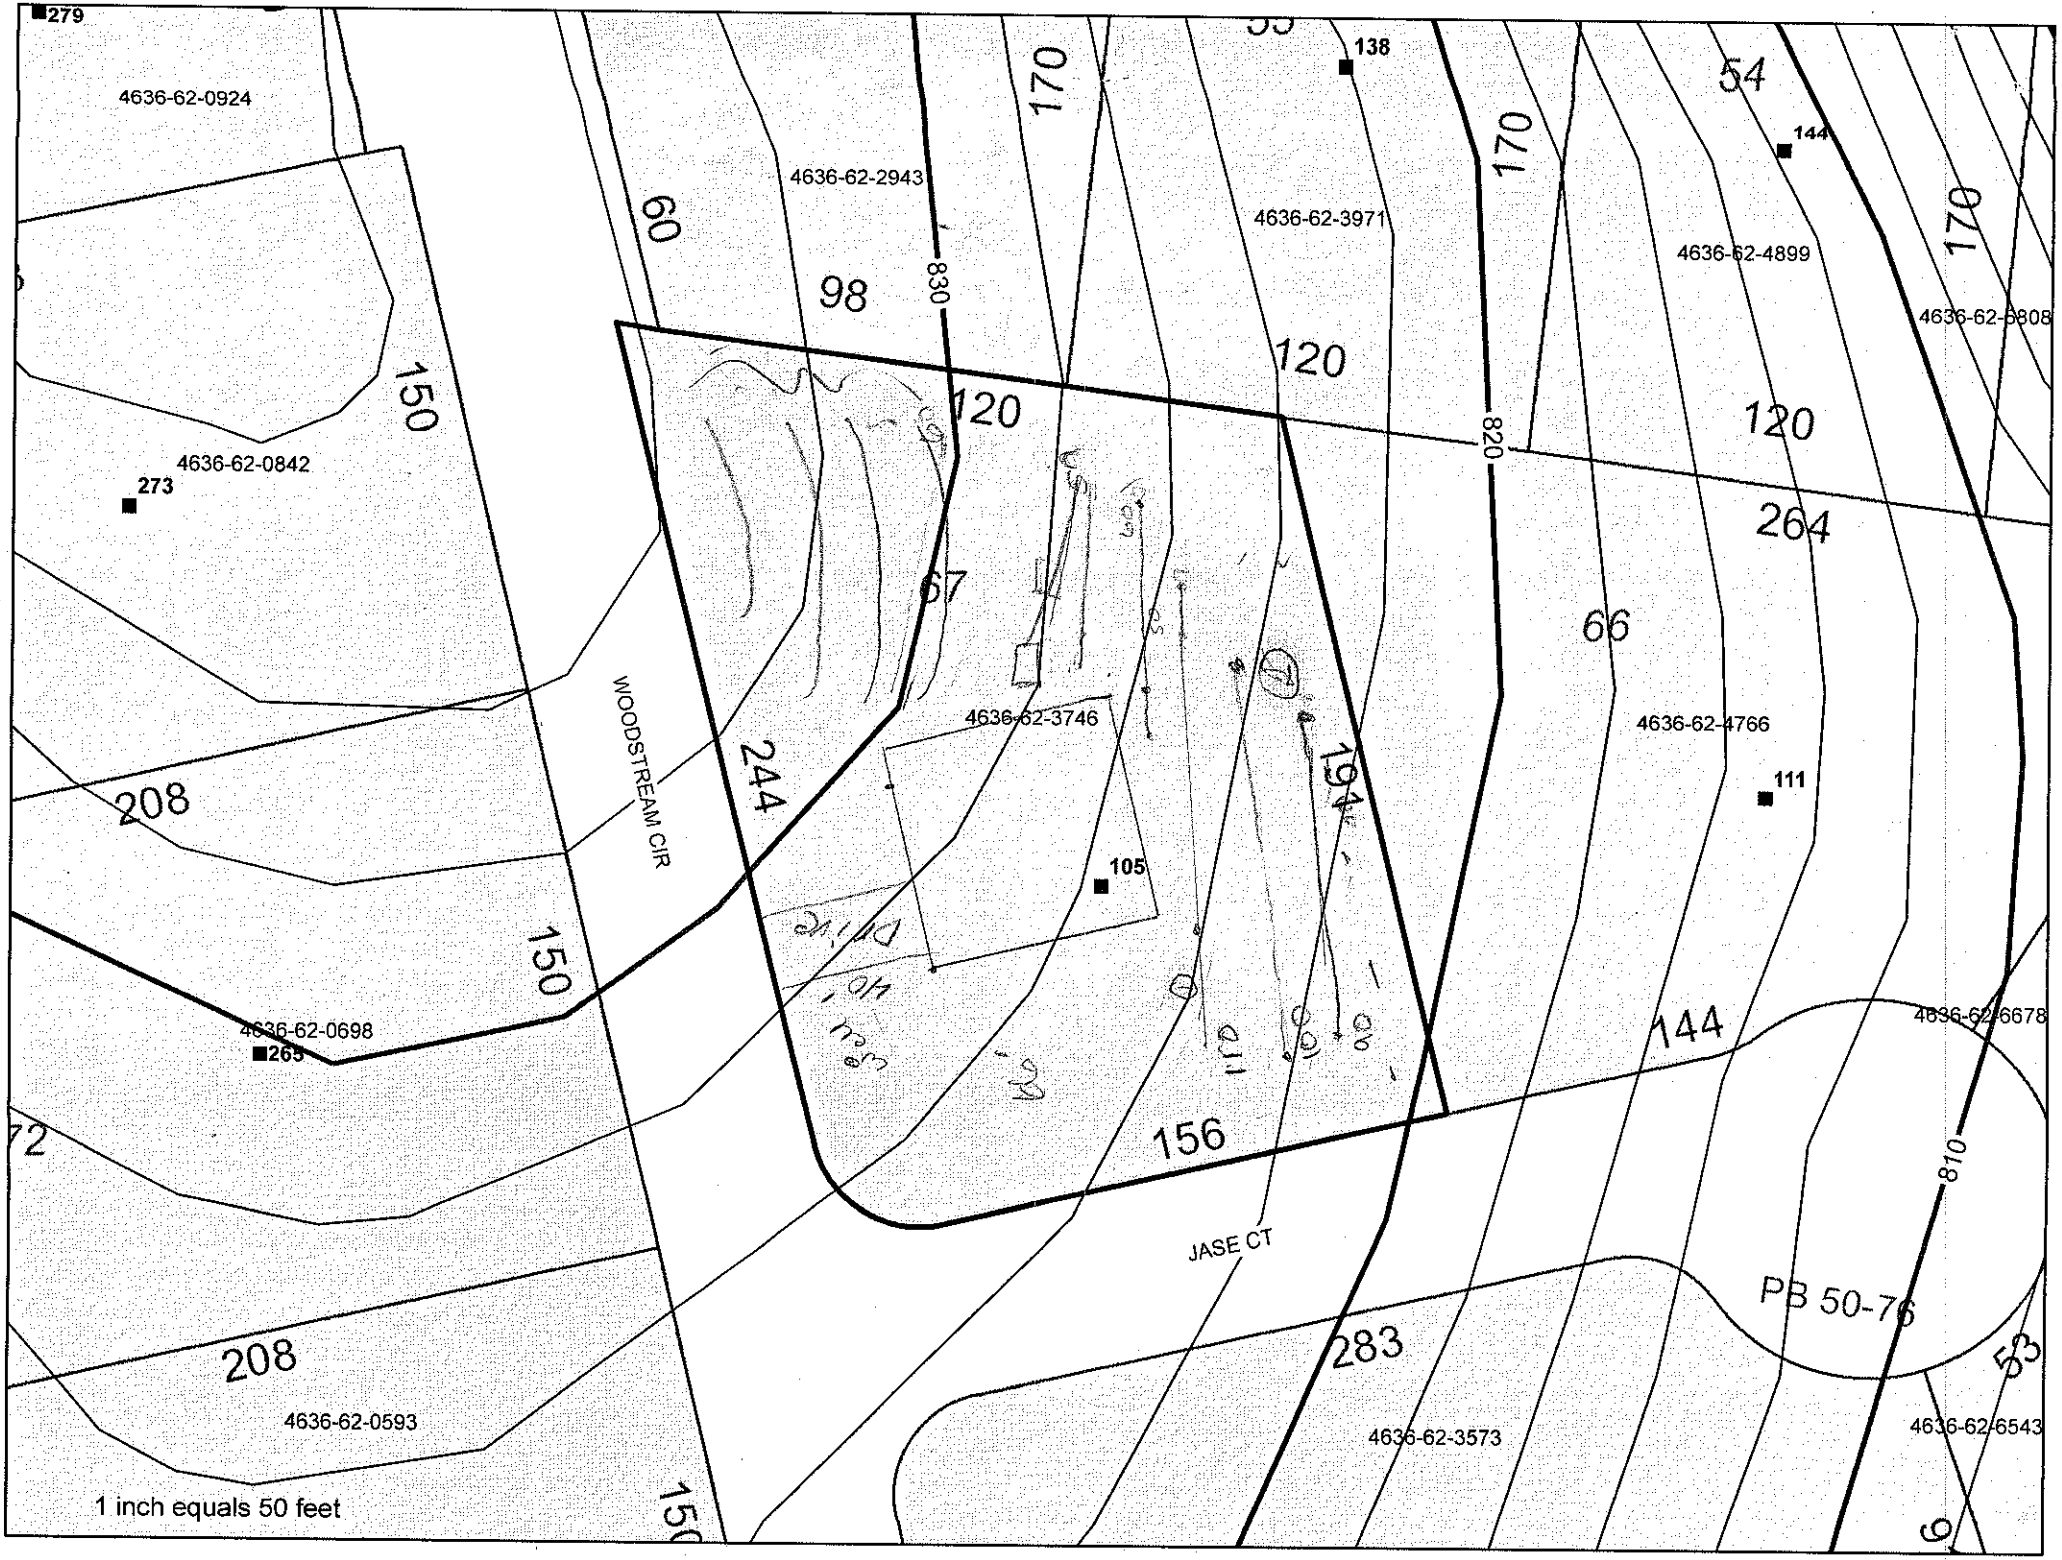
SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: Carolina Builders — APPLICATION DATE ____
ADDRESS: ____ — DATE EVALUATED: 10-9-03
PROPOSED FACILITY: ____ — PROPOSED DESIGN FLOW (.1949): 480 gpd — PROPERTY SIZE: ____
LOCATION OF SITE: Norman Woods #66 — PROPERTY RECORDED: ____
WATER SUPPLY: ☐ Private ☐ Public ☐ Well ☐ Spring ☐ Other ____
EVALUATION METHOD: ☐ Auger Boring ☐ Pit ☐ Cut — TYPE OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	sideslope	0-26	ms sbk/f-abk c	fr sss sp	Red				
		26-48	wk sbk cl	fr sss p	Red		f-sap 40"+		.3
2	pit to 38" auger to 50"	0-38	ms sbk/f-abk c	fr sss p	Red				
		38-50	wk sbk cl	fr sss p	Red				.3
3		0-6	wk gr sl		Br				
		6-36	mr sbk c		Red				.3
		36-	wk sbk cl						
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	yes	yes
System Type(s)	2590	Pond
Site LTAR	.3	.3

OTHER FACTORS (.1946): ____
SITE CLASSIFICATION (.1948): ____
EVALUATED BY: T Melville
OTHER(S) PRESENT: ____
COMMENTS: ____


279
4636-62-0924
4636-62-2943
138
4636-62-3971
144
4636-62-4899
4636-62-5808
4636-62-0842
273
WOODSTREAM CIR
4636-62-3746
105
4636-62-4766
111
4636-62-0698
265
JASE CT
PB 50-76
4636-62-6678
4636-62-0593
4636-62-3573
4636-62-6543
60
98
830
170
120
820
264
67
66
150
208
244
194
156
144
810
283
53
1 inch equals 50 feet