DEPARTMENT OF ENVIRONMENT, HEALTH, AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ *of* ___
PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

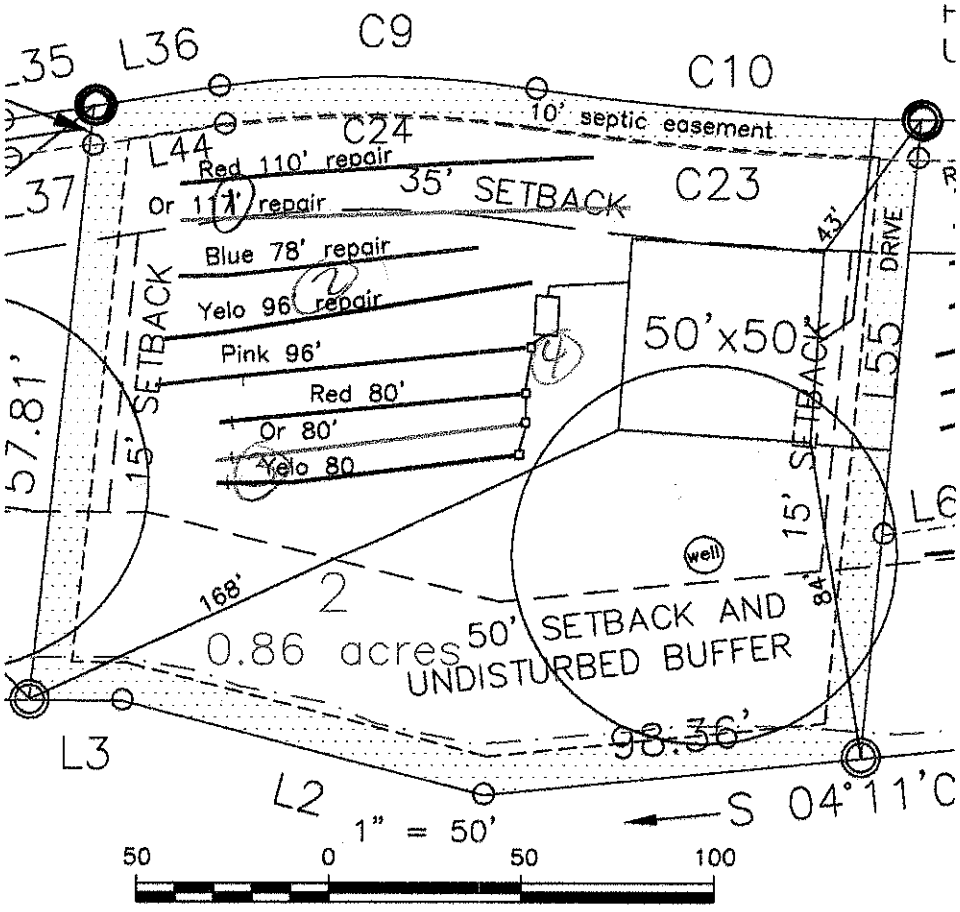
OWNER: _____ APPLICANT: _____
ADDRESS: _____ APPLICATION DATE: _____ DATE EVALUATED: _____
PROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): _____ PROPERTY SIZE: _____
LOCATION OF SITE: Pinewood Ks Lot 2 PROPERTY RECORDED: _____
WATER SUPPLY: ☑ Private ☐ Public ☐ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☐ Auger Boring ☑ Pit ☐ Cut
TYPE OF WASTEWATER: ☑ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	OTHER PROFILE FACTORS .1943 SOIL DEPTH	OTHER PROFILE FACTORS .1956 SAPRO CLASS	OTHER PROFILE FACTORS .1944 RESTR HORIZ	PROFILE CLASS & LTAR
1		0-5	c-vl sbk	Prssp					AS 0.3
		Common Incl sap							
2		0-8	sl sbk	fr sssp					AS 0.3
		8-53	c sbk	fr sssp					
			Incl sap @ 41"						
3		0-8	sl gr	fr sssp					AS 0.3
		8-50	c sbk	fr sssp					
			Incl sap	fr sssp					
4		0-7	sl gr	fr sssp					AS 0.3
		7-52	c sbk	fr sssp					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		
System Type(s)		
Site LTAR		

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): _____

EVALUATED BY: _____
OTHER(S) PRESENT: _____


L35
L36
C9
C10
10' septic easement
C24
L44
Red 110' repair
Or 111' repair
35' SETBACK
C23
Blue 78' repair
Yelo 96' repair
Pink 96'
Red 80'
Or 80'
Yelo 80
43'
DRIVE
50'x50'
L55
15' SETBACK
57.81'
15' SETBACK
L6
well
168'
2
0.86 acres
50' SETBACK AND
UNDISTURBED BUFFER
84'
98.36'
L3
L2
S 04°11'C
1" = 50'
50
0
50
100