4636943272

IREDELL COUNTY HEALTH DEPARTMENT

(SEPTIC TANK) IMPROVEMENTS PERMIT AND CERTIFICATE OF COMPLETION

(Ground Absorption Sewage Disposal System -- G. S. Chapter 130-Article 13C)

OWNER OR CONTRACTOR Frank Phillips DATE Jan. 15, '87 PERMIT NO. 26

PHONE: Business ______ Home ______

LOCATION 1100 TL 1179 (Canvas Back) TL Broad Bill TR Ringneck 2nd lot on left S. R. No. ______

SUBDIVISION NAME Woodland Hills LOT NO. 84 SECTION OR BLOCK NO. 4


House (✓) Mobile Home ( ) Business ( ) Other ______

No. Bedrooms 3 No. Bathrooms 2½

Garbage Disposal Unit	Yes (✓)	No ( )	Character & Porosity of Soil	clay
Auto. Dishwasher	Yes (✓)	No ( )	Percolation Rate	~.5
Auto. Wash. Machine	Yes (✓)	No ( )	Topography	4-6%
Site Suitable	Yes (✓)	No ( )	Depth to Water Table	44"
			Rock or other impervious formations	none obs.

Lot Area ~½ Ac

______ Basement with Plumbing ______ Basement without Plumbing ______ No Basement

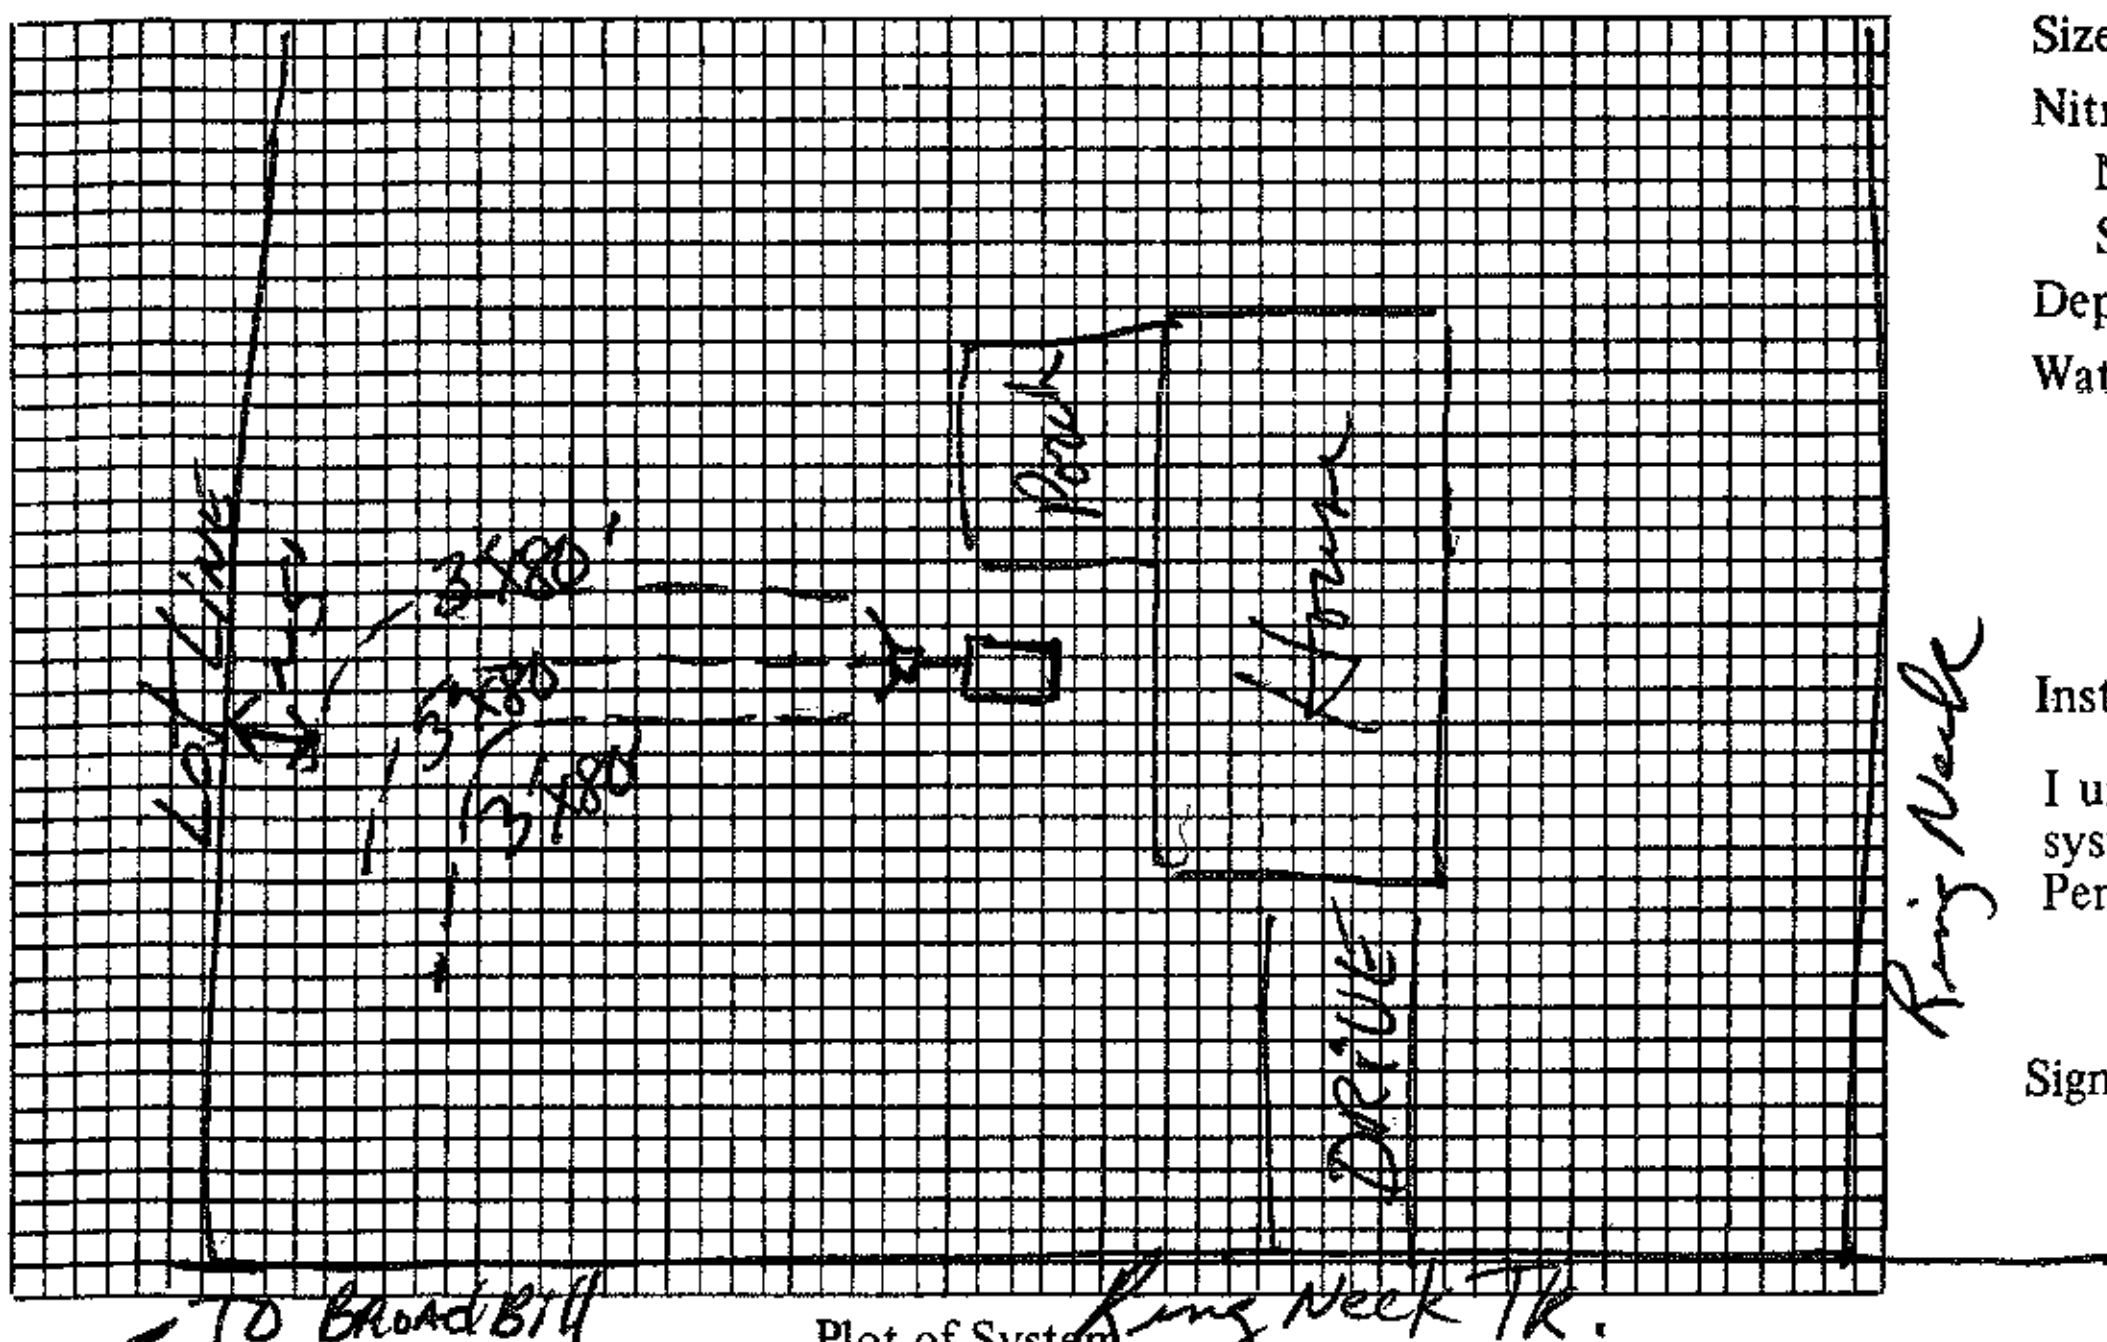

Plot of System

Size of Tank 1250 Gals.

Nitrification Field:

No. of Lines 3

Sq. Ft. 720 Linear Ft. 240

Depth of Stone in Lines 12"

Water Supply: Individual ( )

Public (✓)

Installed by Larry Beam

I understand and agree to install septic tank system as specified on this Improvements Permit.

Signed: ______

IMPROVEMENTS PERMIT BY KRS

COMMENTS: Drainfield had to be turned as shown to stay minimum distance off lot line.

CERTIFICATE OF COMPLETION BY DR Hinson, RS. DATE Jan. 15 '87

EXISTING SYSTEM CHECKED BY: ______ DATE ______

CONSTRUCTION MUST COMPLY WITH ALL OTHER APPLICABLE STATE AND LOCAL REGULATIONS.

Permit is VOID if any unauthorized changes are made in installation of system and/or if any false information is supplied in making Improvements Permit.

Health Dept. Copy: White Inspection Dept. Copy: Yellow Sanitarian's Copy: Pink Owner's Copy: Gold