DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: Stumpy Creek LLC APPLICANT: _____
ADDRESS: _____ APPLICATION DATE: _____ DATE EVALUATED: 6-5-98
PROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): _____ PROPERTY SIZE: _____
LOCATION OF SITE: Lot 61 Sect 4 Harbor Landing PROPERTY RECORDED: _____
WATER SUPPLY: ☐ Private ☐ Public ☐ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☐ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1		0-12	gr brn sl/scl	fr					PS .3
		12-46	sbk rc/cl	fr sp-ss sp sop					
			few fine id soap						
2		0-6	brn cl	fr					PS .3
		6-48	sbk rc/cl	fr sp-ss sp so					
			few ind soap/gravel						
3		0-36	sbk rc/cl	fr sp-ss sp so					PS .3 @ 36"
		36+	rocky						
4	L 2-12% 6-6-98	0-3	gr brn sl/scl						PS .3 @ 38"
		3-24	sbk rc	fr sp soap					
		24-36+	wk stratified gravel	few ind soap fr-fr ss sp soap					
			Pit only 36" deep						

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		
System Type(s)		
Site LTAR		

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): _____
EVALUATED BY: _____
OTHER(S) PRESENT: _____

DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM


OWNER: Stoney Point LLC — APPLICANT: _____
ADDRESS: _____ — APPLICATION DATE: _____ — DATE EVALUATED: 8-31-98
PROPOSED FACILITY: _____ — PROPOSED DESIGN FLOW (.1949): _____ — PROPERTY SIZE: _____
LOCATION OF SITE: Lot 61 continued — PROPERTY RECORDED: _____
WATER SUPPLY: ☐ Private ☐ Public ☐ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☐ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR. HORIZ.	PROFILE CLASS & LTAR
5 1		0-12	sdy [illegible]	[illegible]	[illegible]	[illegible]	[illegible]	[illegible]	* PS .3
		12-10	wk sbk yp cl	mdy gra sa w/ [illegible]	-grd w/ [illegible]	19"-42"			
						predominately silt			
6 2		0-4	gr lgm sl/scl fr						PS .25
		4-22	SBK/GR RC	fr-fr SO SESW					
		22-48	wk fine masses yp cl	fr SSO SSP					
			few common gbm mottles	[illegible]					
3									
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		
System Type(s)		
Site LTAR		

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): _____
EVALUATED BY: _____
OTHER(S) PRESENT: _____

9-29-98 - Davis would like road formed, pump to creek

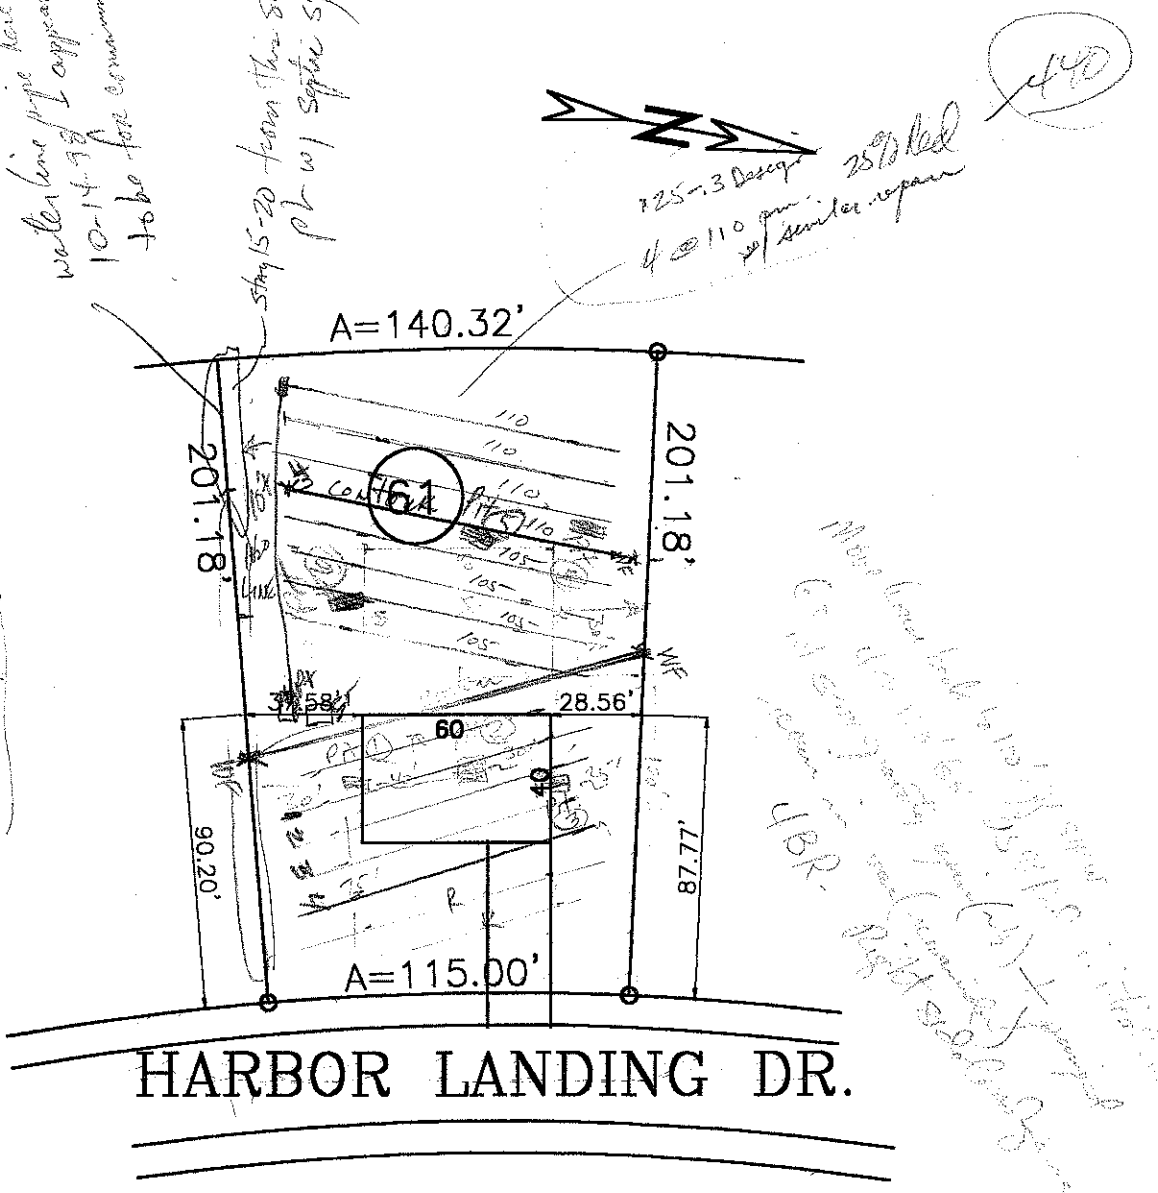

LOT #61
HARBOR LANDING

DAVIDSON TOWNSHIP
APRIL 05, 1998

IREDELL COUNTY, NC
SCALE: 1" = 60'