DEPARTMENT OF ENVIRONMENT, HEALTH, AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: _____
COUNTY: _____

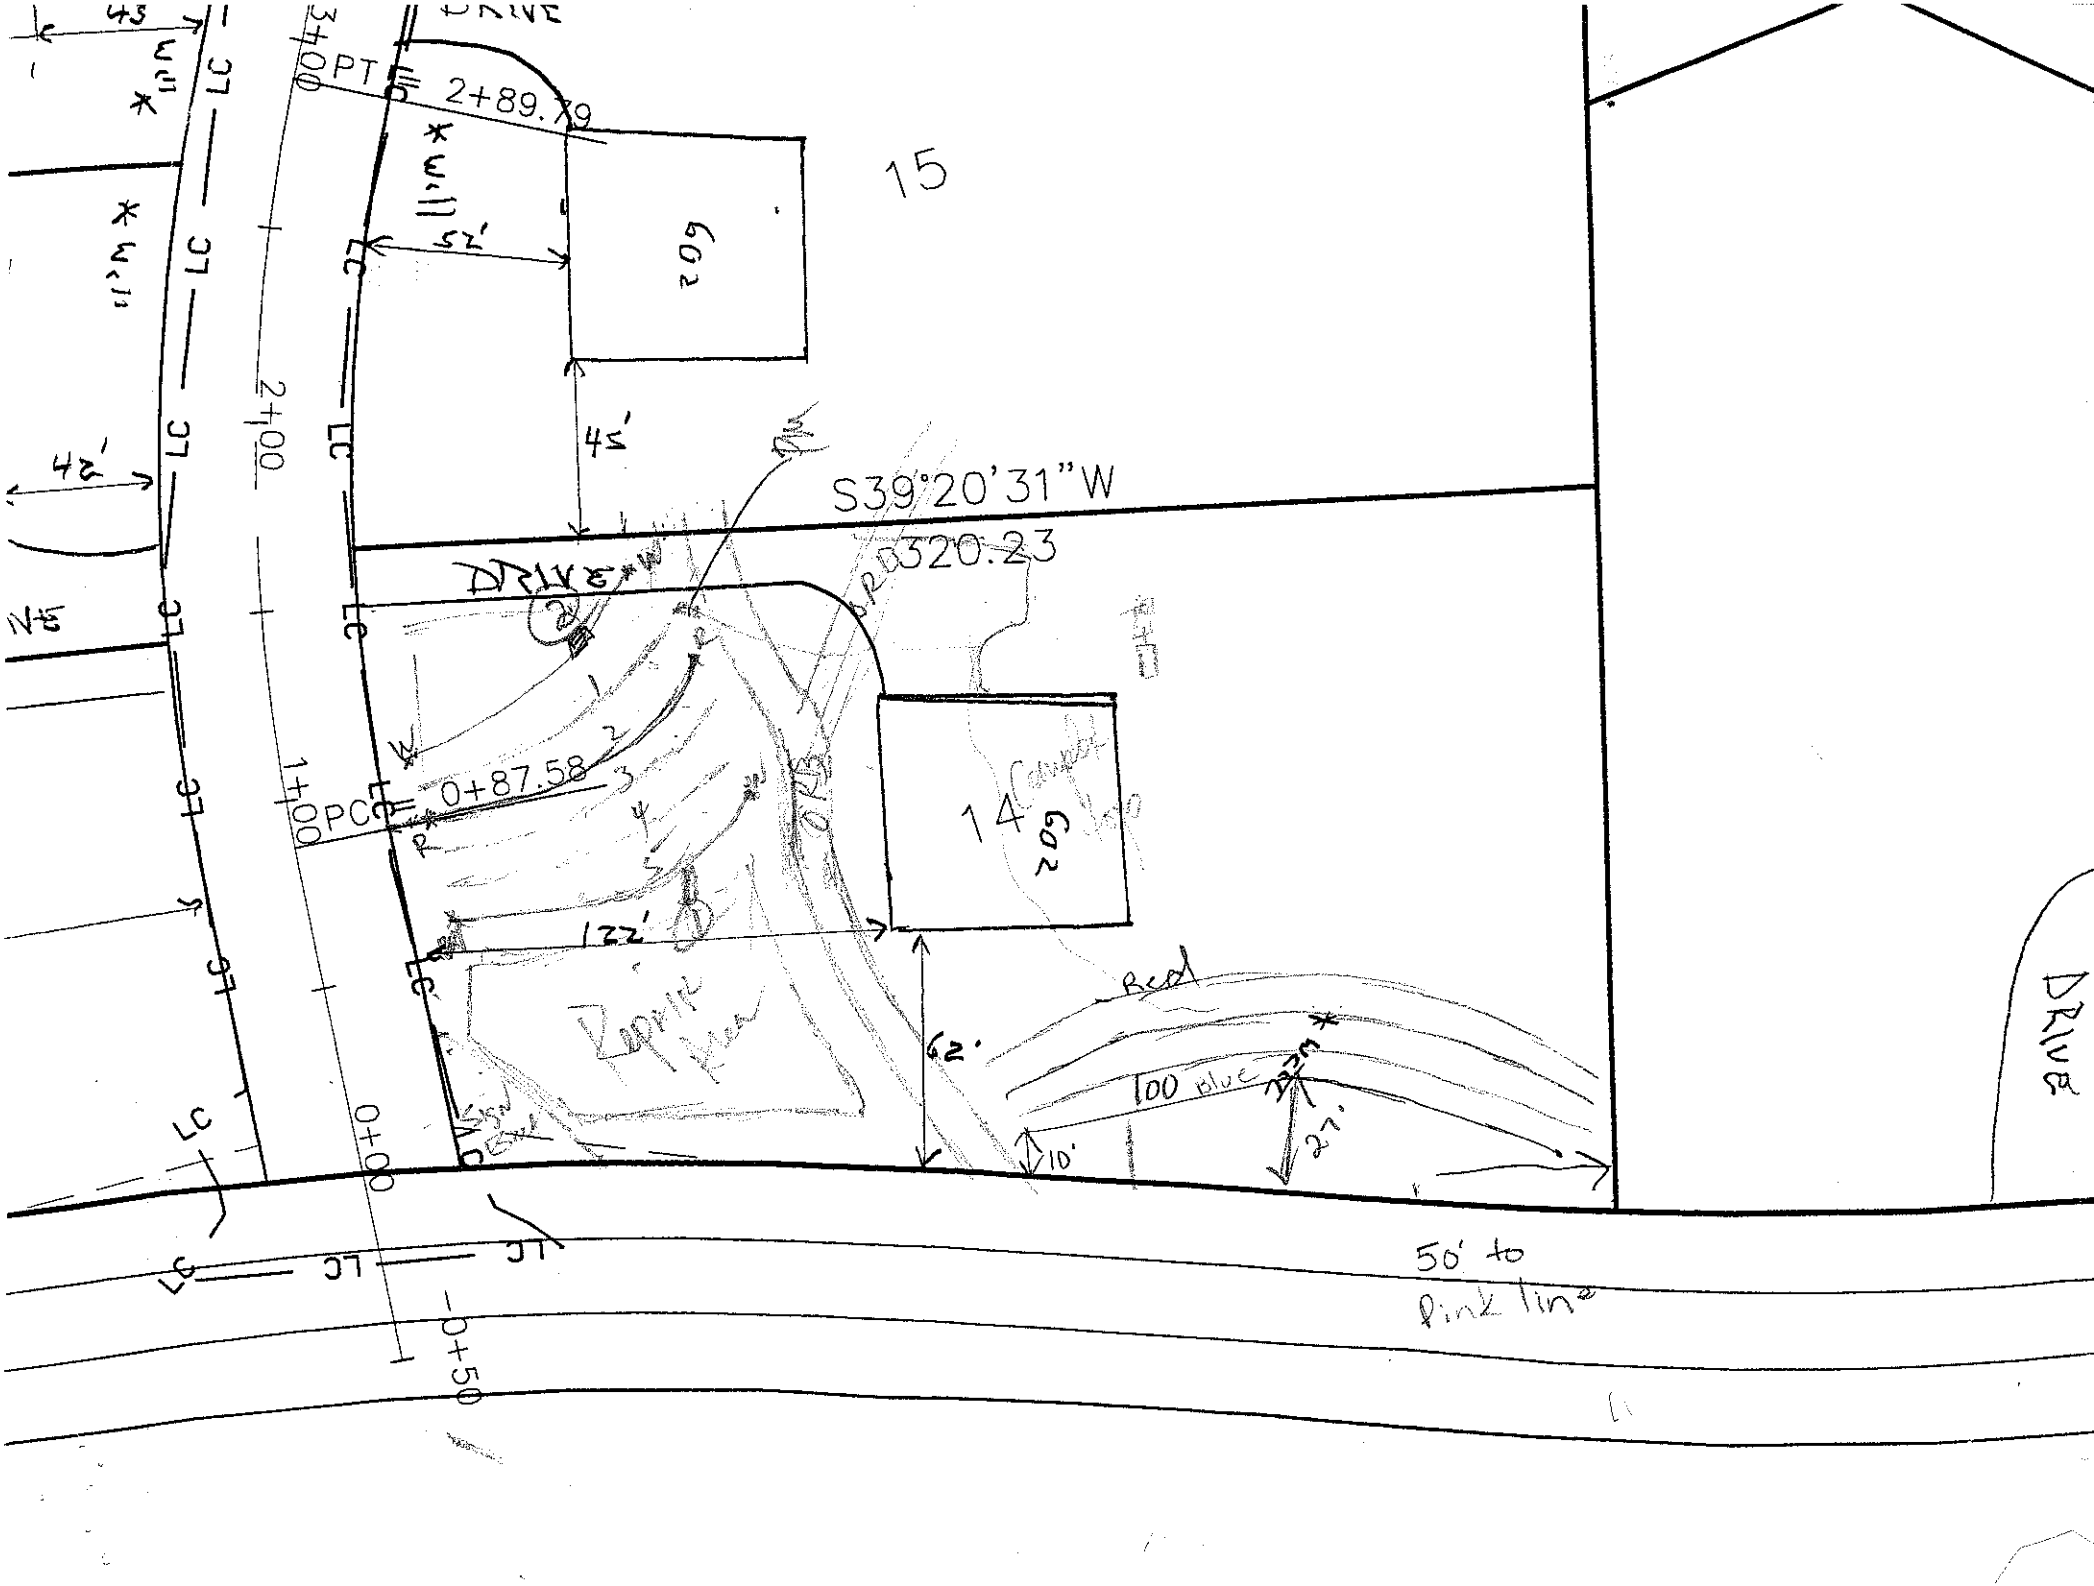
SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: Beacon Pt. Partners APPLICANT: _____
ADDRESS: _____ APPLICATION DATE: _____ DATE EVALUATED: 5-7-04
PROPOSED FACILITY: SFR PROPOSED DESIGN FLOW (.1949): 480gpd PROPERTY SIZE: _____
LOCATION OF SITE: Lot 14 phs 4 Beacon Pt. PROPERTY RECORDED: _____
WATER SUPPLY: ☑ Private ☐ Public ☑ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☐ Auger Boring ☑ Pit ☐ Cut
TYPE OF WASTEWATER: ☑ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	2-5%	0-25	Wk fsbk SCL	fr sss sp	Common fine med SAP,	Rock			.3+
		25-30	wk fsbk gr cl	fr sss sp	featuring w. rock				
2		6-17	wk fsbk CL	fr sss sp	common med/SAP				.3> 8"
		17-36	Brn wk fsbk gr cl	fr sss sp					
		36-55	massive LSAP	fr sss sp					
3	Alt	0-6	Brn SCL	SR FR					PS .3
		6-46	Red/Brn C/CL mw SBK SS, SP, SE, FI-FR w/ few to many SAP Inclus						
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	2M 25% Red	LPP PBPS
Site LTAR	.3	.3

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: DHamm
OTHER(S) PRESENT: Paul Pennuza


DRIVE
3+00 PT = 2+89.79
15
602
45'
S39°20'31"W
320.23
DRIVE
2+00
1+00 PC = 0+87.58
14
602
122'
62'
Bed
100 blue
10'
2'
DRIVE
0+00
0+50
50' to
pink line