DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM


OWNER: _____
ADDRESS: _____ APPLICATION DATE _____
PROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): _____ DATE EVALUATED: _____
LOCATION OF SITE: _____ PROPERTY SIZE: _____
WATER SUPPLY: ☐ Private ☐ Public ☐ Well ☐ Spring ☐ Other _____ PROPERTY RECORDED: _____
EVALUATION METHOD: ☐ Auger Boring ☐ Pit ☐ Cut TYPE OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	12%	0-12	SLW	NSNP VF	MANY MICA FEW SAP	50"	—	—	.3
		12-38	SCL MSBK	SSSP VF					
		38-44	CL WSBK	SSSP VF					
		44-50	SLW	NSNP VF					
			SILT						
2	10%	0-48	C/CL MSBK	SSSP SEXP F	MANY SAP	48"	5	—	.3
		48-52	SAND SAPW	NSNP VF					
3	9%	0-10	SIL L			30"			.3 TO 30"
		10-22	SCL MSBK	SSSP VF					
		22-30	SCM SBK	SSSP F					
		30-	ISOLATED	ROCK					
			PROBED AROUND ISOLATED ROCK						
4									


DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		
System Type(s)		
Site LTAR		

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): _____
EVALUATED BY: _____
OTHER(S) PRESENT: _____

COMMENTS: _____

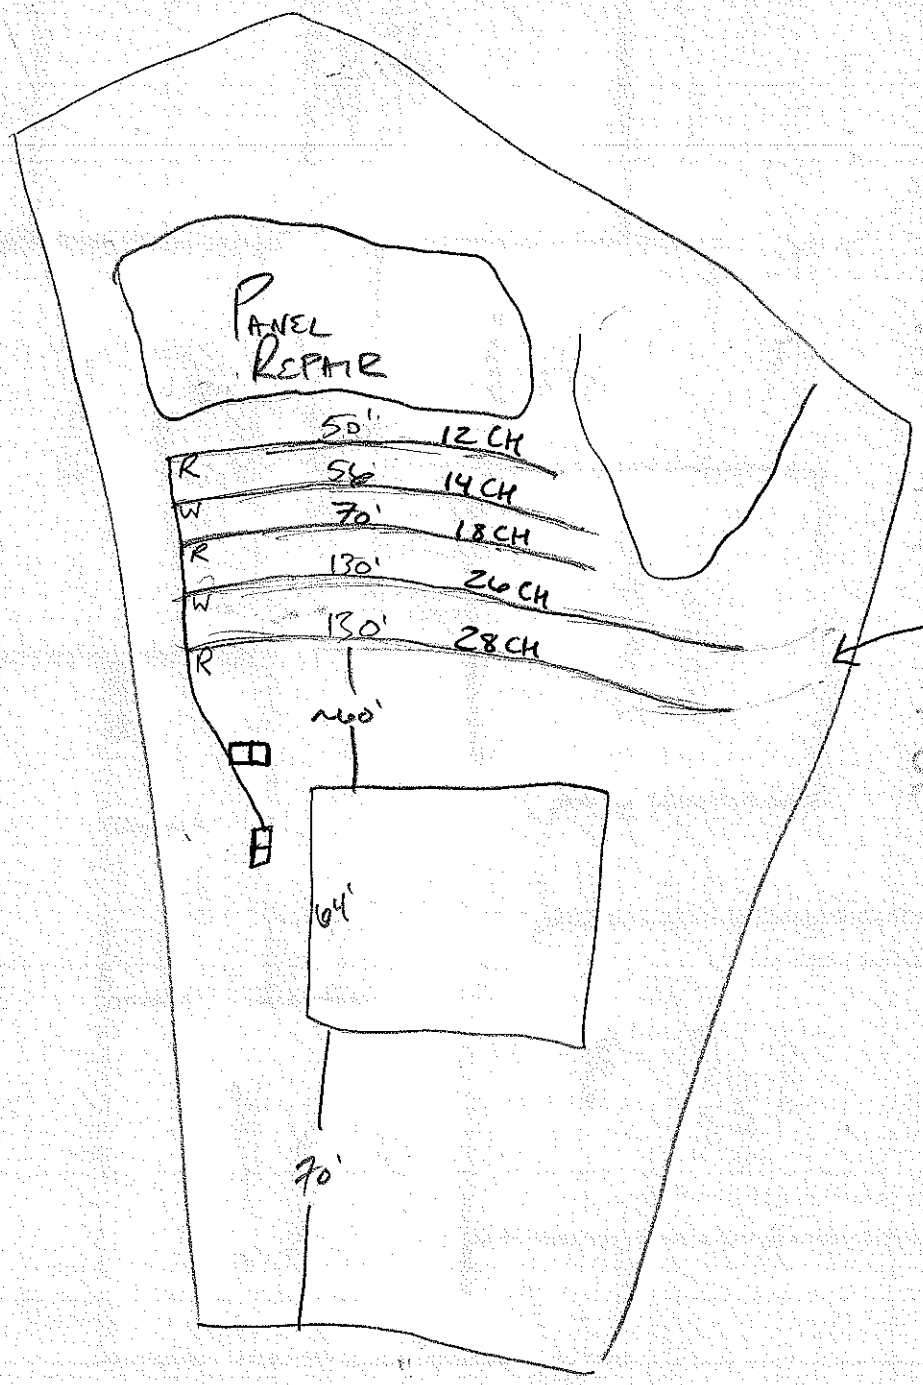

89' TO
NEIGHBOR'S
WELL

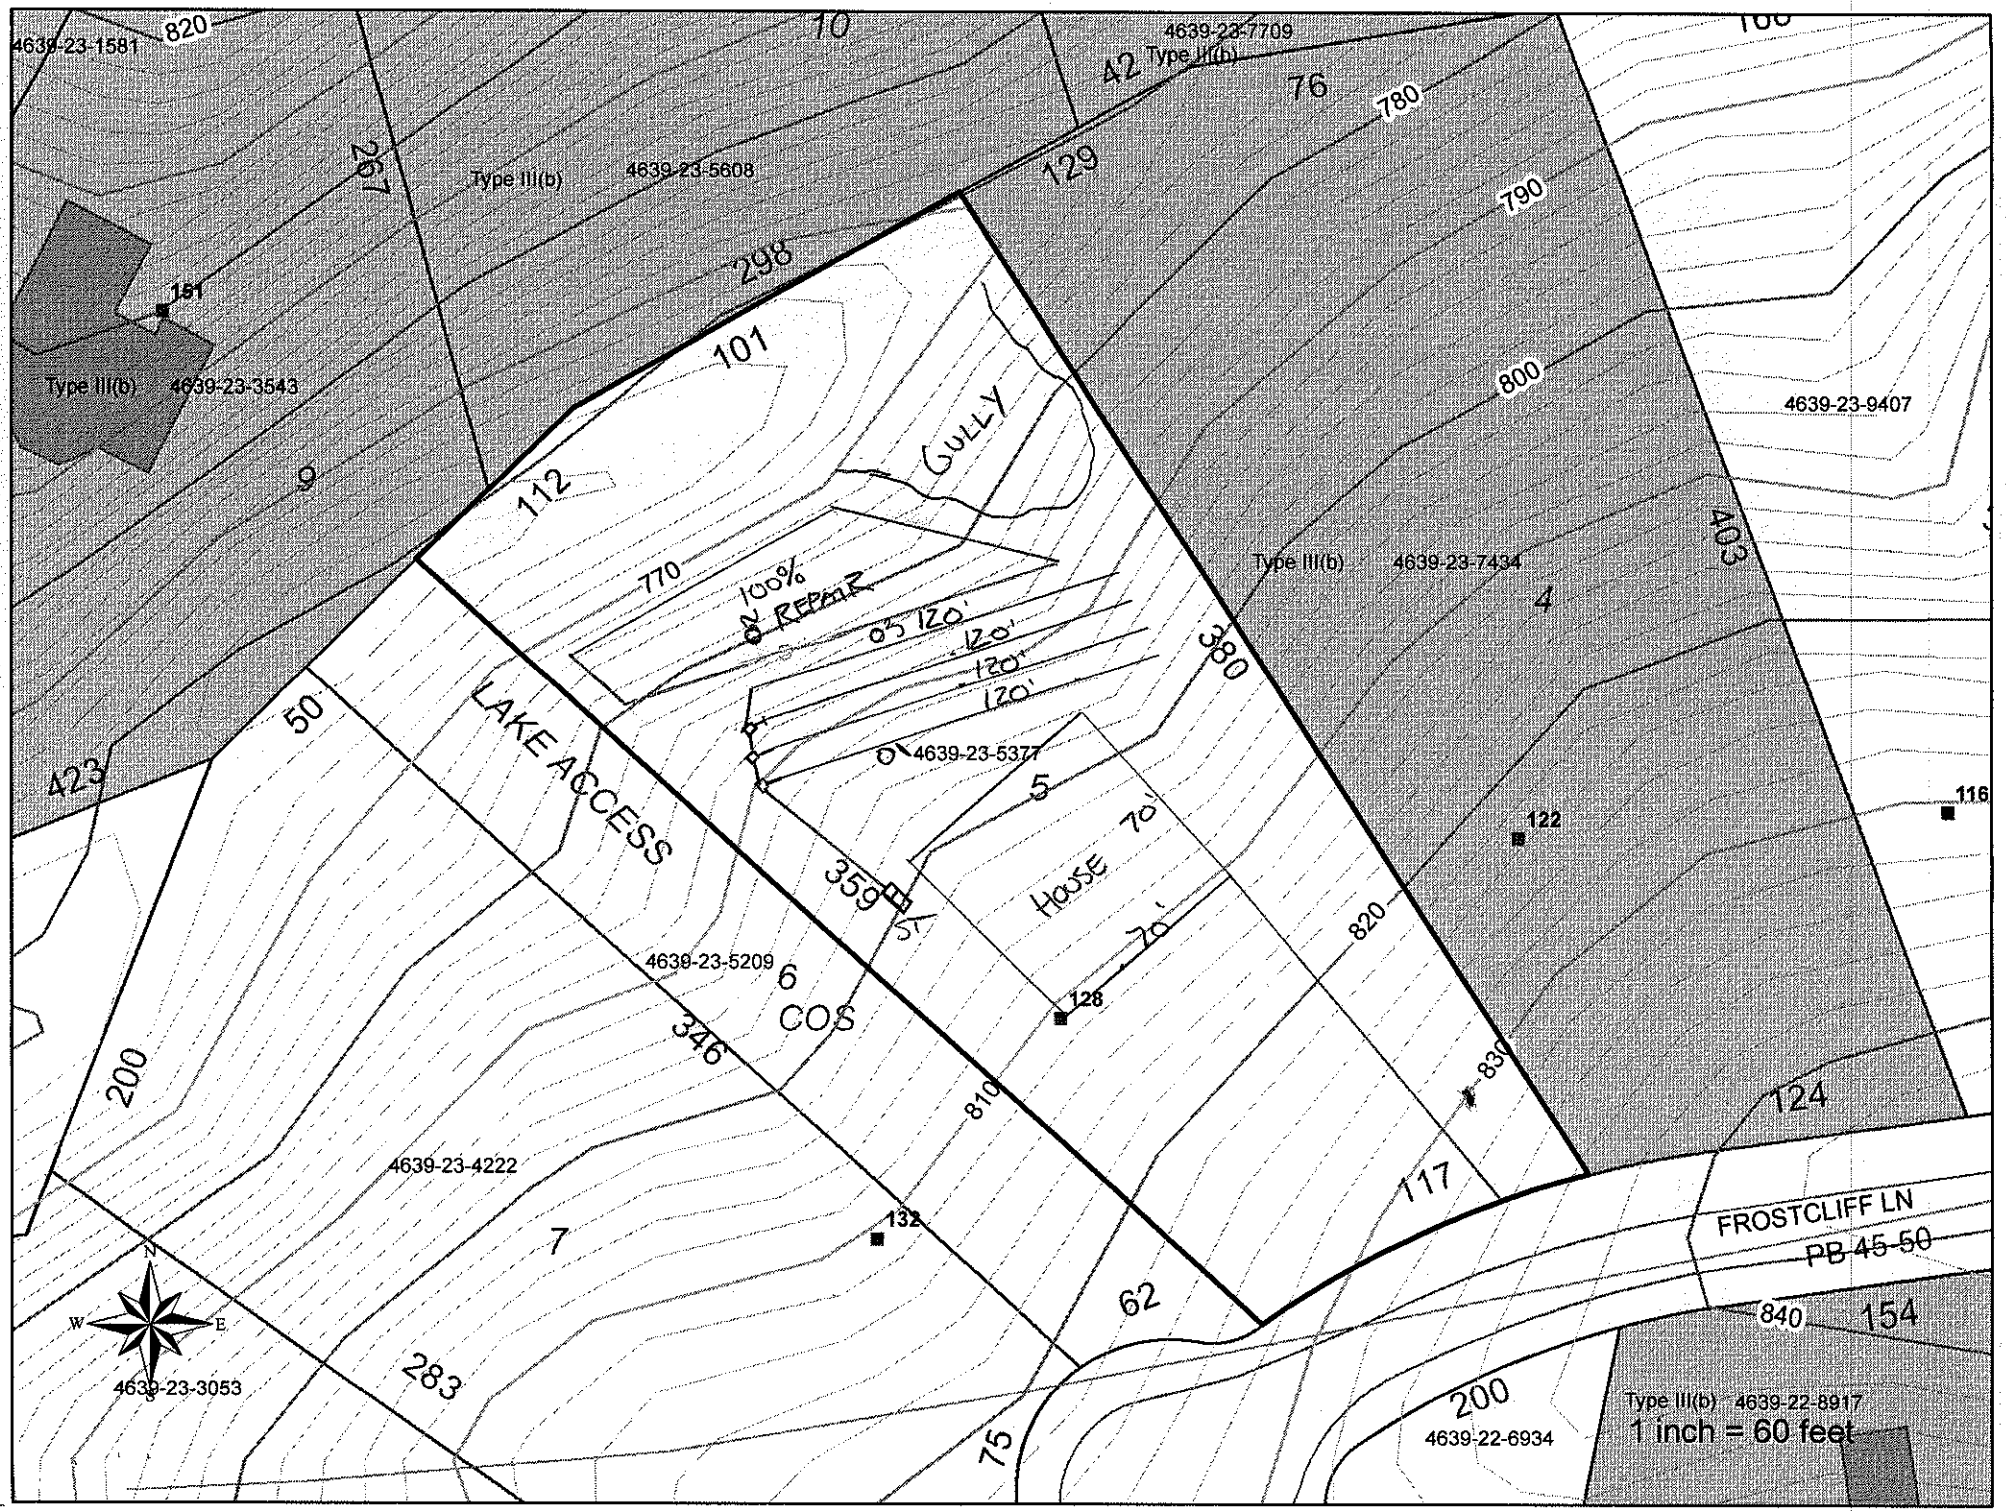
4639-23-1581
820
10
4639-23-7709
Type III(b)
42
76
780
Type III(b)
4639-23-5608
267
129
790
298
181
101
Type III(b)
4639-23-3543
9
GULLY
112
4639-23-9407
800
770
100%
REPAIR
403
Type III(b)
4639-23-7434
4
380
120'
120'
120'
4639-23-5377
LAKE ACCESS
50
423
5
HOUSE
70'
70'
122
116
350
SX
820
4639-23-5209
6
COS
128
346
200
810
830
124
4639-23-4222
117
132
7
FROSTCLIFF LN
PB 45-50
62
840
154
283
75
200
4639-22-6934
Type III(b)
4639-22-8917
4639-23-3053
1 inch = 60 feet