DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

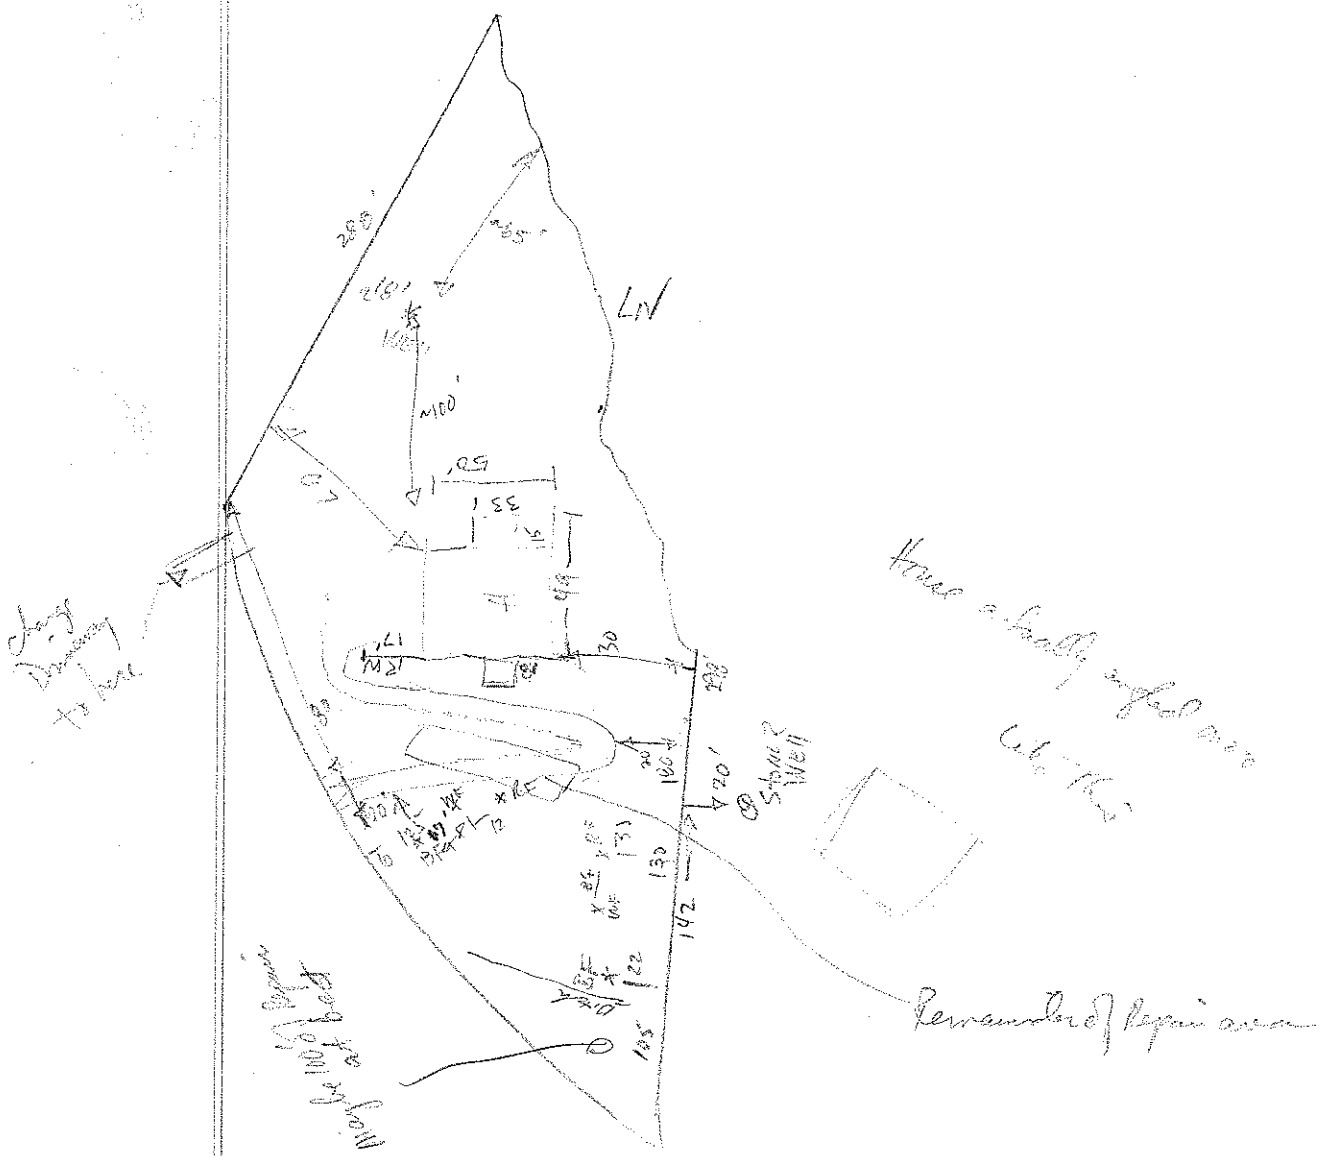
OWNER: CL JT APPLICANT: _____
ADDRESS: _____ APPLICATION DATE: _____ DATE EVALUATED: _____
PROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): _____ PROPERTY SIZE: _____
LOCATION OF SITE: 939 PROPERTY RECORDED: _____
WATER SUPPLY: ☐ Private ☐ Public ☐ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☐ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1		0-24	SL GR	FR					
		24-48	SCL WSBK	FR					
2		0-16	SL GR	FR					
		16-24	SCL WSBK	FR					
		24-48	L WSBK	FR					
3									
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		
System Type(s)		
Site LTAR		

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): _____

EVALUATED BY: _____
OTHER(S) PRESENT: _____


289'
265'
210'
LIV
100'
105'
33'
15'
48'
30
180'
20'
Storage Shed
130
142
Remainder of Applicant's
Long Driveway to Road
Wooded 100' Buffer
R Line - 5'
W Line - 70
B Line - ~90'

DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ____ *of* ____
PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: Kotch APPLICATION DATE _____
ADDRESS: _____ DATE EVALUATED: Dec 10, 01
PROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): _____ PROPERTY SIZE: _____
LOCATION OF SITE: Lot ~~5~~ 939 PROPERTY RECORDED: _____
WATER SUPPLY: ☐ Private ☐ Public ☐ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☐ Auger Boring ☐ Pit ☐ Cut Pits predominately soil
TYPE OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	25% from well to pond	12"fill	cl fill		wavy soil/sap boundary				.3
		0-3	[illegible] Sil						
		3-27	RC	fi-fr ssy sp					
		27-52	Mixed Cl	fr-ssy p					
		52-60	massive sl/ssp	fr-ssy p	only 26" soil to sap on west side of pit				
2	upslope 20' from pit	0-3	brk sh	fr ssc					.3
		3-18	RC	fi-fr s/ssy p					
		18-51	yrch	fr ssy p					
		51-78	sl/ssp						
3		0-6	sch						.3
		6-44	RC/ch						
		44-66	massive sl/ssp						
			30"+6						
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		
System Type(s)		
Site LTAR		

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): _____
EVALUATED BY: Brady Freeman & David Hinson
OTHER(S) PRESENT: _____

COMMENTS: _____