DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

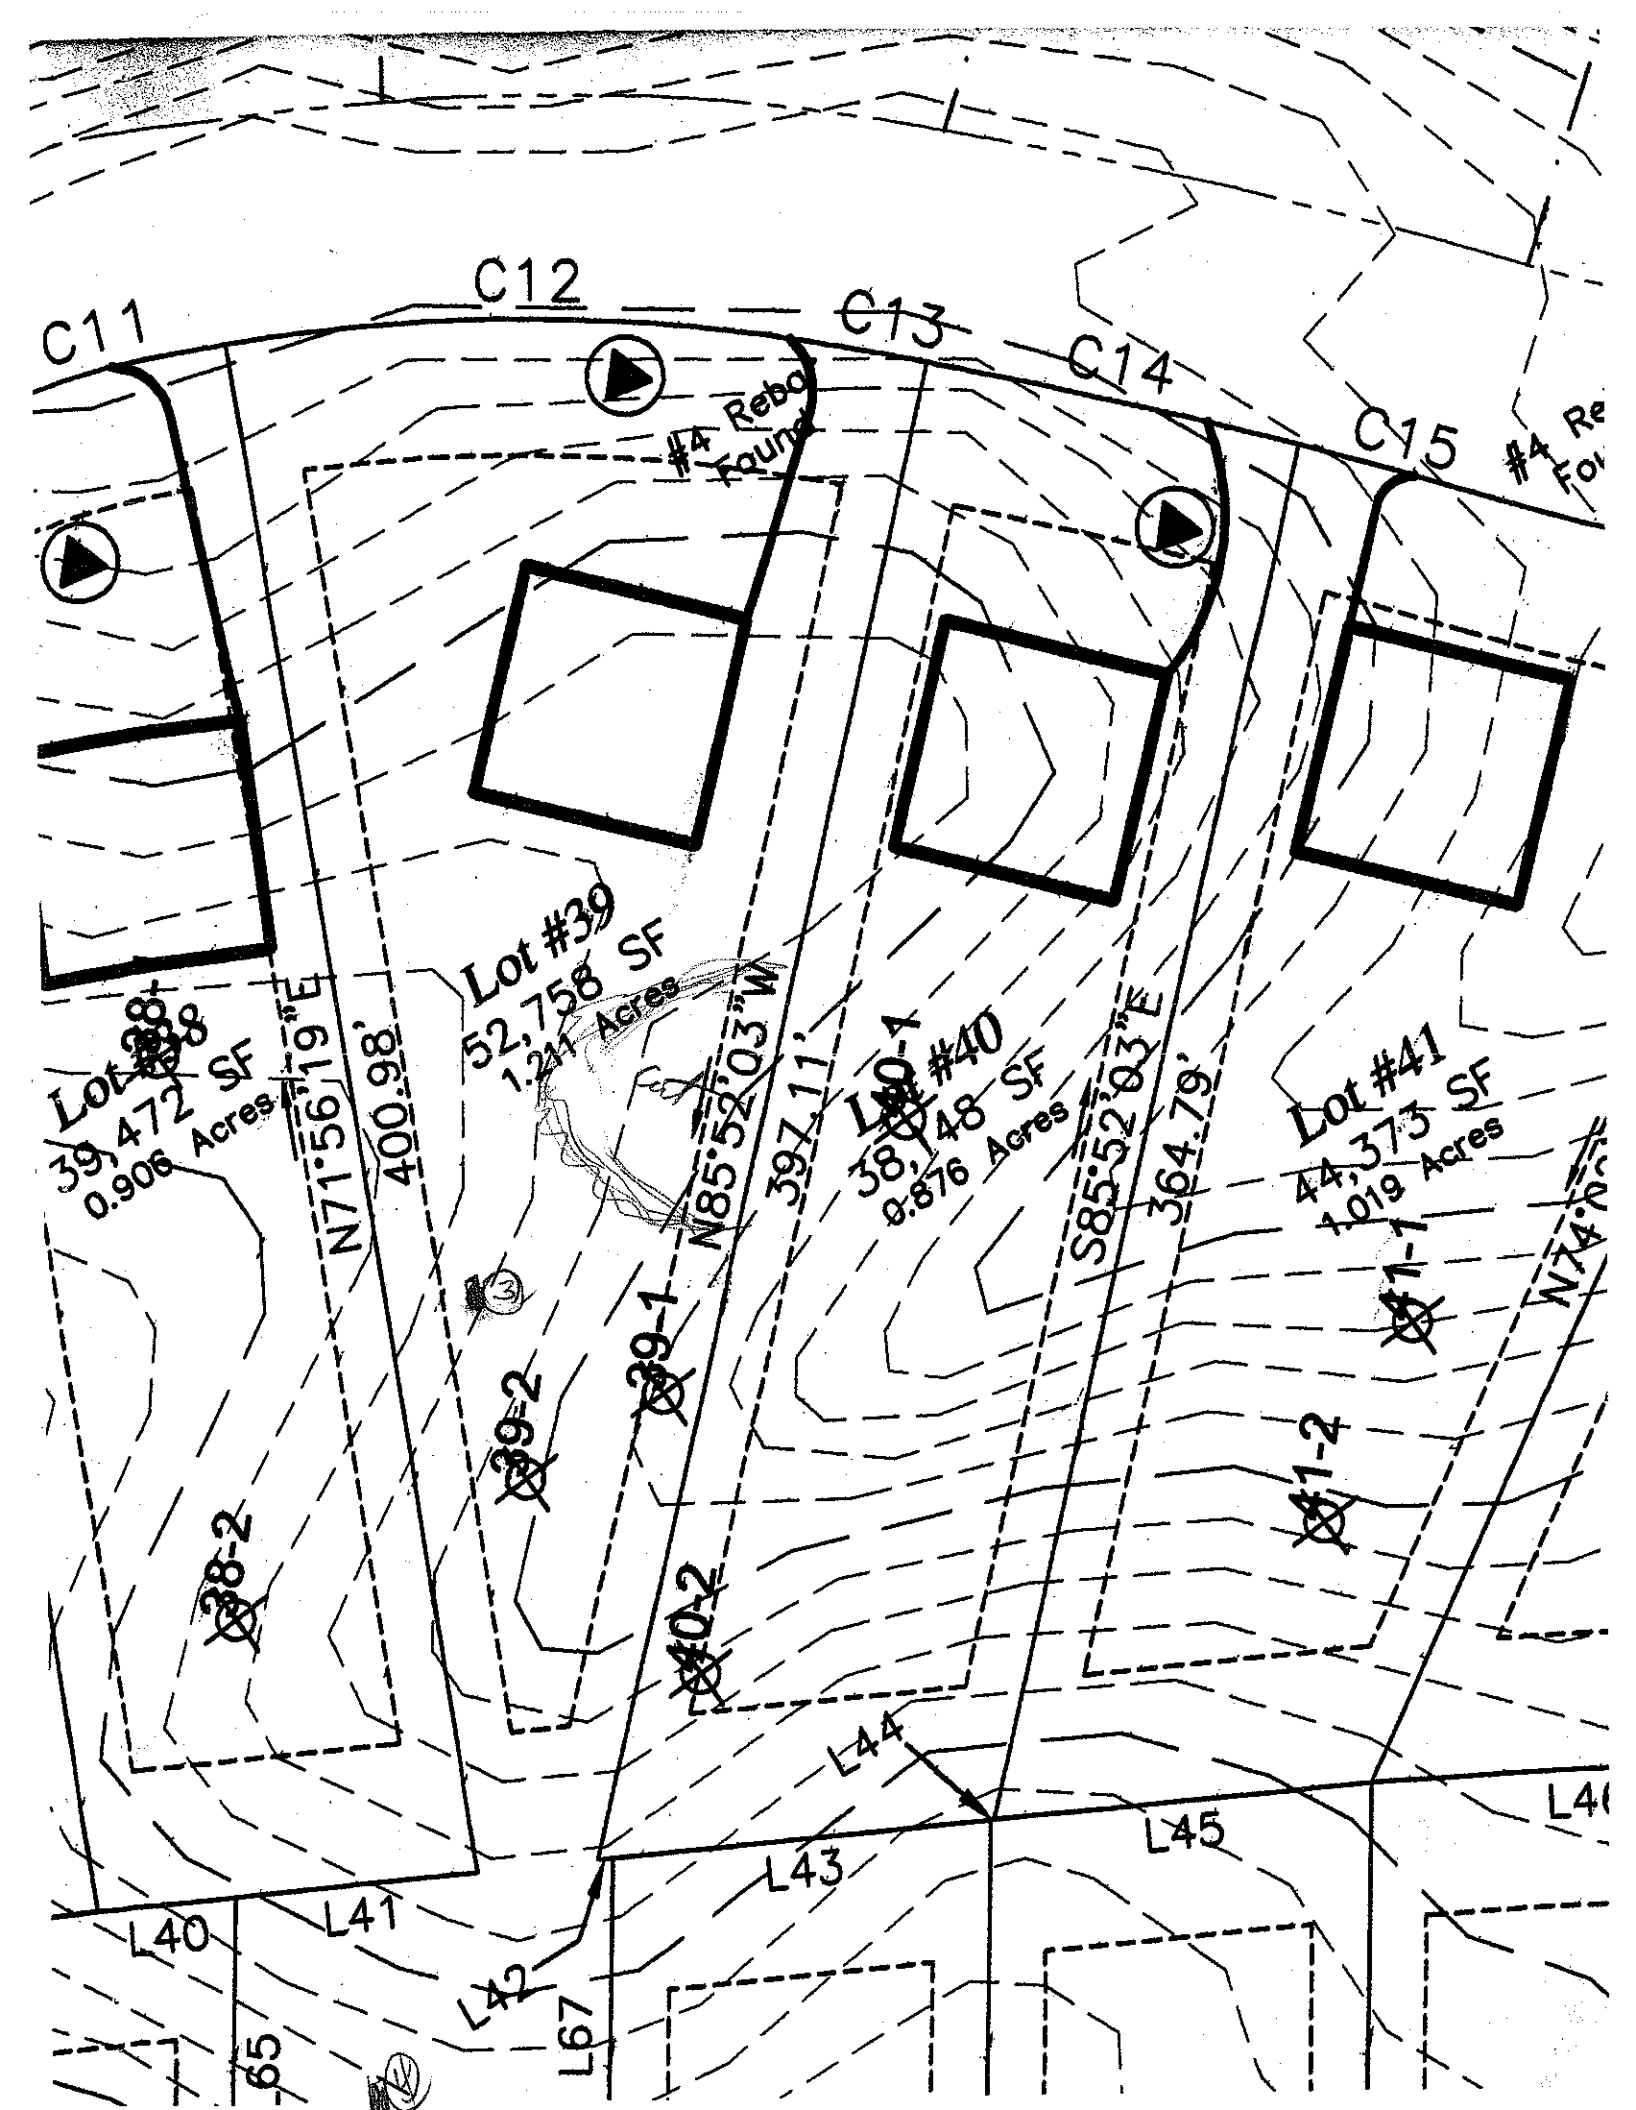
OWNER: Woodleaf S/D _____ APPLICATION DATE _____
ADDRESS: _____ DATE EVALUATED: 4/21/06
PROPOSED FACILITY: House PROPOSED DESIGN FLOW (.1949): 480 PROPERTY SIZE: _____
LOCATION OF SITE: Lot 39 PROPERTY RECORDED: _____
WATER SUPPLY: ☐ Private ☐ Public ☒ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☐ Auger Boring ☒ Pit ☐ Cut TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1948 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941)		OTHER PROFILE FACTORS				PROFILE CLASS & LTAR
			.1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	.1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	
1	L	0-29	WK/MO SBK C	FR SS/SP	Red				0.3
		29-42	WK SBK CL	FR SS/SP	Red; F/C sap				
		42-52	MA L sap	FR SS/SP	multicolored				
2	L	0-26	WK/MO SBK C	FR SS/SP	Red Br				0.3
		26-36	WK SBK CL	FR SS/SP	Red Br; F/C sap				
		36-52	MA L sap	FR SS/SP	multicolored				
3	8-9% S	0-18	wk sbk/l cl	fr ss sp					.35 = 4
		18-60	massive L sap	fr ss-ls sp					
4	15% V	0-17	gr-wk bk sl cl	fr ss sp					.25
		17-55	sbk/prismod cl	fr ss sp	SRXP				
			few+common gravel		36"+				

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		
System Type(s)		
Site LTAR		

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): _____
EVALUATED BY: Rob
OTHER(S) PRESENT: _____

COMMENTS: _____


C11
C12
C13
C14
C15
#4 Rebar Found
Lot #38
39,472 SF
0.906 Acres
N71°56'19"E
400.98'
Lot #39
52,758 SF
1.211 Acres
N85°52'03"W
397.11'
LOT-1
Lot #40
38,748 SF
0.876 Acres
S85°52'03"E
364.79'
Lot #41
44,373 SF
1.019 Acres
38-2
39-2
39-1
40-2
41-1
41-2
L40
L41
L42
L43
L44
L45
L67
65