VISION OF ENVIRONMENTAL HEALTH
I-SITE WASTEWATER SECTION

PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

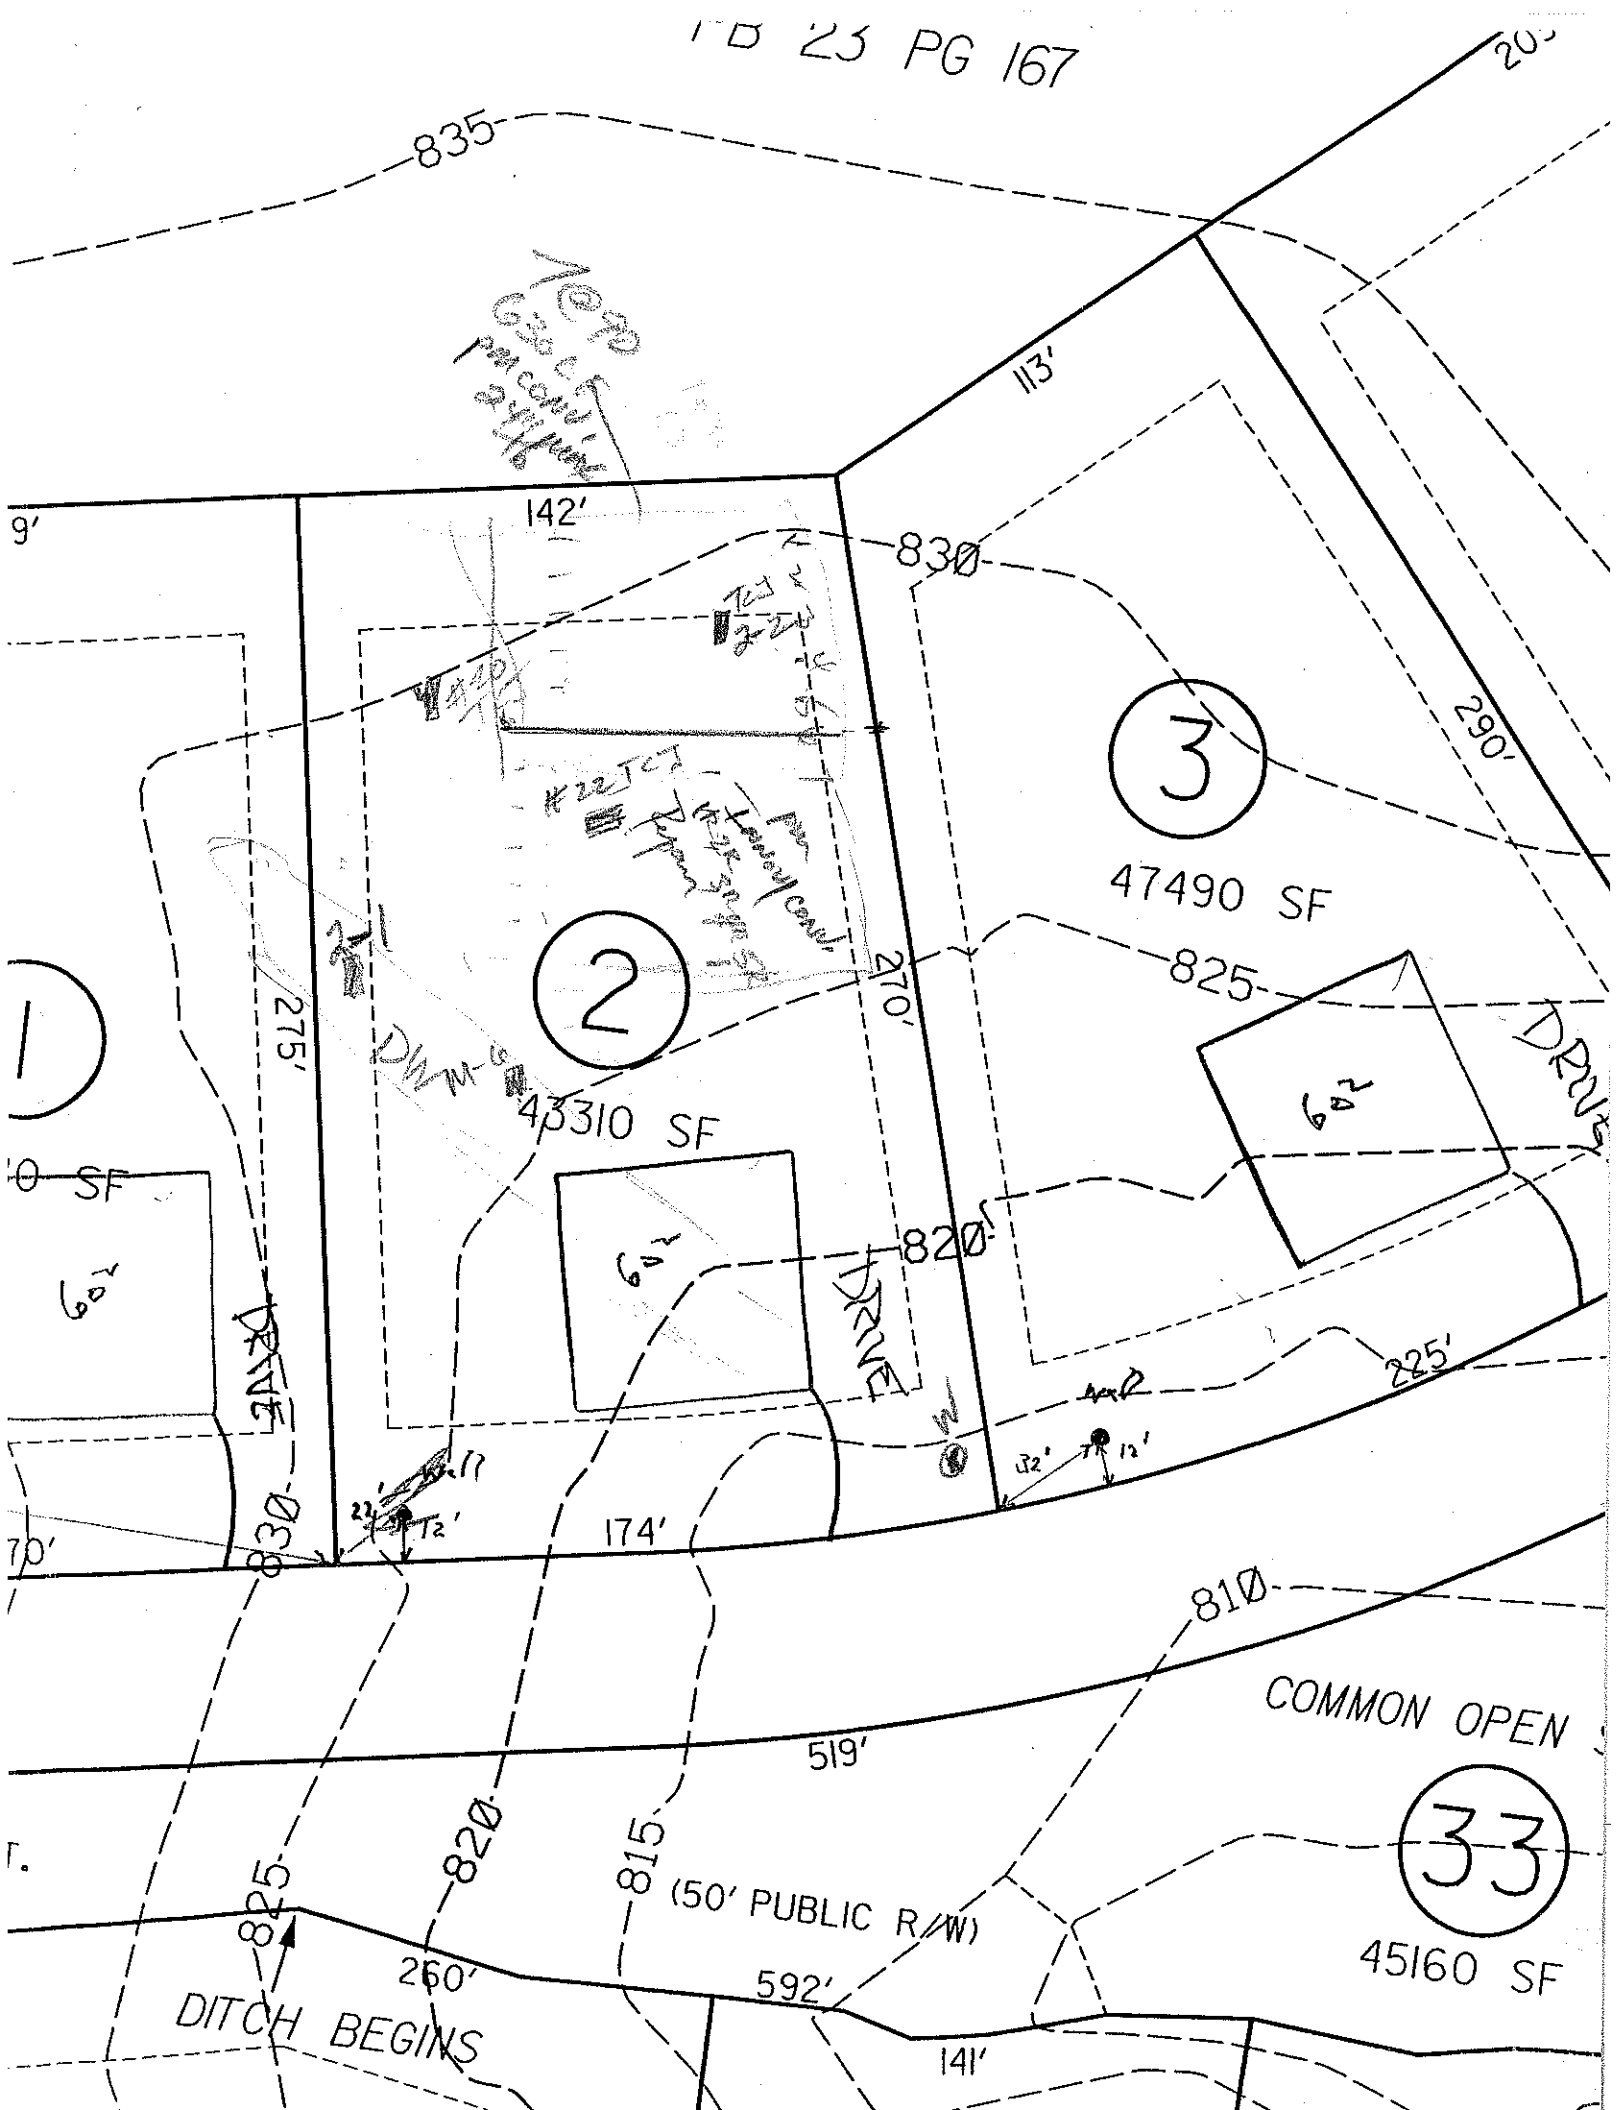
OWNER: CKT APPLICANT: _____
ADDRESS: _____ APPLICATION DATE: _____ DATE EVALUATED: 10-16-20
PROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): _____ PROPERTY SIZE: _____
LOCATION OF SITE: Lot 7 Wildwood Cove PROPERTY RECORDED: _____
WATER SUPPLY: ☐ Private ☐ Public ☐ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☐ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed

TCT 2-1 0-19 fr brn sl cl 19-45 sbk rd sl cl y brn mottles fr fr .25 (U) due to LS position

.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
#21 TCT	0-30	sbk rcl	fi-fr					PS .025 @ ≤ 36"
	30-42	(BC) rcl	gl dk mottles fi-fr p	water in pit 38"				
TCT 2-2	0-42	sbk rcl	fi-fr few med SRP					PS .3
#22 TCT	0-24	wk sbk sl. brn sl cl						.25
	24-38	sbk rcl	fi. fr					
	38-47	MB rcl	common y brn				24" in Ap #6	
M-6	0-24	brn sl cl/cl	fr SSSP	few common distinct y brn mottles	y brn mottles			LPP .1
	24-30	R brn cl	fi SSSP	many y brn mottles				
	30-42	fri dist brn	rcl common distinct	24/30"				

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
ilable Space (.1945)		
tem Type(s)		
LTAR		

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): _____
EVALUATED BY: _____
OTHER(S) PRESENT: _____


PB 23 PG 167
835
113'
142'
830
290'
3
47490 SF
825
270'
275'
2
43310 SF
60²
820'
DRIVE
225'
174'
810'
519'
COMMON OPEN
33
45160 SF
(50' PUBLIC R/W)
592'
260'
141'
DITCH BEGINS