ITE WASTEWATER SECTION

PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

ER: CRI — APPLICANT: _____

RESS: _____ APPLICATION DATE: _____ DATE EVALUATED: 10-20-00

POSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): _____ PROPERTY SIZE: _____

ATION OF SITE: 1 to 2 Wetland Core Sta's — PROPERTY RECORDED: _____

ER SUPPLY: ☐ Private ☐ Public ☐ Well ☐ Spring ☐ Other _____

LUATION METHOD: ☐ Auger Boring ☐ Pit ☐ Cut

E OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed

.1940 LAND-SCAPE POSITION/ SLOPE %	HORI-ZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	OTHER PROFILE FACTORS .1943 SOIL DEPTH	OTHER PROFILE FACTORS .1956 SAPRO CLASS	OTHER PROFILE FACTORS .1944 RESTR HORIZ	PROFILE CLASS & LTAR
#59 TCJ (mlk) SFE22A	0-34	sab RCL	fr-fr SSSP					B 0.3+
	34-48	wk sab RCL	common med SAP fr SSSP					
21A-1 SFE22A	0-5	brwk SAL ORM	SL fr					B 1
	5-24	wk sab RCL	fr SSSP					
	24-40	wk sab RCL	common med SAP fr SSSP					
	40-50	wk sab/LS RCL	common-many med SAP fr SSSP					
#60 TCJ 2-1A	0-38	wk sab cl/cl	fr SSSP					B 0.3
	38-48	wk sab/LS RCL	fr SSSP vfr					
	0-8	wk sab SiCL	fr					B .3
	8-19	sab RCL	fr SSSP					
	19-48	wk sab/LS	cl fr SSSP					
			few quartz rock 3%					

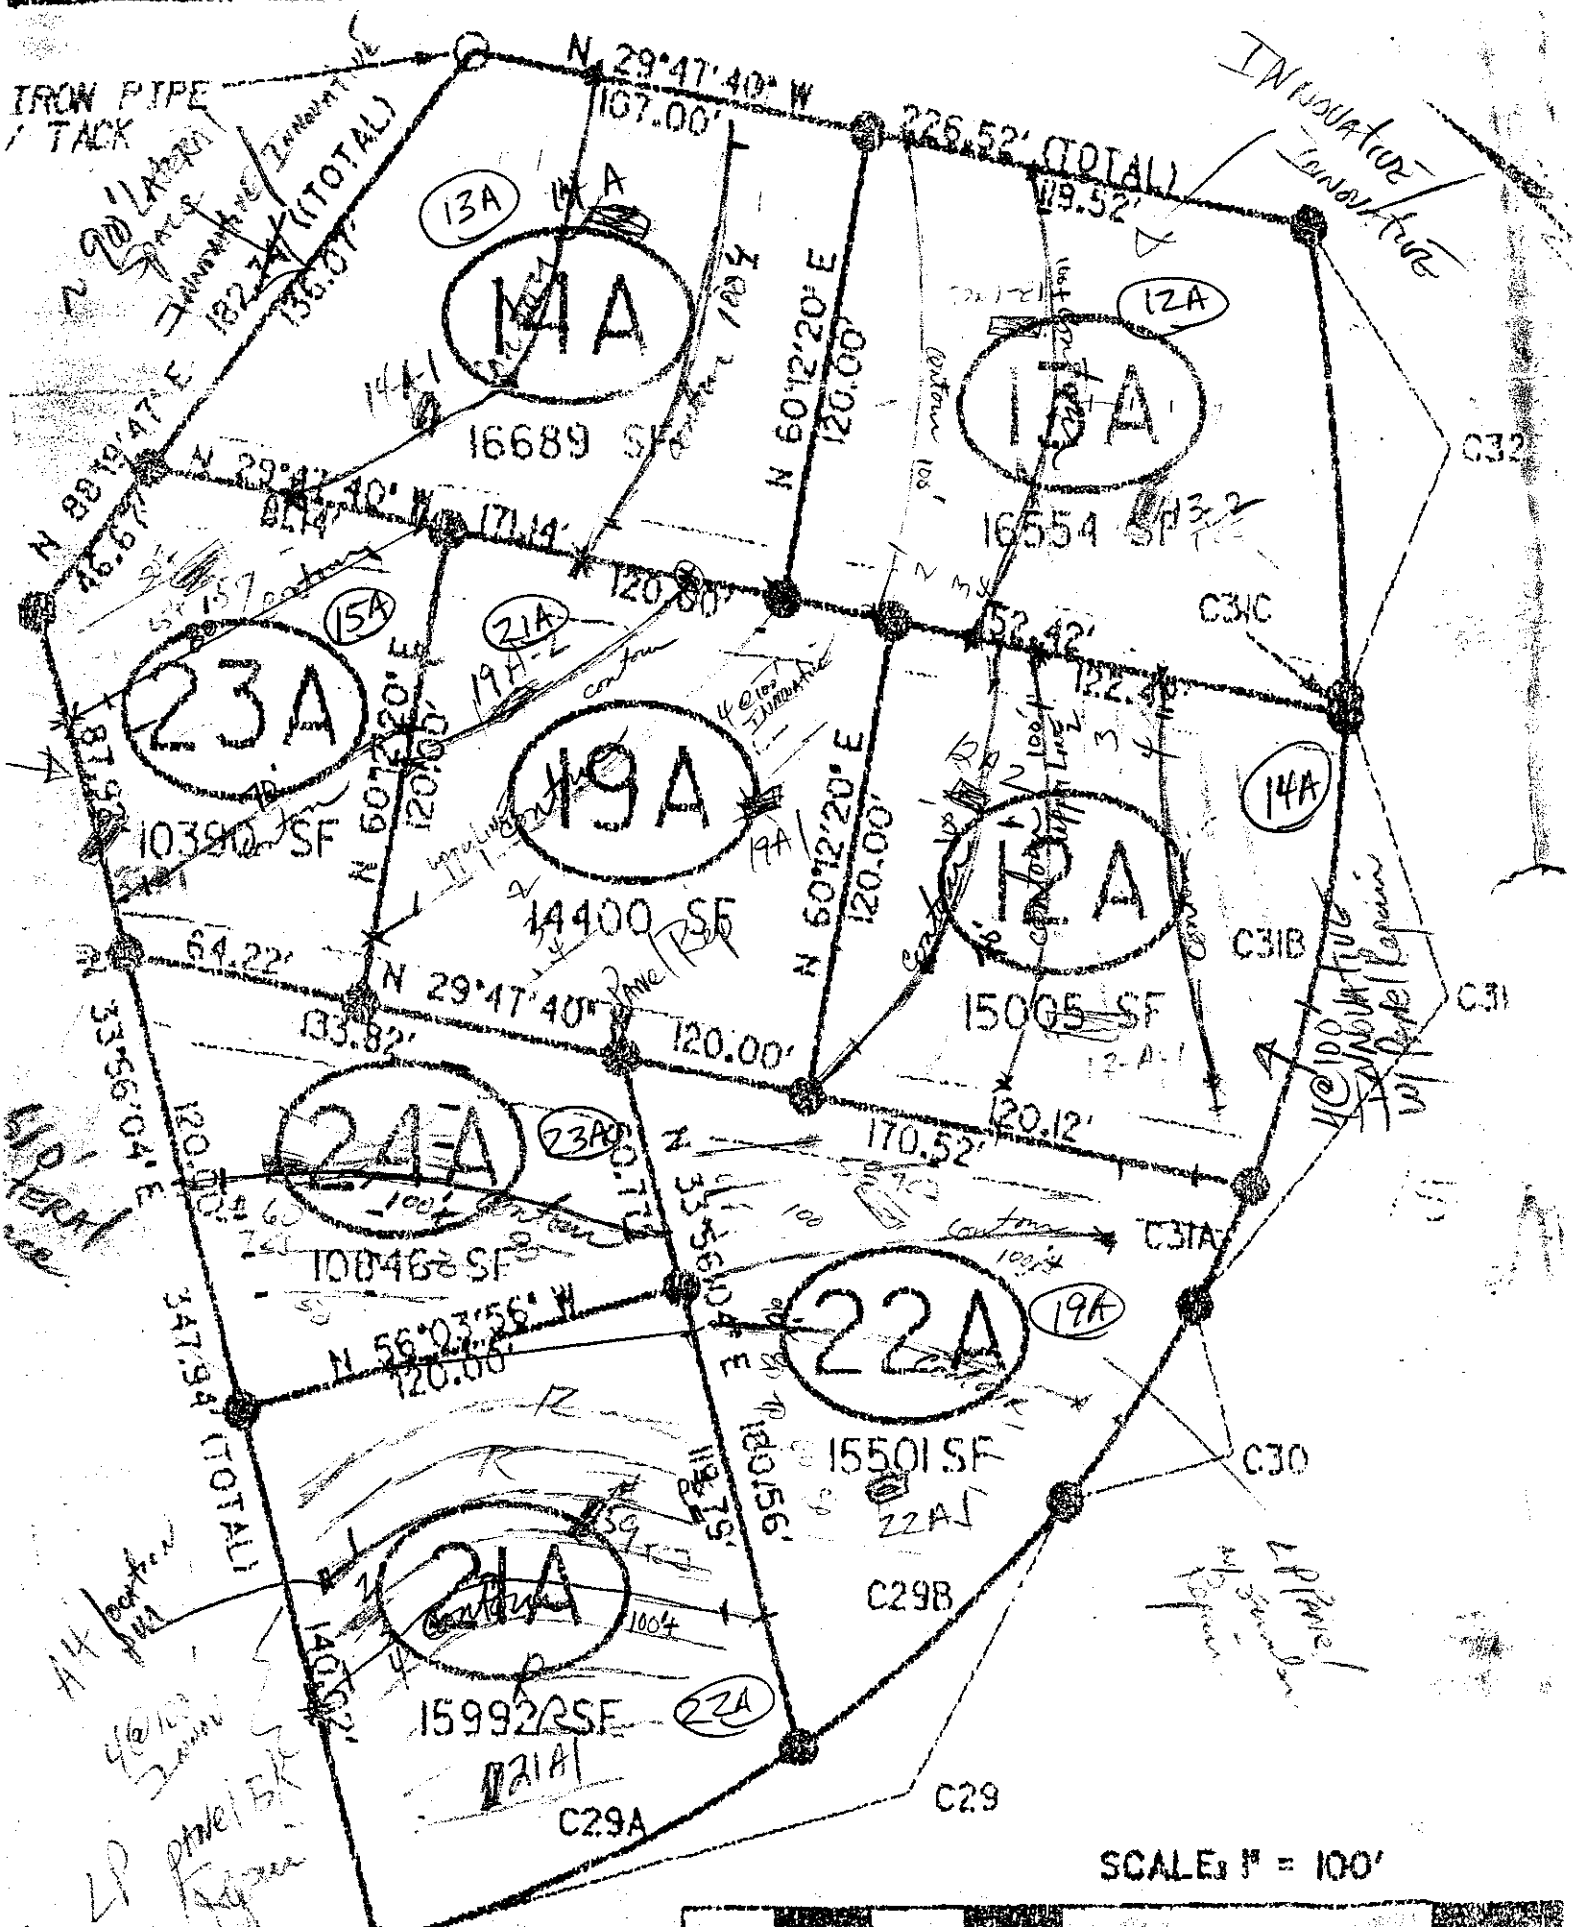
DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
able Space (.1945)		
m Type(s)		

OTHER FACTORS (.1946): _____

SITE CLASSIFICATION (.1948): _____

EVALUATED BY: _____

OTHER(S) PRESENT: _____


IRON PIPE / TACK
N 29°47'40" W
107.00'
226.52' (TOTAL)
119.52'
13A
14A
14A
16689 SF
12A
12A
16554 SF
N 88°19'47" E
46.67'
N 29°47'40" W
171.14'
120.00'
N 60°12'20" E
120.00'
15A
21A
23A
10396 SF
19A
14400 SF
19A
17A
15005 SF
14A
C32
C31C
C31B
C31
64.22'
N 29°47'40" W
133.82'
120.00'
170.52'
120.12'
24A
23A
10046 SF
C31A
N 56°03'56" W
120.00'
347.94' (TOTAL)
22A
19A
15501 SF
C30
C29B
21A
15992 SF
22A
C29A
C29
SCALE: 1" = 100'