ITE WASTEWATER SECTION COUNTY:

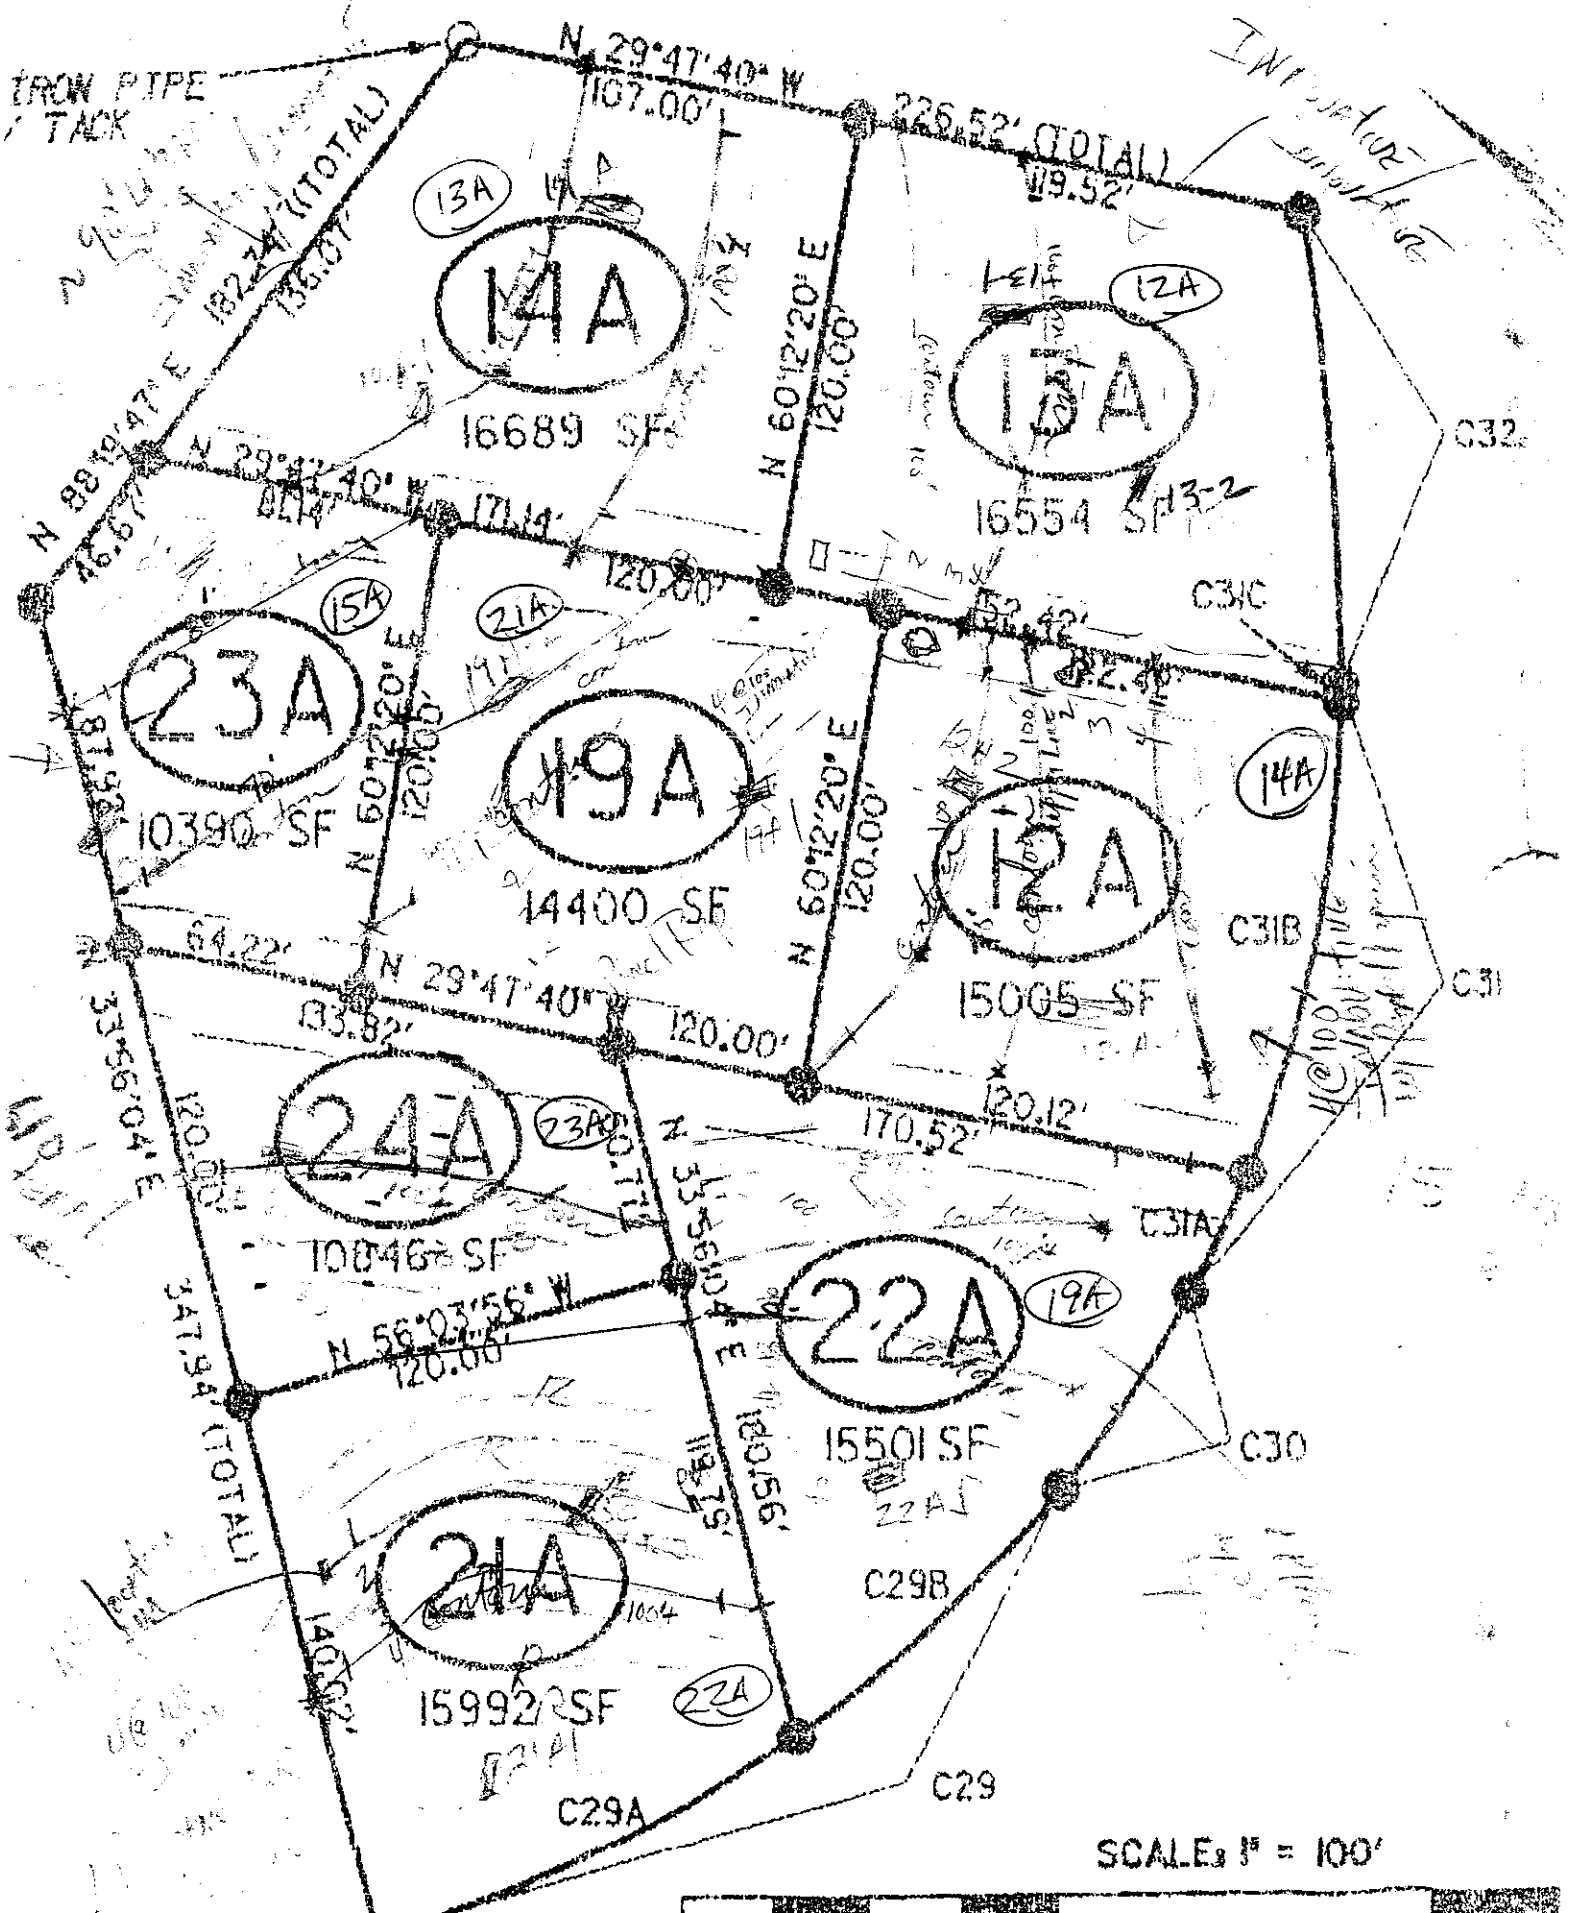
SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

ER: CRF APPLICANT:
DRESS: APPLICATION DATE: DATE EVALUATED: 10-20-00
POSED FACILITY: PROPOSED DESIGN FLOW (.1949): PROPERTY SIZE:
ATION OF SITE: Wildwood Cove Lot 8 SFEs PROPERTY RECORDED:
TER SUPPLY: ☐ Private ☐ Public ☐ Well ☐ Spring ☐ Other
LUATION METHOD: ☐ Auger Boring ☐ Pit ☐ Cut
E OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed

.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	OTHER PROFILE FACTORS .1943 SOIL DEPTH	OTHER PROFILE FACTORS .1956 SAPRO CLASS	OTHER PROFILE FACTORS .1944 RESTR HORIZ	PROFILE CLASS & LTAR
13-2 (SFE 12A)	0-23	Snb scl	fr sss so					B 03
	23-37	wk sbk/gr scl/l	fr sss so					
	37-48	wk sbk/gr yr l	common lin sap fr sss sp					
13-1 (SFE 12A)	0-25	Snb RCL	fi-fr sss so					PS 03
	25-45	wk sbk/gr CL	fi-fr sss so					
14A	0-8	brn scl/scl						PS 03
	8-32	Snb yr cl	fr sp-sss p					
	32-46	wk sbk/gr yr cl	fr sss p					
14A-1	0-33	snb RCL	fi-fr sss pso sp					B 03
	33-46	wk sbk RCL	common lin sap fi-fr sss sp					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
lable Space (.1945)		
m Type(s)		
LTAR		

OTHER FACTORS (.1946):
SITE CLASSIFICATION (.1948):
EVALUATED BY:
OTHER(S) PRESENT:


IRON PIPE
TACK
N 29°47'40" W
107.00'
226.52' (TOTAL)
119.52'
182.74' (TOTAL)
136.07'
N 88°19'47" E
16.67'
13A
14A
16689 SF
N 60°12'20" E
120.00'
12A
13A
16554 SF
C32
C31C
N 29°47'40" W
171.14'
120.00'
15A
21A
23A
10390 SF
19A
14400 SF
N 60°12'20" E
120.00'
12A
15005 SF
14A
C31B
C31
64.22'
N 29°47'40" W
120.00'
03.82'
24A
10046 SF
23A
170.52'
120.12'
C31A
N 56°03'56" W
120.00'
22A
15501 SF
19A
C30
21A
15992 SF
22A
C29B
C29A
C29
SCALE: 1" = 100'