ITE WASTEWATER SECTION COUNTY:

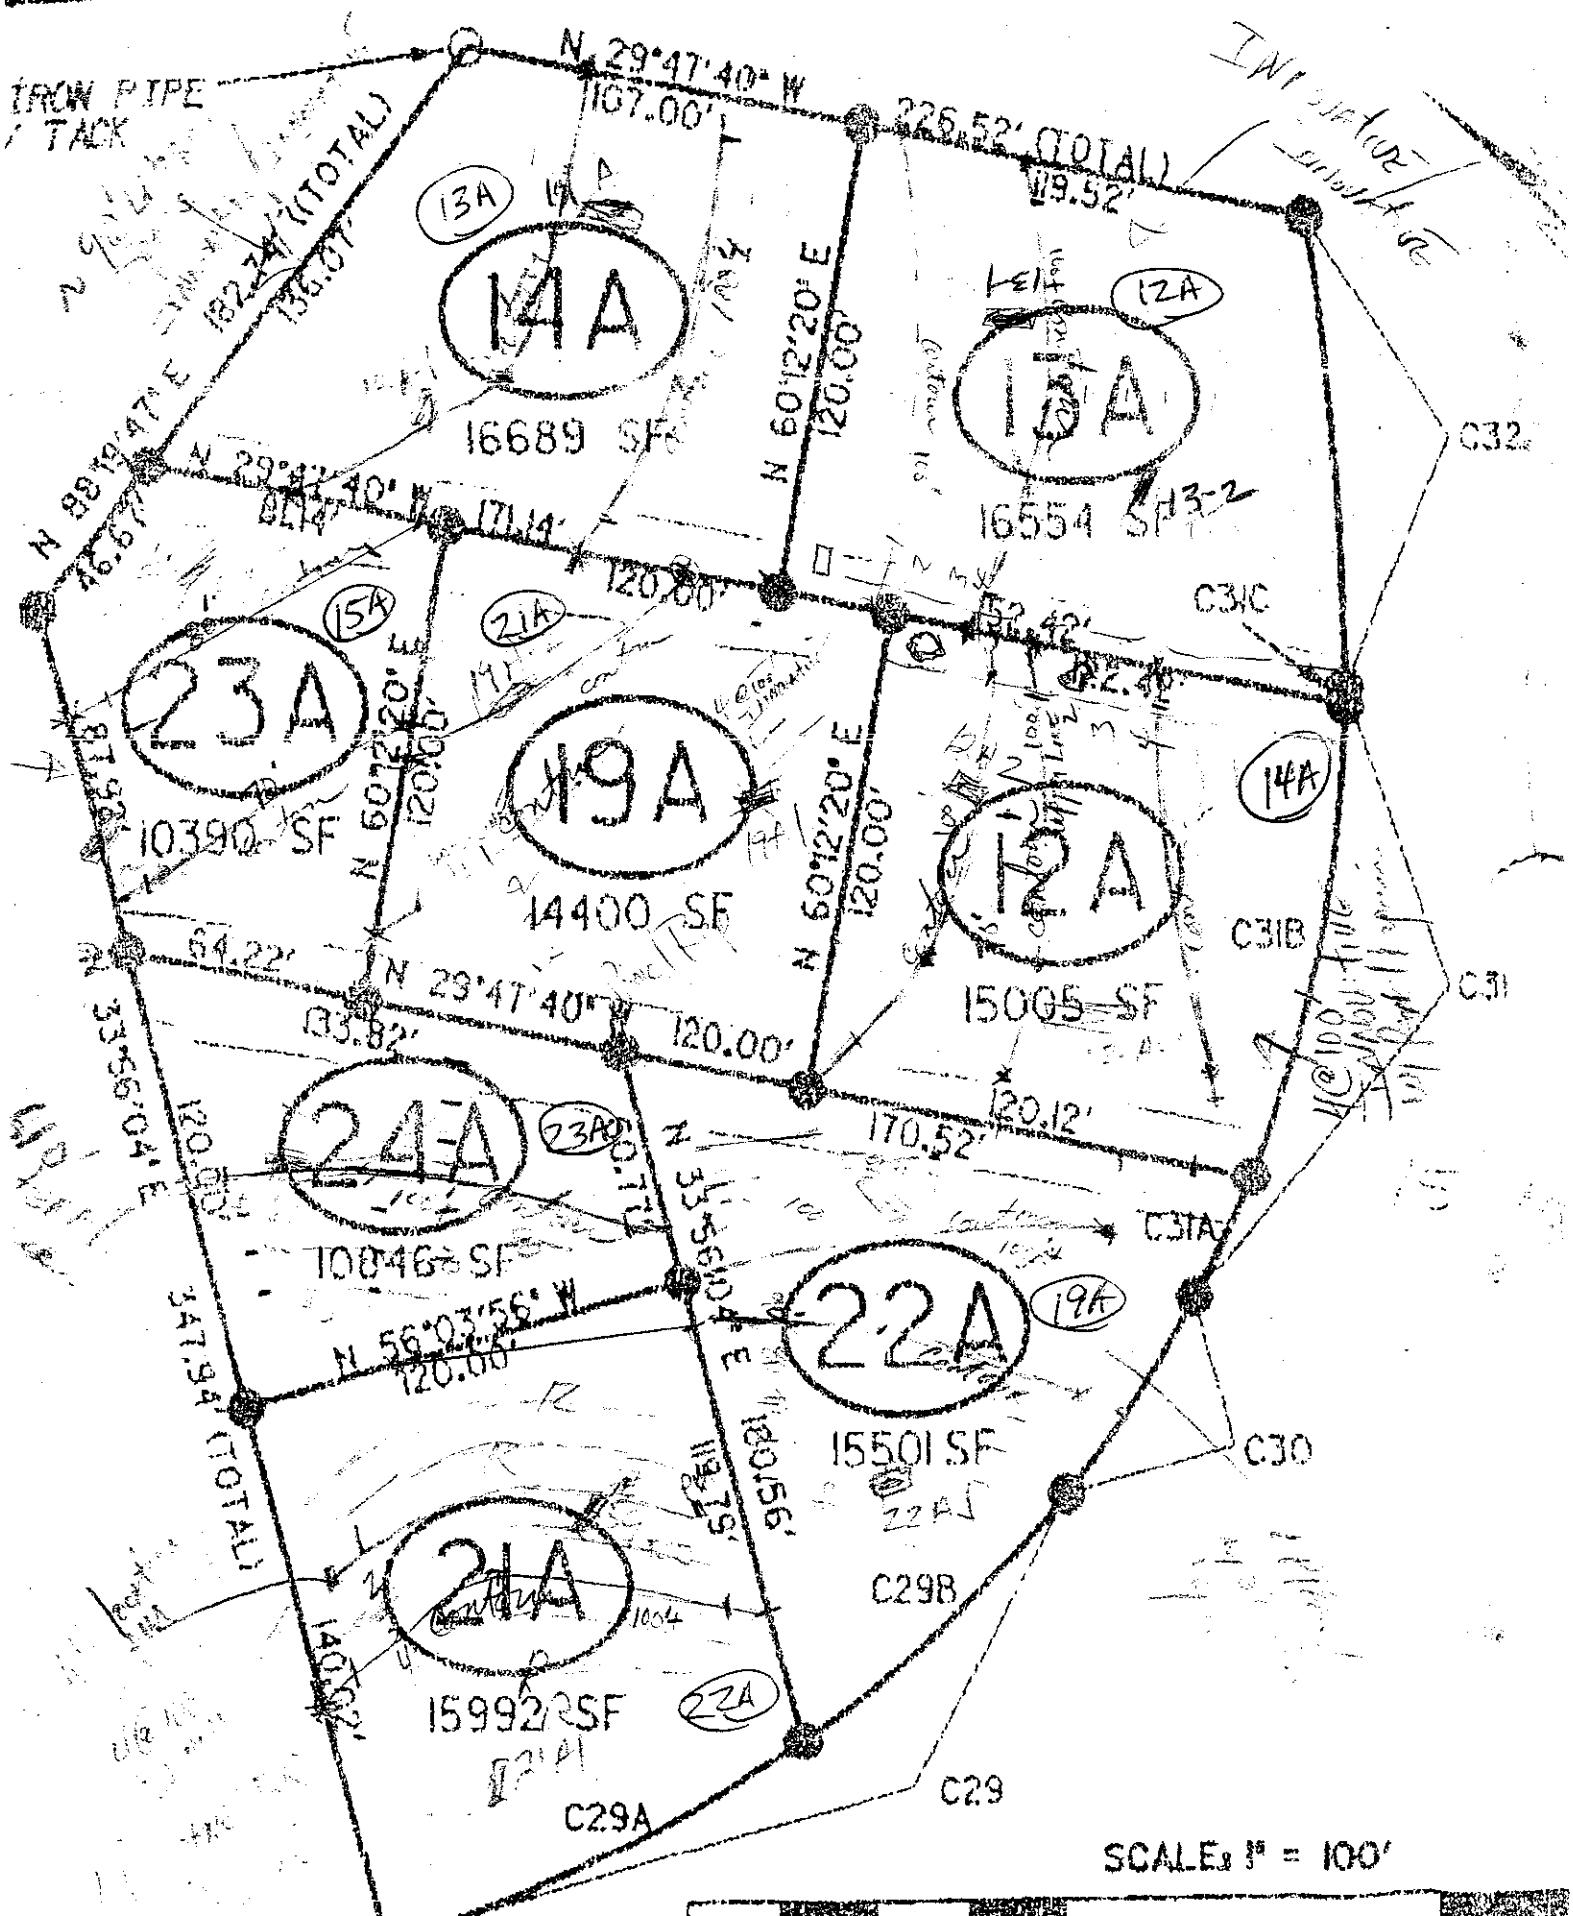
SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

ER: CRF APPLICANT:
DRESS: APPLICATION DATE: DATE EVALUATED: 10-20-00
POSED FACILITY: PROPOSED DESIGN FLOW (.1949): PROPERTY SIZE:
ATION OF SITE: Wildwood Cove Lot 8 SFEs PROPERTY RECORDED:
TER SUPPLY: ☐ Private ☐ Public ☐ Well ☐ Spring ☐ Other
LUATION METHOD: ☐ Auger Boring ☐ Pit ☐ Cut
E OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed

.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	OTHER PROFILE FACTORS .1943 SOIL DEPTH	OTHER PROFILE FACTORS .1956 SAPRO CLASS	OTHER PROFILE FACTORS .1944 RESTR HORIZ	PROFILE CLASS & LTAR
13-2 (SFE 12A)	0-23	Snb scl	fr SSSO					PS 03
	23-37	wk Sbk fr scl/cl	L Common					
	37-48	wk Sbk/1MS yr	L Common					
13-1 SFE 12A	0-25	SAb RCL	fi-fr SSSO					PS 03
	25-45	wk Sbk AB CL	fi-fr SSSO					
14A	0-8	brn SCL/scl						PS 03
	8-32	SAb yr cl	fr SP-SSSO					
	32-46	wk Sbk/gran yr cl	fr SSSO					
14A-1	0-33	Snb RCL	fi-fr SSSPSSOP					PS 03
	33-46	wk Sbk RCL	Common fi-fr SSSP					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
lable Space (.1945)		
m Type(s)		
LTAR		

OTHER FACTORS (.1946):
SITE CLASSIFICATION (.1948):
EVALUATED BY:
OTHER(S) PRESENT:


IRON PIPE
/ TACK
N 29°47'40" W
107.00'
226.52' (TOTAL)
109.52'
182.24' (TOTAL)
136.01'
N 88°19'47" E
46.67'
13A
14A
14A
16689 SF
N 60°12'20" E
120.00'
12A
12A
16554 SF
C32
C31C
15A
21A
23A
10390 SF
19A
14400 SF
N 60°12'20" E
120.00'
14A
12A
15005 SF
C31B
C31
64.22'
N 29°47'40" W
120.00'
33.82'
24-A
23A
10046 SF
170.52'
120.12'
C31A
N 56°03'56" W
120.00'
22A
19A
15501 SF
C30
C29B
21A
15992 SF
22A
C29A
C29
SCALE: 1" = 100'