I-SITE WASTEWATER SECTION

COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

NER: _____ APPLICANT: _____

DDRESS: _____ APPLICATION DATE: _____ DATE EVALUATED: 9/6/07

OPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): _____ PROPERTY SIZE: _____

CATION OF SITE: Site is Templeton Farms PROPERTY RECORDED: _____

ATER SUPPLY: ☐ Private ☐ Public ☐ Well ☐ Spring ☐ Other _____

ALUATION METHOD: ☐ Auger Boring ☐ Pit ☐ Cut

PE OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed

42-3 0-7 fr sssp-sp
7-29 mod pe fr sssp-sp
29-41 mod pl fr sssp common inf sap

.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
39-1 low 55A	0-21	mfsabk fr Re	fr sssp-sp					
	21-43/48	mksabk ypcl	frsssp common inf sap					.3
39-2 Now 55A	0-3	wksabk brn sl	fr sssp					
	3-26	sabk RC	fr sp sspo					.3
	26-43	m-wksabk yr-mg cl	common inf sap-frsssp					
42-1	0-3	gr sl	fr sssp					
	3-26	sabk R	fr sssp					
	26-52	m-wksabk yr cl	frsssp few inf sap					.3
42-2	0-5	gr loam sl	fr sssp					
	5-32	sabk pe	fr sp sspo					.3
	32-49	wkfsabk gy cl	common inf sap-fr sssp					

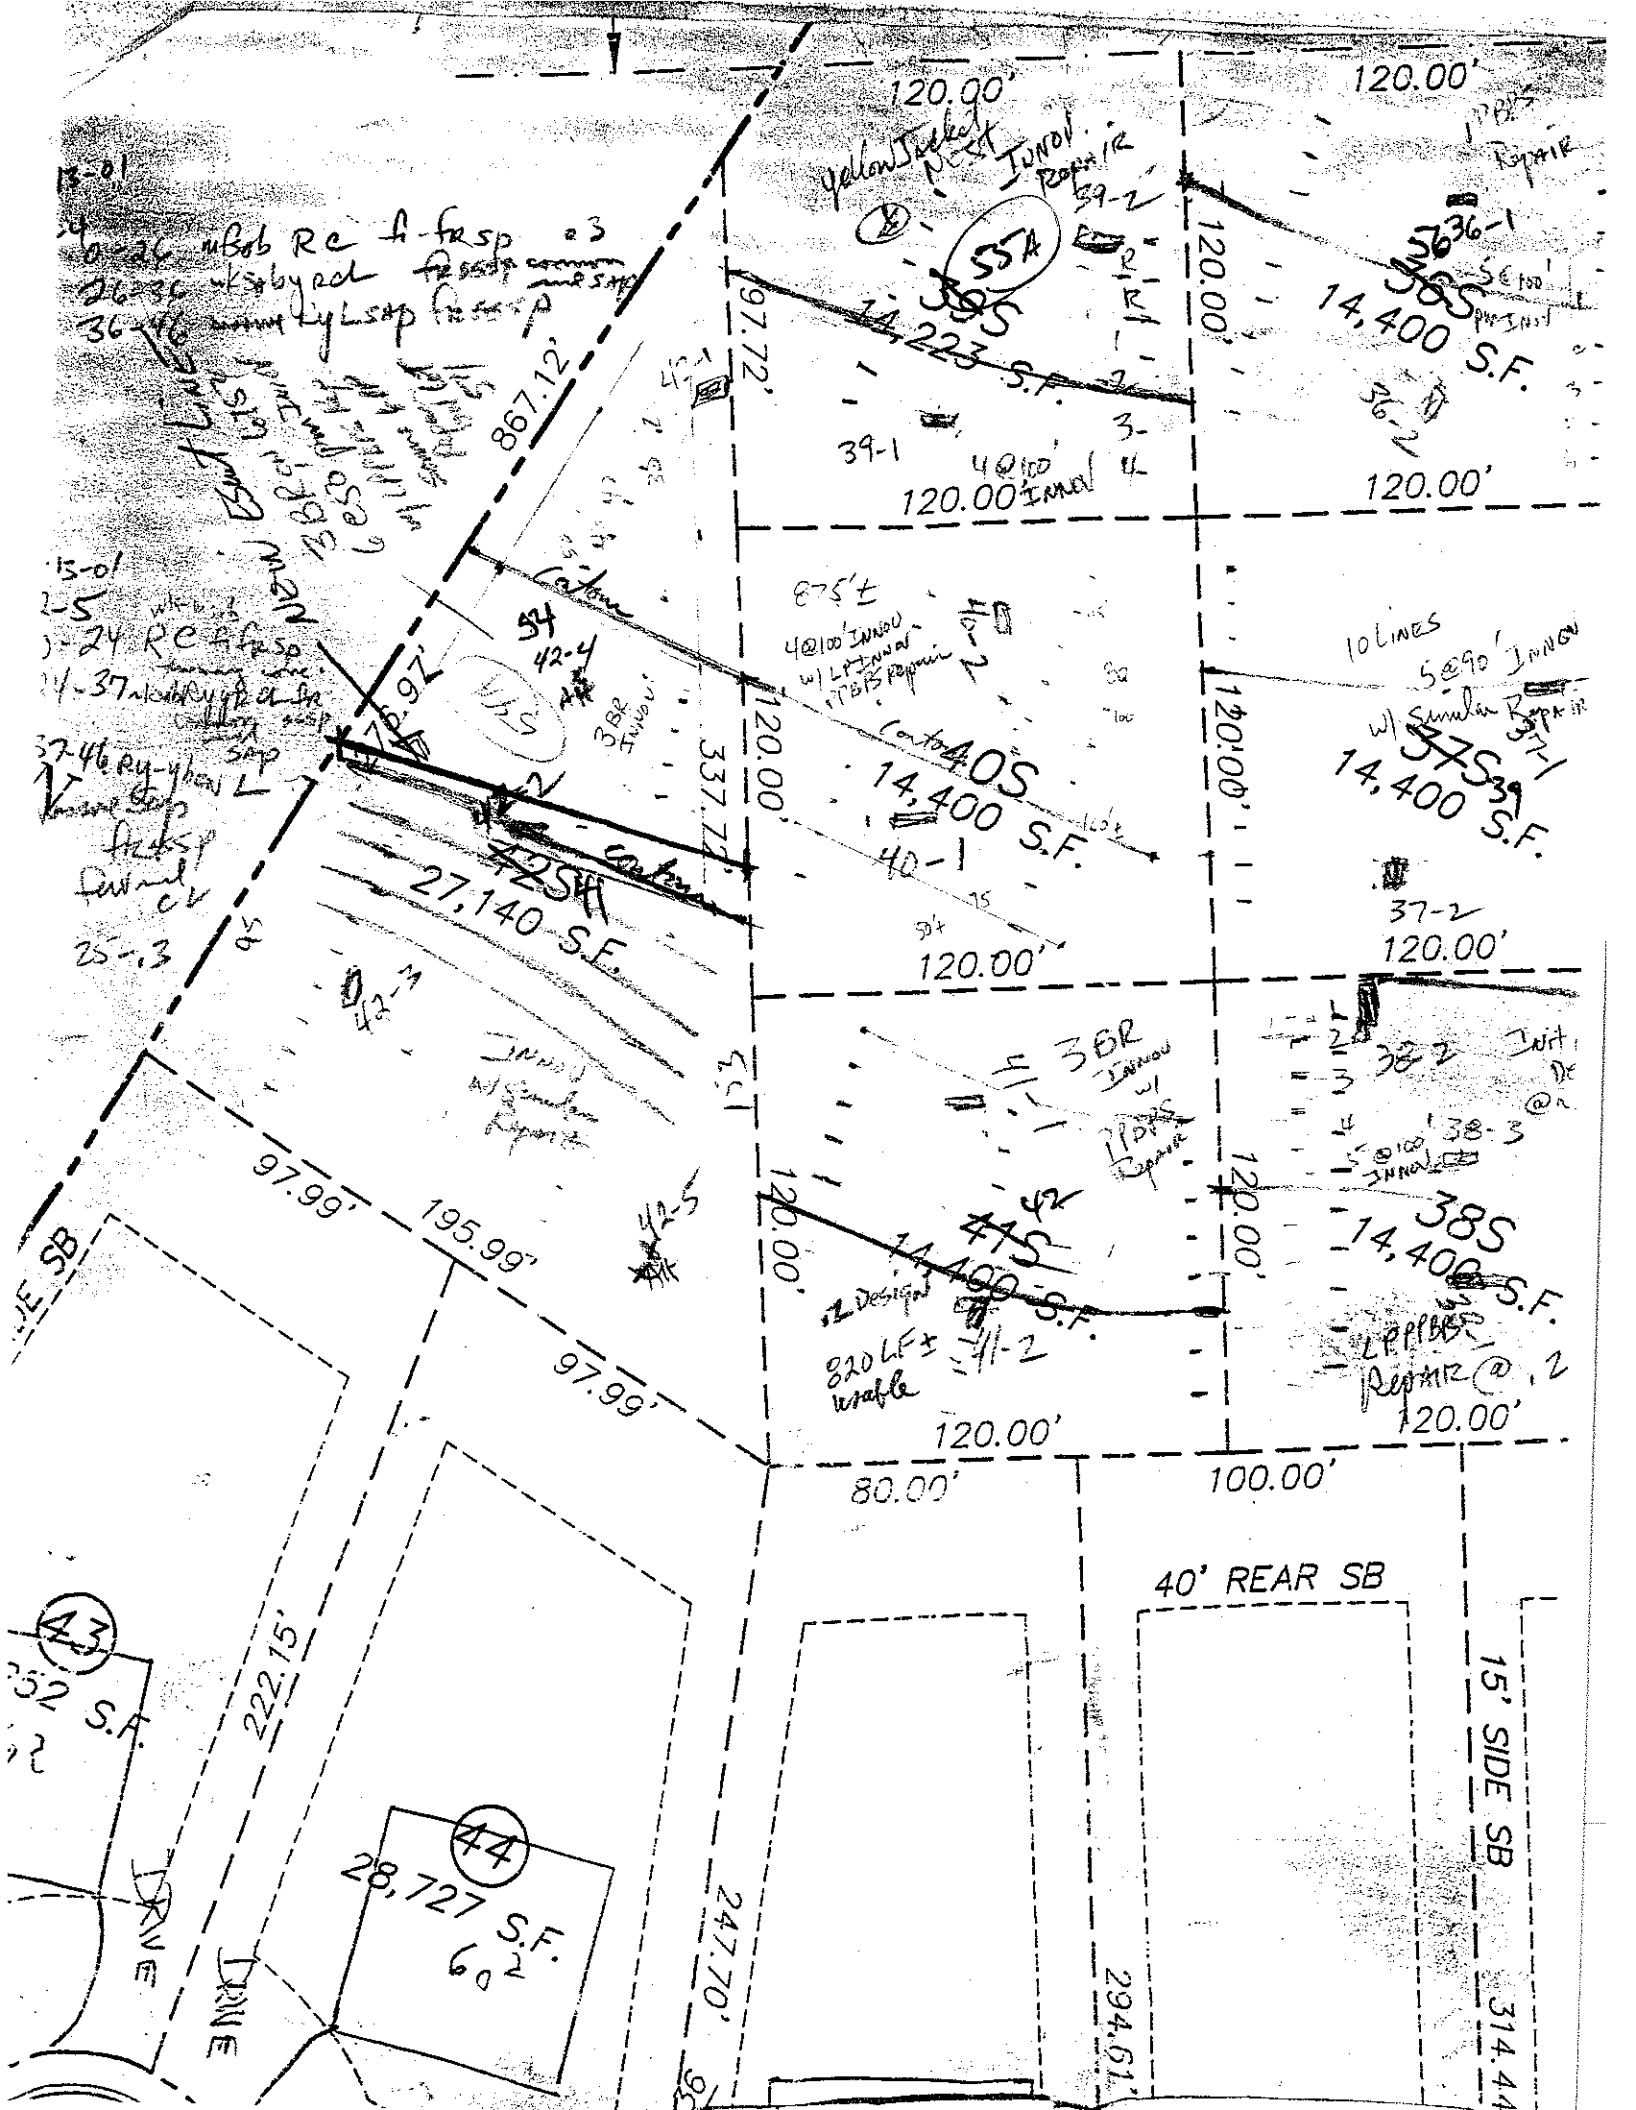
DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
able Space (.1945)		
m Type(s)		
TAR		

OTHER FACTORS (.1946): _____

SITE CLASSIFICATION (.1948): _____

EVALUATED BY: _____

OTHER(S) PRESENT: _____


120.00'
120.00'
867.12'
97.72'
337.77'
97.99'
195.99'
97.99'
120.00'
80.00'
100.00'
40' REAR SB
15' SIDE SB
222.15'
247.70'
294.61'
314.4
DRIVE
DRIVE
14,223 S.F.
14,400 S.F.
14,400 S.F.
27,140 S.F.
14,400 S.F.
14,400 S.F.
28,727 S.F.
S.F.
39-1
40-1
42-1
42-2
42-3
42-4
42-5
43
44
55A
Yellow Jacket
Cartons
3BR
1 1/2 BATH
10 LINES
820 LF ± Walk
Repair @ 2
Repair @ 3