DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

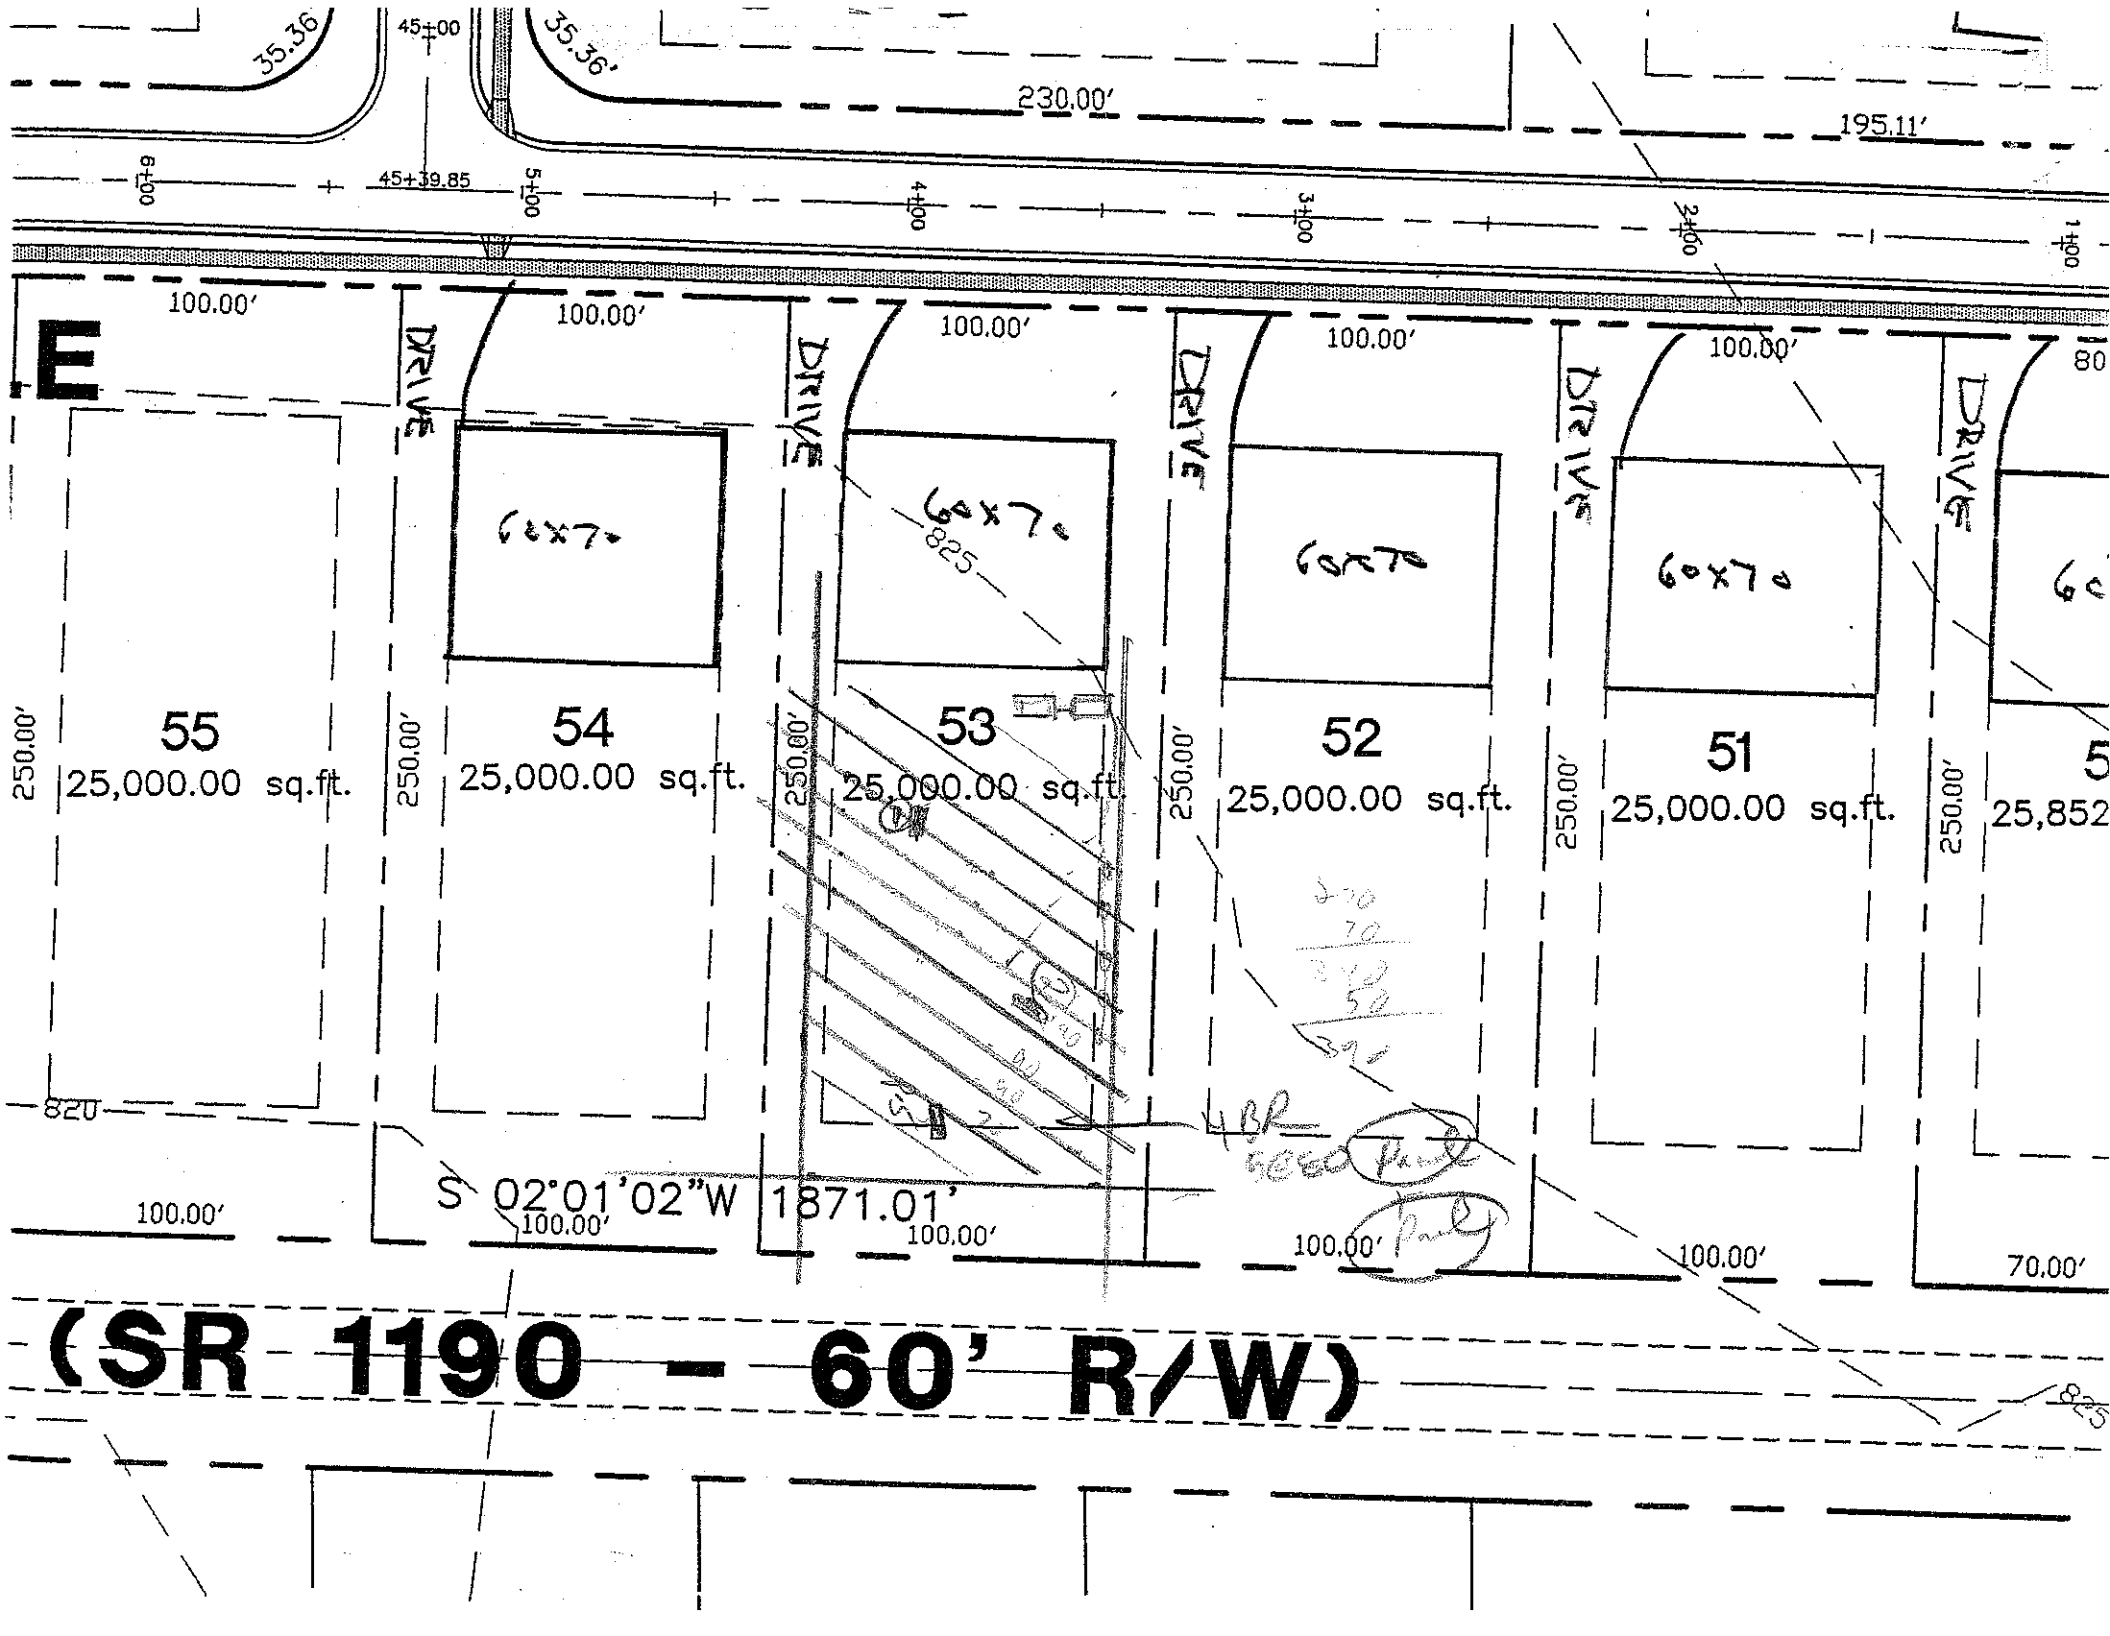
OWNER: _____ APPLICATION DATE _____
ADDRESS: _____ DATE EVALUATED: 5-16-02
PROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): _____ PROPERTY SIZE: _____
LOCATION OF SITE: Lot 53 Sundown Cove PROPERTY RECORDED: _____
WATER SUPPLY: ☐ Private ☐ Public ☐ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☐ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1		0-8	Massive Phard						.25
		8-30	MAB RC	fi sp	few yellow & gray cons.				
		30-46	m SBK ye cl	fi sp	common ind sp				
		46-55	massive Ry L sap	fi ss sp	few mott cl				
2		0-11	massive brn sol						.2
		11-52	mo SBK cl/cl	fr sp	common ind sp few common manf. cons				
3	P S TCU	0-9	dry massive Sol						.2-
		9-37	AB fine RC	fi sp	ind sp few				
		37-55	M SBK ye LSap	fi ss sp	few mott cl				
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		
System Type(s)		
Site LTAR		

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): _____
EVALUATED BY: _____
OTHER(S) PRESENT: _____

COMMENTS: _____


35.36'
45+00
35.36'
230.00'
195.11'
6+00
45+39.85
5+00
4+00
3+00
2+00
1+00
E
100.00'
DRIVE
6x7.
825
60x70
55
25,000.00 sq.ft.
54
25,000.00 sq.ft.
53
25,000.00 sq.ft.
52
25,000.00 sq.ft.
51
25,000.00 sq.ft.
250.00'
820
S 02°01'02"W 1871.01'
70.00'
(SR 1190 - 60' R/W)