DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet 1 of 1
PROPERTY ID #:
COUNTY: IREDELL

4646-42-9482

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: COLLINGTHAN BUILDERS, LTD
ADDRESS: P.O. BOX 990, DENVER NC 28037
PROPOSED FACILITY: 4 BR HOUSE
PROPOSED DESIGN FLOW (.1949): 480
LOCATION OF SITE: CATALINA RIDGE LOT #6
APPLICATION DATE 6-18-07
DATE EVALUATED: 6-18-07
PROPERTY SIZE: 33,218 ft²
PROPERTY RECORDED:

WATER SUPPLY: ☑ Private ☐ Public ☑ Well ☐ Spring ☐ Other
EVALUATION METHOD: ~~Auger Boring~~ ☑ Pit ☐ Cut
TYPE OF WASTEWATER: ☑ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	L 32	0-3	wfSBK CL	FR SS/SP SSPL					PS 0.25
		3-42	MM & wfSBK C	FI S/SP SSPL					
		42-58	wfSBK CL	FR SS/SP SSPL					
2	L 32	0-3	wfSBK CL	FR SS/SP SSPL					PS 0.25
		3-48	MM & wfSBK C	FI S/SP SSPL					
		48-60	wfSBK CL	FR SS/SP SSPL					
3	L 32	0-3	wfSBK CL	FR SS/SP SSPL					PS 0.25
		3-48	MM & wfSBK C	FI S/SP SSPL					
		48-60	wfSBK CL	FR SS/SP SSPL					
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	IV	IV
Site LTAR	~~0.25~~ GPD	0.25 GPD

OTHER FACTORS (.1946): NONE
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: J. HEDRICK
OTHER(S) PRESENT: PTH L SCIENCES, ALICIA AGJON & HOE OPERATOR

COMMENTS:

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	Si (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiCL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			**MOIST**	**WET**
S (Shoulder Slope)		SiL (Silt Loam)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SiC (Silty Clay)			FI (Firm)	S (Sticky)
		C (Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None	None	EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

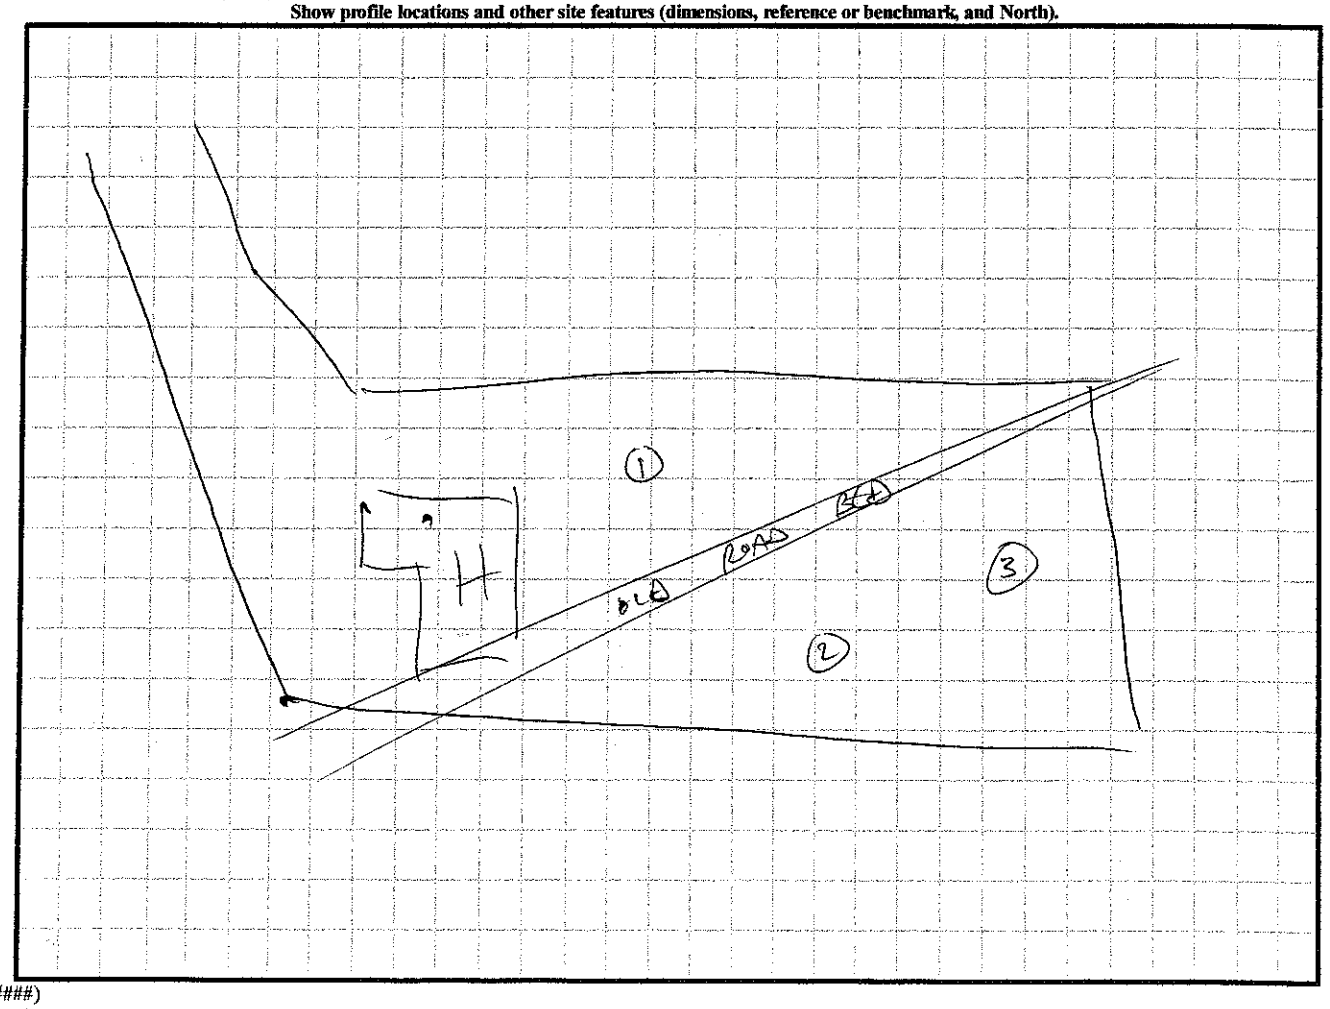

DENR (######)
Review (#####)