...WASTEWATER SECTION

PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

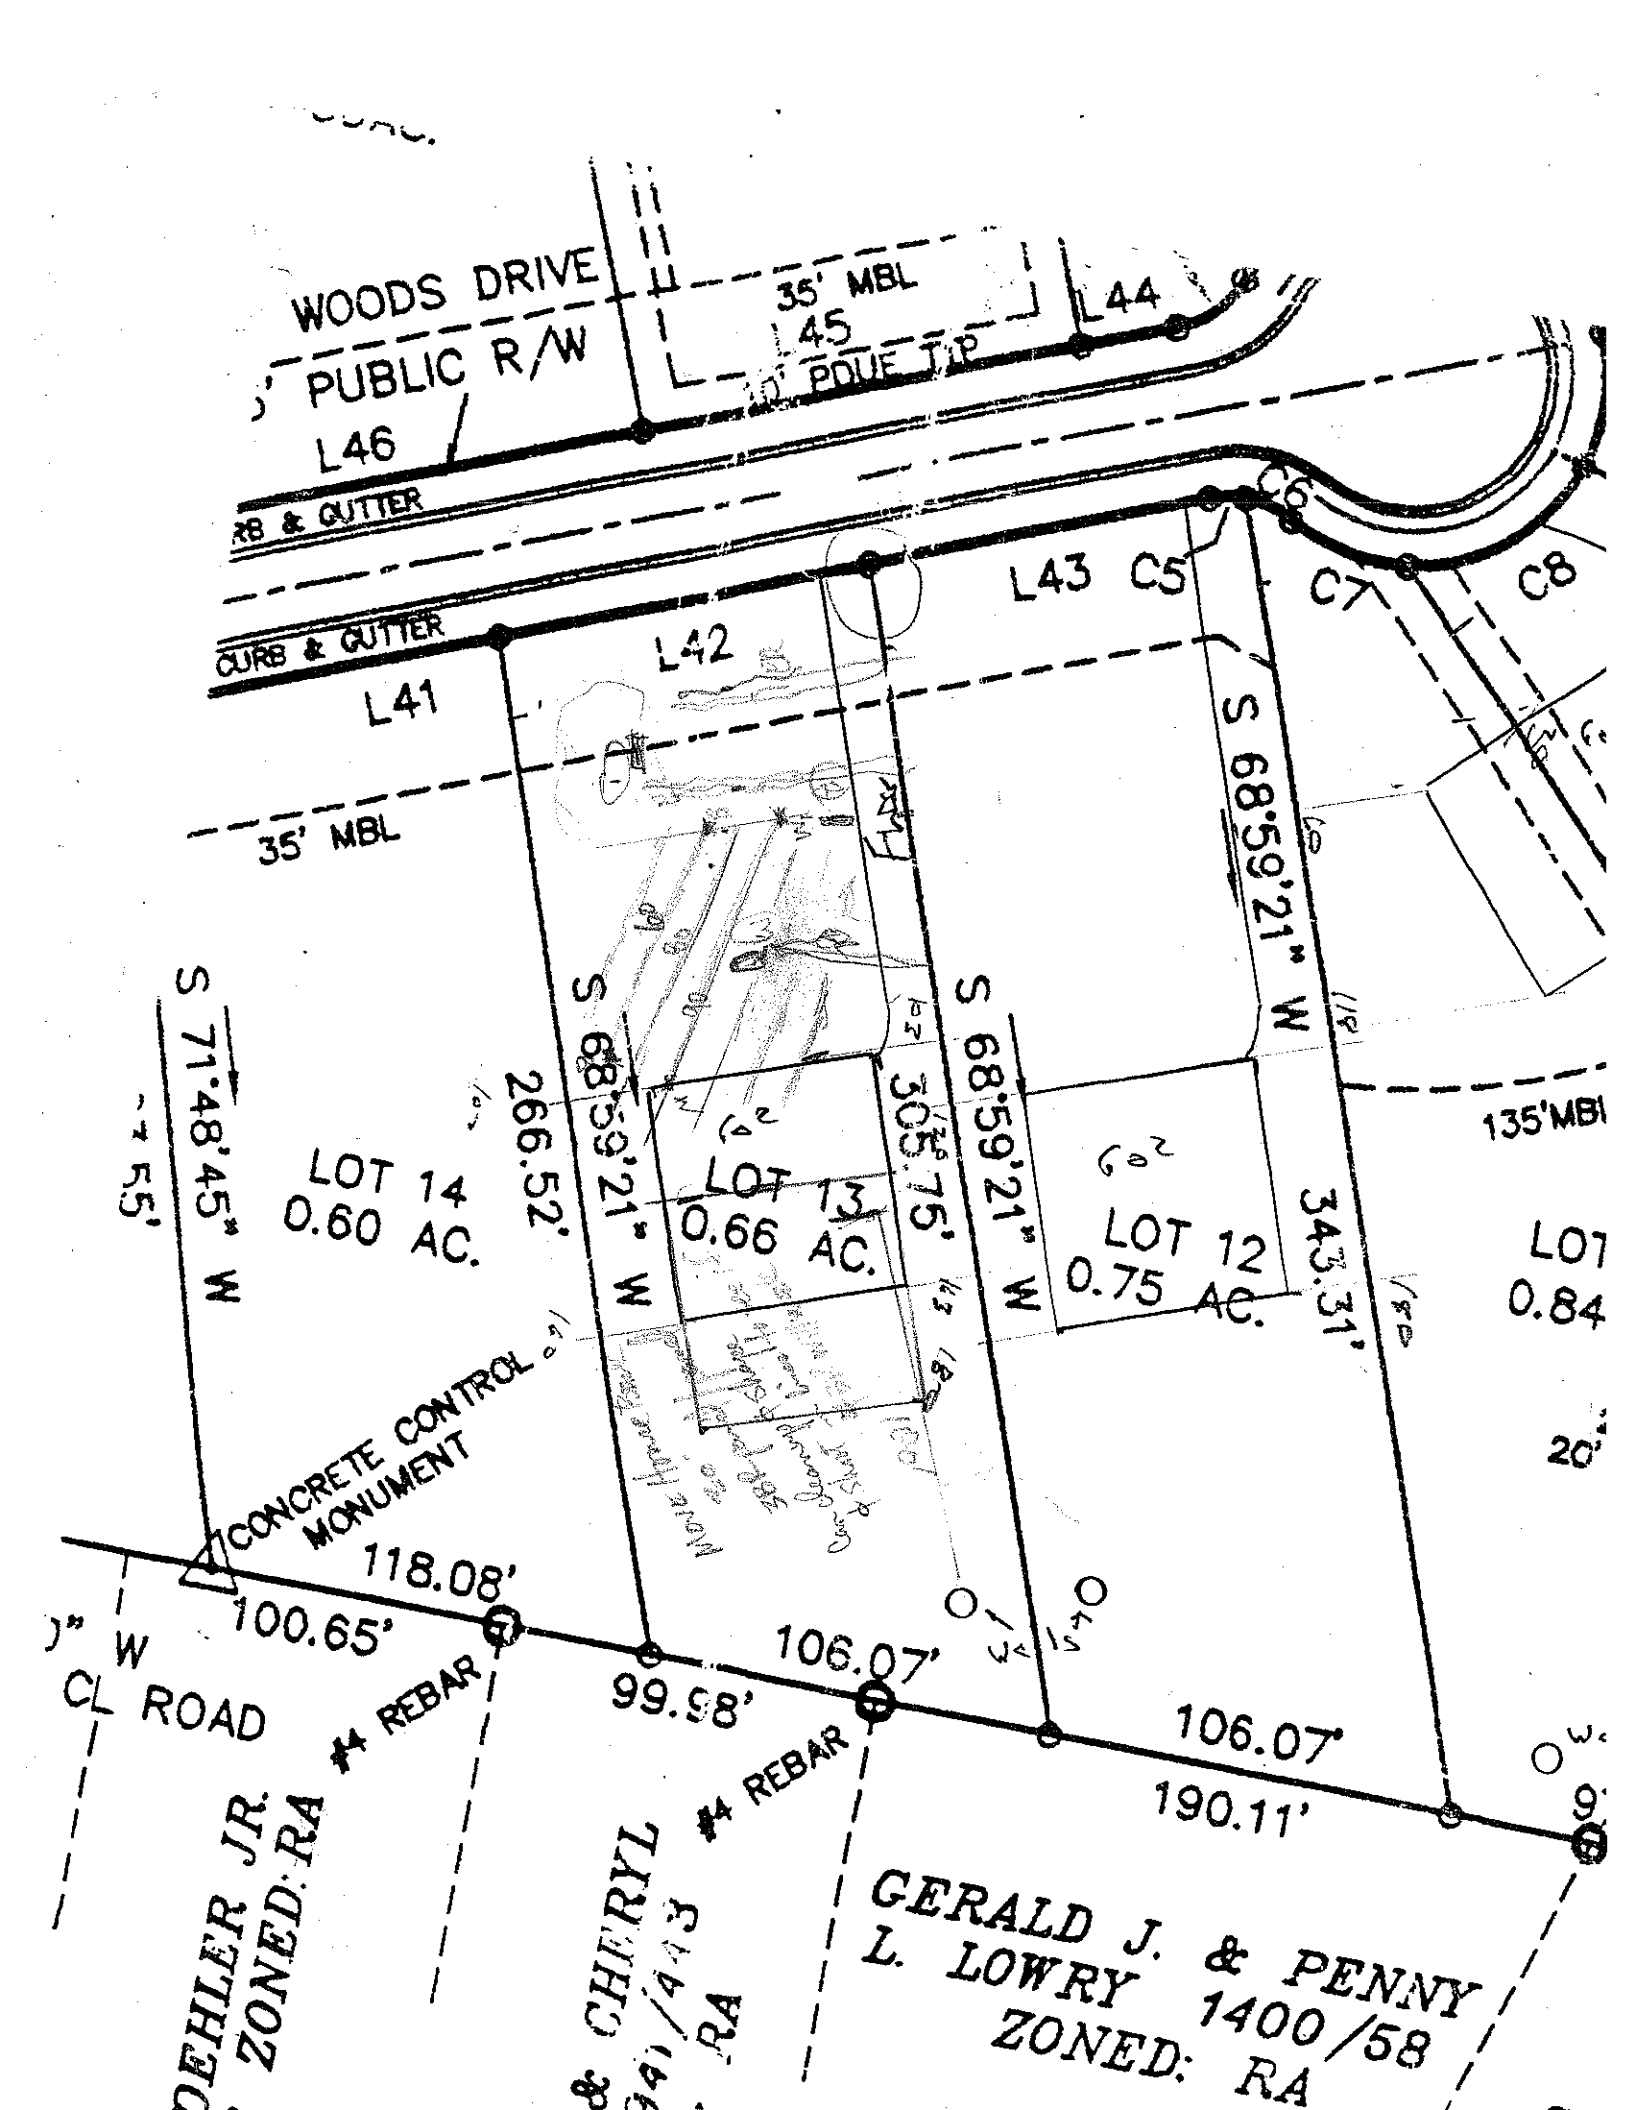
WNER: _____ APPLICATION DATE _____
DDRESS: _____
ROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): _____ DATE EVALUATED: 1-23-04
OCATION OF SITE: Lot 13 Cedar Woods PROPERTY SIZE: _____
ATER SUPPLY: ☒ Private ☐ Public ☒ Well ☐ Spring ☐ Other _____ PROPERTY RECORDED: _____
VALUATION METHOD: ☐ Auger Boring ☒ Pit ☐ Cut
YPE OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LAND-SCAPE POSITION/ SLOPE %	HORI-ZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1		0-4	wk fsbk pbrn sl	fr ss p					.3
		4-27	mod fsbk RC	fr ss p stky					
		27-52	mod fsbk yel	fi-fr ss p	few gravel mi/ss p				
					few gravel mi/ss p				
2		0-4	wk sbk pbrn sl	fr ss p					.3
		4-34	mod sbk RC	fr sl stky p					
		34-60	wk fsbk R-yel cl	fi-fr ss p	few mi/ss p				
3	8-10%	0-28	mod fsbk RC	fr ss p	few gravel mi/ss p				.25
		28-51	wk fsbk RC/gl	fi-fr ss p	few fine mi/ss p				
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	*PS	*PS
System Type(s)	LPPBPS	LPPBPS
Site LTAR	.25-.3	.25-.3

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: DL Hamm
OTHER(S) PRESENT: Neil Hemmings

*Application revised to 3BR due to Available Space


WOODS DRIVE
PUBLIC R/W
35' MBL
L44
L45
L46
CURB & GUTTER
CURB & GUTTER
L43
C5
C6
C7
C8
L42
L41
35' MBL
S 68°59'21" W
S 68°59'21" W
S 68°59'21" W
S 71°48'45" W
266.52'
305.75'
343.31'
LOT 14
0.60 AC.
LOT 13
0.66 AC.
LOT 12
0.75 AC.
135'MBL
CONCRETE CONTROL MONUMENT
118.08'
100.65'
99.98'
106.07'
106.07'
190.11'
#4 REBAR
#4 REBAR
CL ROAD
GERALD J. & PENNY L. LOWRY 1400/58
ZONED: RA