~~4639917423~~ 4649010581

IREDELL COUNTY HEALTH DEPARTMENT

10081

(SEPTIC TANK) IMPROVEMENTS PERMIT AND CERTIFICATE OF COMPLETION
(Ground Absorption Sewage Disposal System -- G. S. Chapter 130-Article 13C)

OWNER OR CONTRACTOR Rocky Mt United Meth. Church Parsonage DATE Jan 2, '90 PERMIT NO. 25-A-2472

PHONE: Business _____ Home _____

LOCATION 150 w. SR 1303 (Peeks Rd) on left ~1/4 mile before get w/ Jades Rd. (1378) S. R. No. _____

SUBDIVISION NAME _____ LOT NO. _____ SECTION OR BLOCK NO. _____


House (✓) Mobile Home ( ) Business ( ) Other _____

No. Bedrooms 4 No. Bathrooms 2½

Garbage Disposal Unit	Yes (✓)	No ( )	Character & Porosity of Soil	P.S. clay
Auto. Dishwasher	Yes (✓)	No ( )	Percolation Rate	1 in 4
Auto. Wash. Machine	Yes (✓)	No ( )	Topography	4-6%
Site Suitable	Yes (✓)	No ( )	Depth to Water Table	4'+
			Rock or other impervious formations	none obs.

Lot Area 1.43 AC.

_____ Basement with Plumbing _____ Basement without Plumbing ___✓___ No Basement

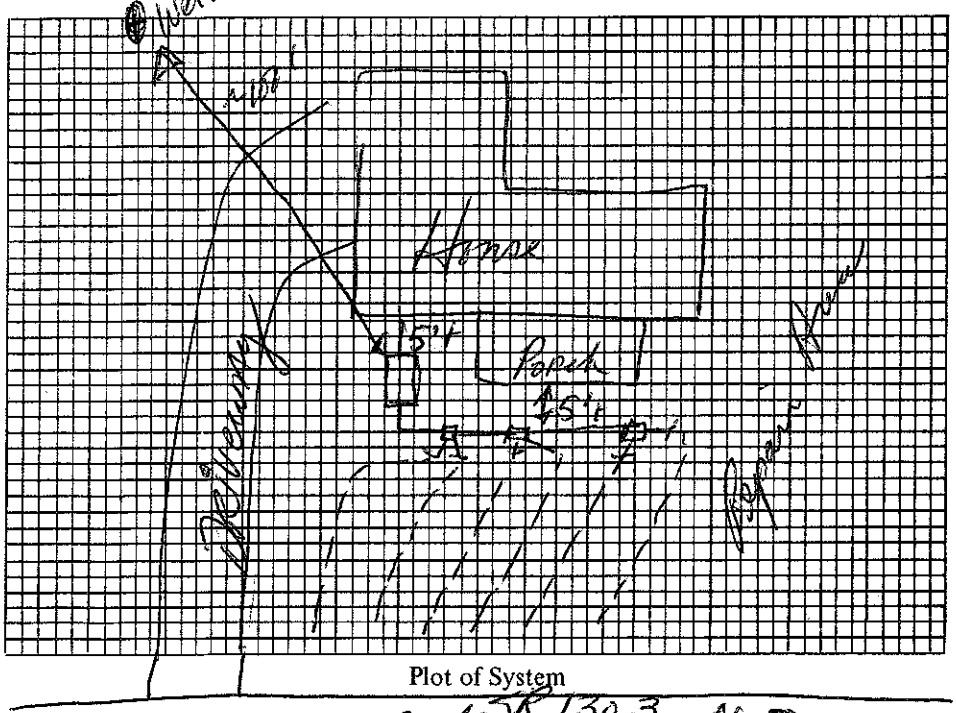

Plot of System

IMPROVEMENTS PERMIT BY DRH SR 1303 N →

Size of Tank 1500 Gals.

Nitrification Field:
No. of Lines 6
Sq. Ft. 1200 Linear Ft. 400
Depth of Stone in Lines 12"

Water Supply: Individual (✓)
Public ( )

Installed by David Yountz

I understand and agree to install septic tank system as specified on this Improvements Permit.

Signed: _____

COMMENTS: _____

CERTIFICATE OF COMPLETION BY D R Hinson, RS DATE Jan 4, '90

EXISTING SYSTEM CHECKED BY: _____ DATE _____

CONSTRUCTION MUST COMPLY WITH ALL OTHER APPLICABLE STATE AND LOCAL REGULATIONS.

Permit is VOID if any unauthorized changes are made in installation of system and/or if any false information is supplied in making Improvements Permit.

Health Dept. Copy: White Inspection Dept. Copy: Yellow Sanitarian's Copy: Pink Owner's Copy: Gold

11:30-12:00

IREDELL COUNTY HEALTH DEPARTMENT

10081

(SEPTIC TANK) IMPROVEMENTS PERMIT AND CERTIFICATE OF COMPLETION

(Ground Absorption Sewage Disposal System – G. S. Chapter 130-Article 13C)

OWNER OR CONTRACTOR Rocky Mount United Methodist Church Parsonage DATE June 19, '89 PERMIT NO. _____

PHONE: Business _____ Home _____

LOCATION 1.5 ow. TR 1303 (Peeth Rd.) past Rocky Mt. Methodist Church on left (~1/8-1/4 mile before jct w/Judas Rd.) S. R. No. _____

SUBDIVISION NAME _____ LOT NO. _____ SECTION OR BLOCK NO. _____

House (✓) Mobile Home ( ) Business ( ) Other _____

No. Bedrooms 4 No. Bathrooms 2½

Garbage Disposal Unit Yes (✓) No ( )

Auto. Dishwasher Yes (✓) No ( )

Auto. Wash. Machine Yes (✓) No ( )

Site ~~Suitable~~ PS Yes (✓) No ( )

Lot Area ~1.43Ac

Character & Porosity of Soil clay


Percolation Rate 20-4

Topography 2-6%

Depth to Water Table 4'+

Rock or other impervious formations none obs.

_____ Basement with Plumbing _____ Basement without Plumbing ✓ No Basement

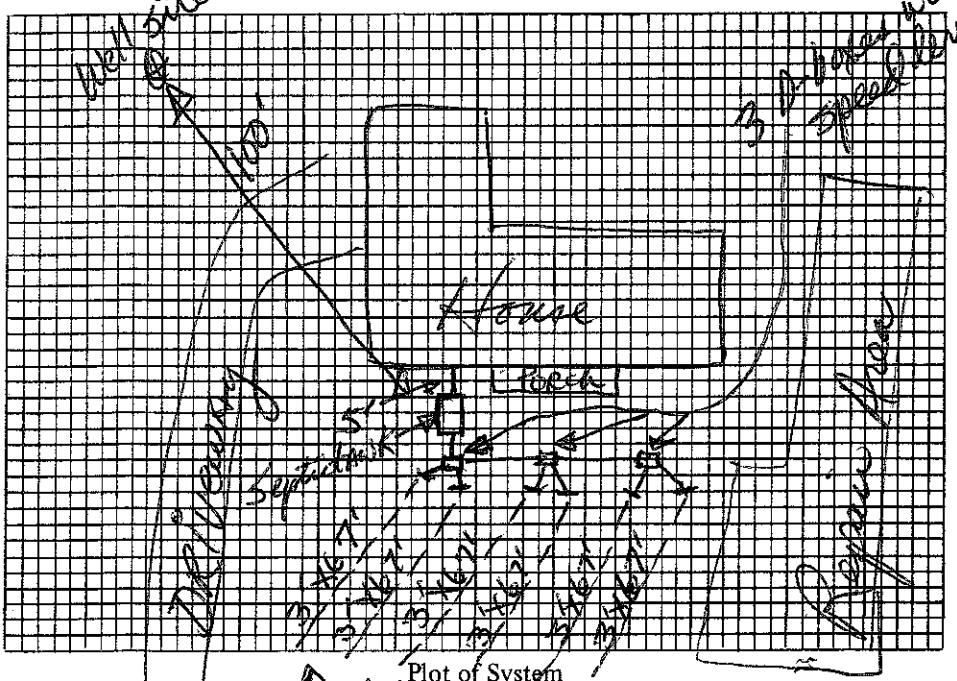

Size of Tank 1500 Gals.

Nitrification Field:

No. of Lines ~6

Sq. Ft. 1200 Linear Ft. 400

Depth of Stone in Lines 12"

Water Supply: Individual (✓)

Public ( )

Installed by _____

I understand and agree to install septic tank system as specified on this Improvements Permit.

Signed: ✗ Jim Monster

IMPROVEMENTS PERMIT BY _____, R.S.

COMMENTS: SR 1303

Follow contour with drainfield. Trench bottom depth to be 30". Use 3 D-boxes with speed levelers. 4" Sch 40 between boxes and at least 2'+ from box to "working" trench.

CERTIFICATE OF COMPLETION BY _____ DATE _____

EXISTING SYSTEM CHECKED BY: _____ DATE _____

CONSTRUCTION MUST COMPLY WITH ALL OTHER APPLICABLE STATE AND LOCAL REGULATIONS.

Permit is VOID if any unauthorized changes are made in installation of system and/or if any false information is supplied in making Improvements Permit.

Health Dept. Copy: White Inspection Dept. Copy: Yellow Sanitarian's Copy: Pink Owner's Copy: Gold