N-SITE WASTEWATER SECTION

PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

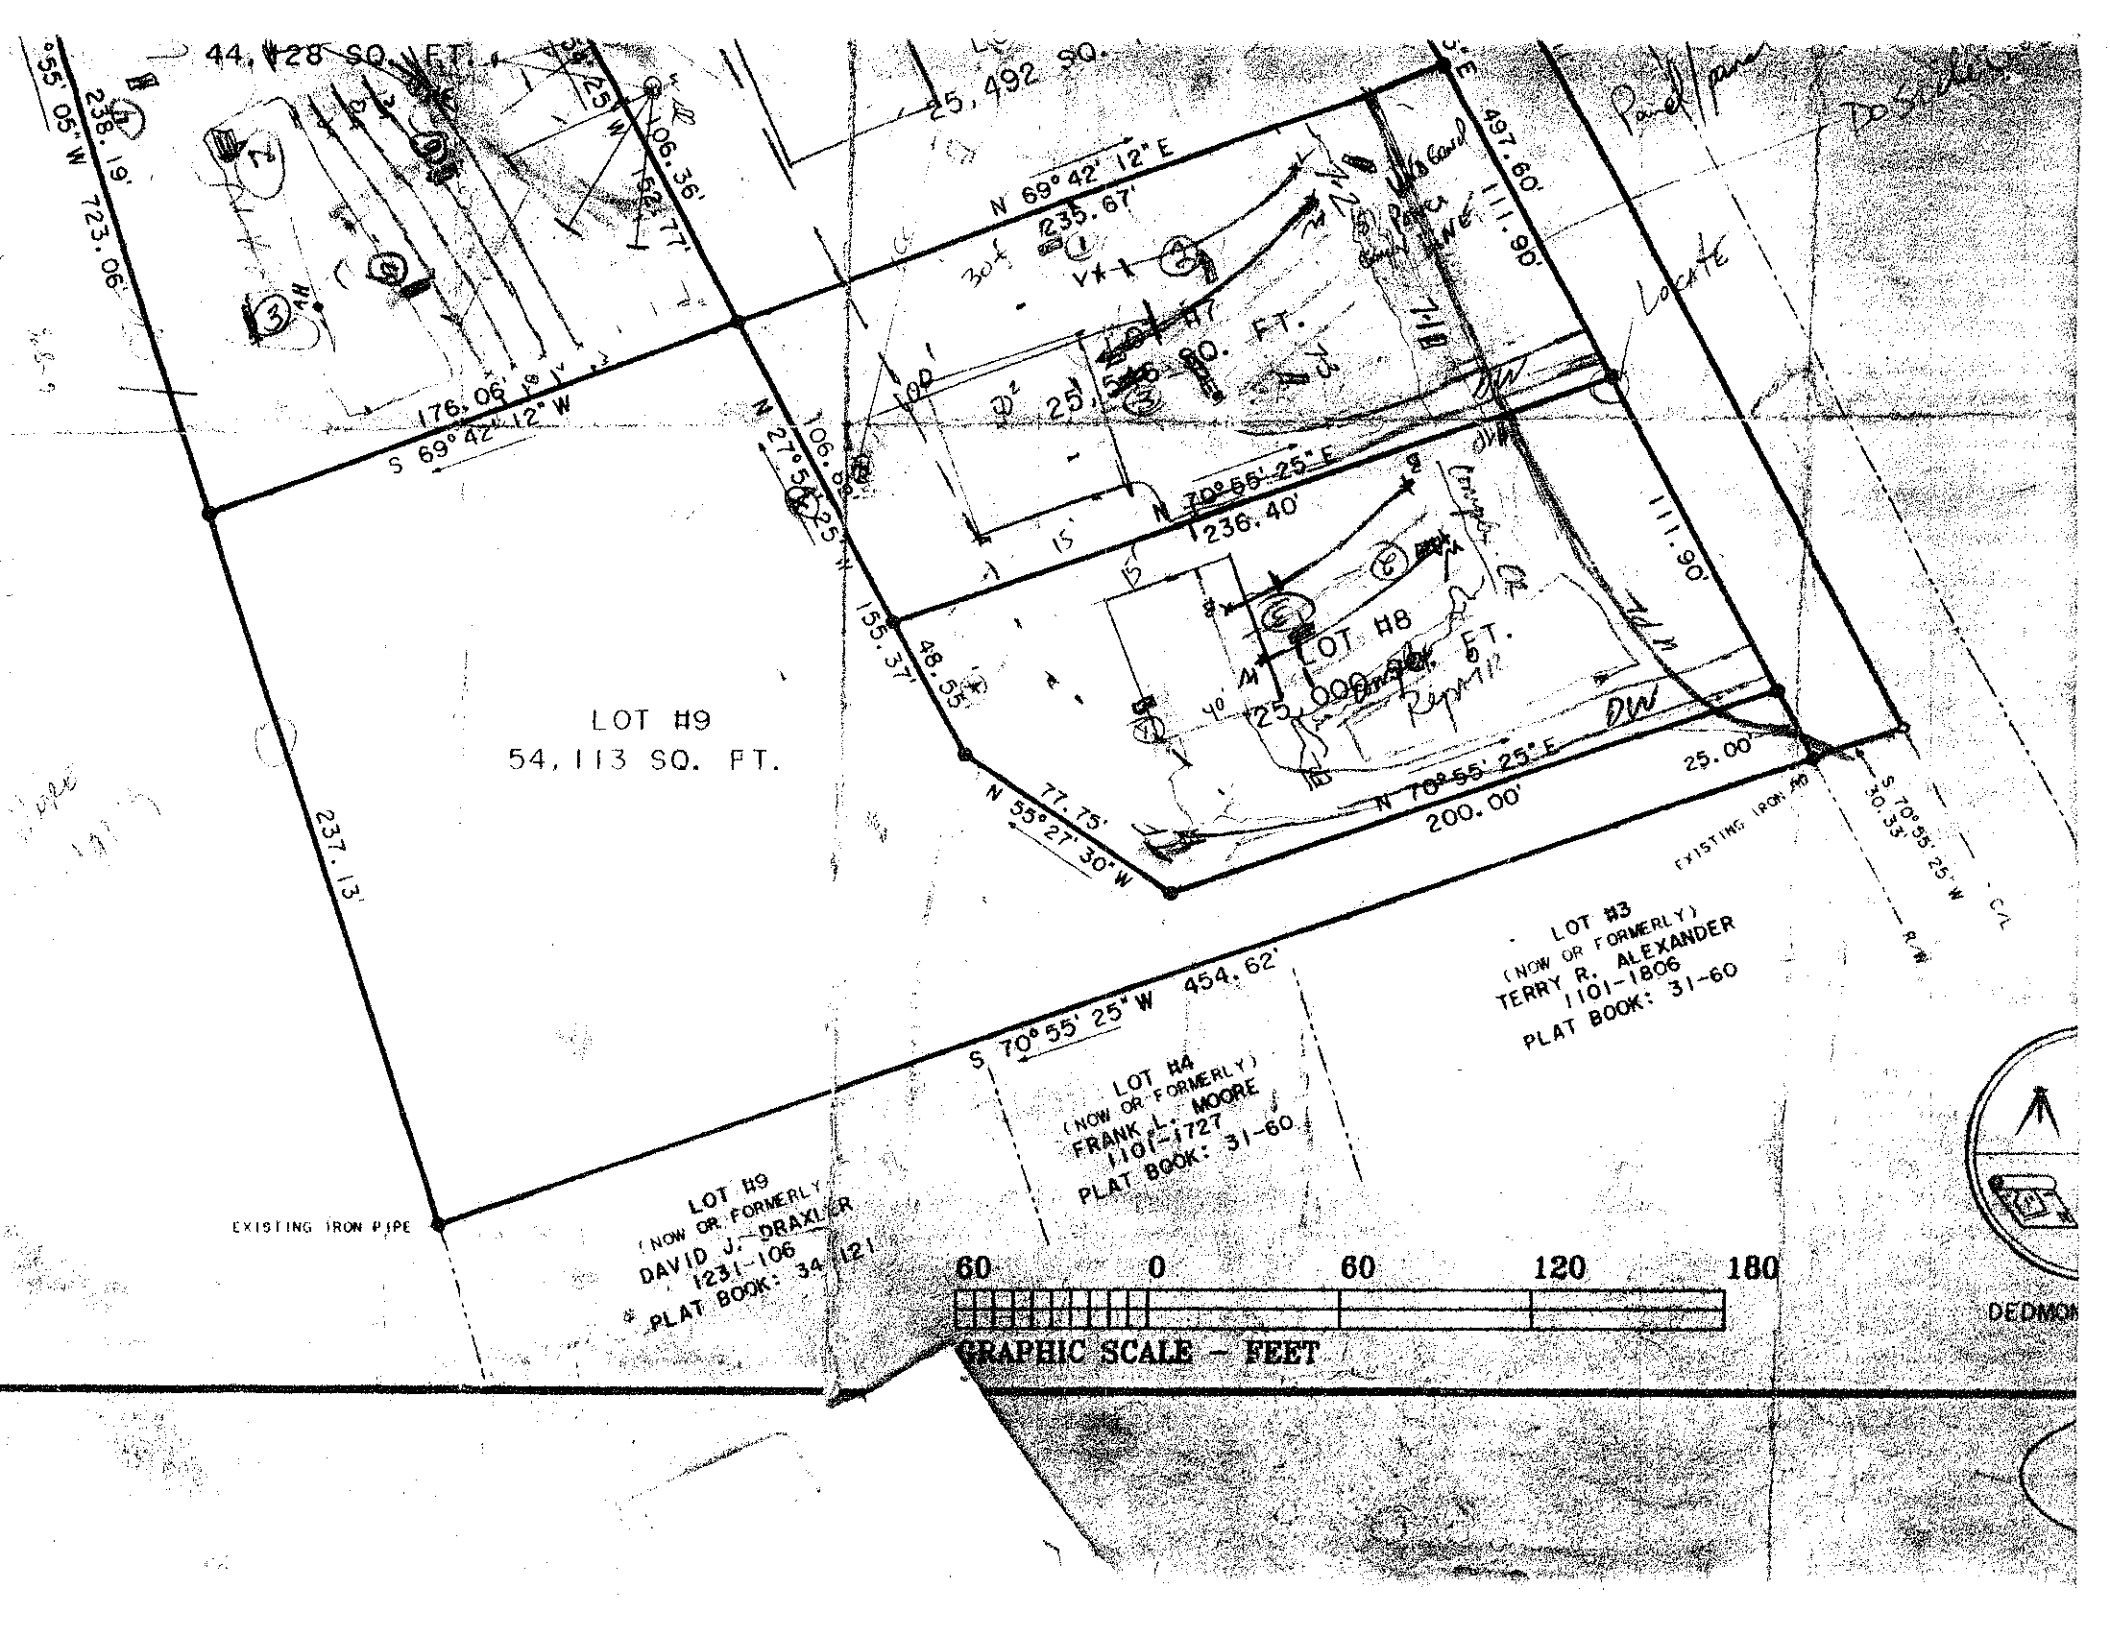
WNER: _____ APPLICATION DATE: _____
DDRESS: _____ DATE EVALUATED: 2-13-04
ROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): _____ PROPERTY SIZE: _____
OCATION OF SITE: lot 8 Tanglewood PROPERTY RECORDED: _____
/ATER SUPPLY: ☐ Private ☐ Public ☐ Well ☐ Spring ☐ Other _____
VALUATION METHOD: ☐ Auger Boring ☐ Pit ☐ Cut
YPE OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LAND-SCAPE POSITION/ SLOPE %	HORI-ZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1		0-23	SBK rc	fi SP					
		23-36	massive SL/LSap	friSP	fair mott				x.25
					* too close to well site				(4)
2	8%	0-3	gr loam SL/sbk fr						
		3-22	m-f sm ABK loam c fi SP SAP						
		22-48	massive pyLSap	friSP	fair mott in matrix & channels, redoximorphic				.25
		-60+	" "	"					
			~~fi SP~~						
3		0-14"	compacted c/ wd Sap						
		14-60	massive SL Sap	friSP					.3 > 14"
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	LPPBGS	LPPBGS
LTAR	.25-.3	.25-.3

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: DRA
OTHER(S) PRESENT: _____

COMMENTS: _____


44,128 SQ. FT.
25,492 SQ.
S 55° 05" W 723.06'
238.19'
106.36'
N 69° 42' 12" E
235.67'
497.60'
111.90'
176.06'
S 69° 42' 12" W
N 27° 55' 25" W
106.00'
N 70° 55' 25" E
236.40'
LOT #8
25,000 SQ. FT.
155.37'
48.55'
111.90'
LOT #9
54,113 SQ. FT.
237.13'
N 55° 27' 30" W
77.75'
N 70° 55' 25" E
200.00'
25.00'
S 70° 55' 25" W
30.33'
S 70° 55' 25" W 454.62'
LOT #3
(NOW OR FORMERLY)
TERRY R. ALEXANDER
1101-1806
PLAT BOOK: 31-60
LOT #4
(NOW OR FORMERLY)
FRANK L. MOORE
1101-1727
PLAT BOOK: 31-60
LOT #9
(NOW OR FORMERLY)
DAVID J. DRAXLER
1231-106
PLAT BOOK: 34-121
EXISTING IRON PIPE
60 0 60 120 180
GRAPHIC SCALE - FEET