N-SITE WASTEWATER SECTION

PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

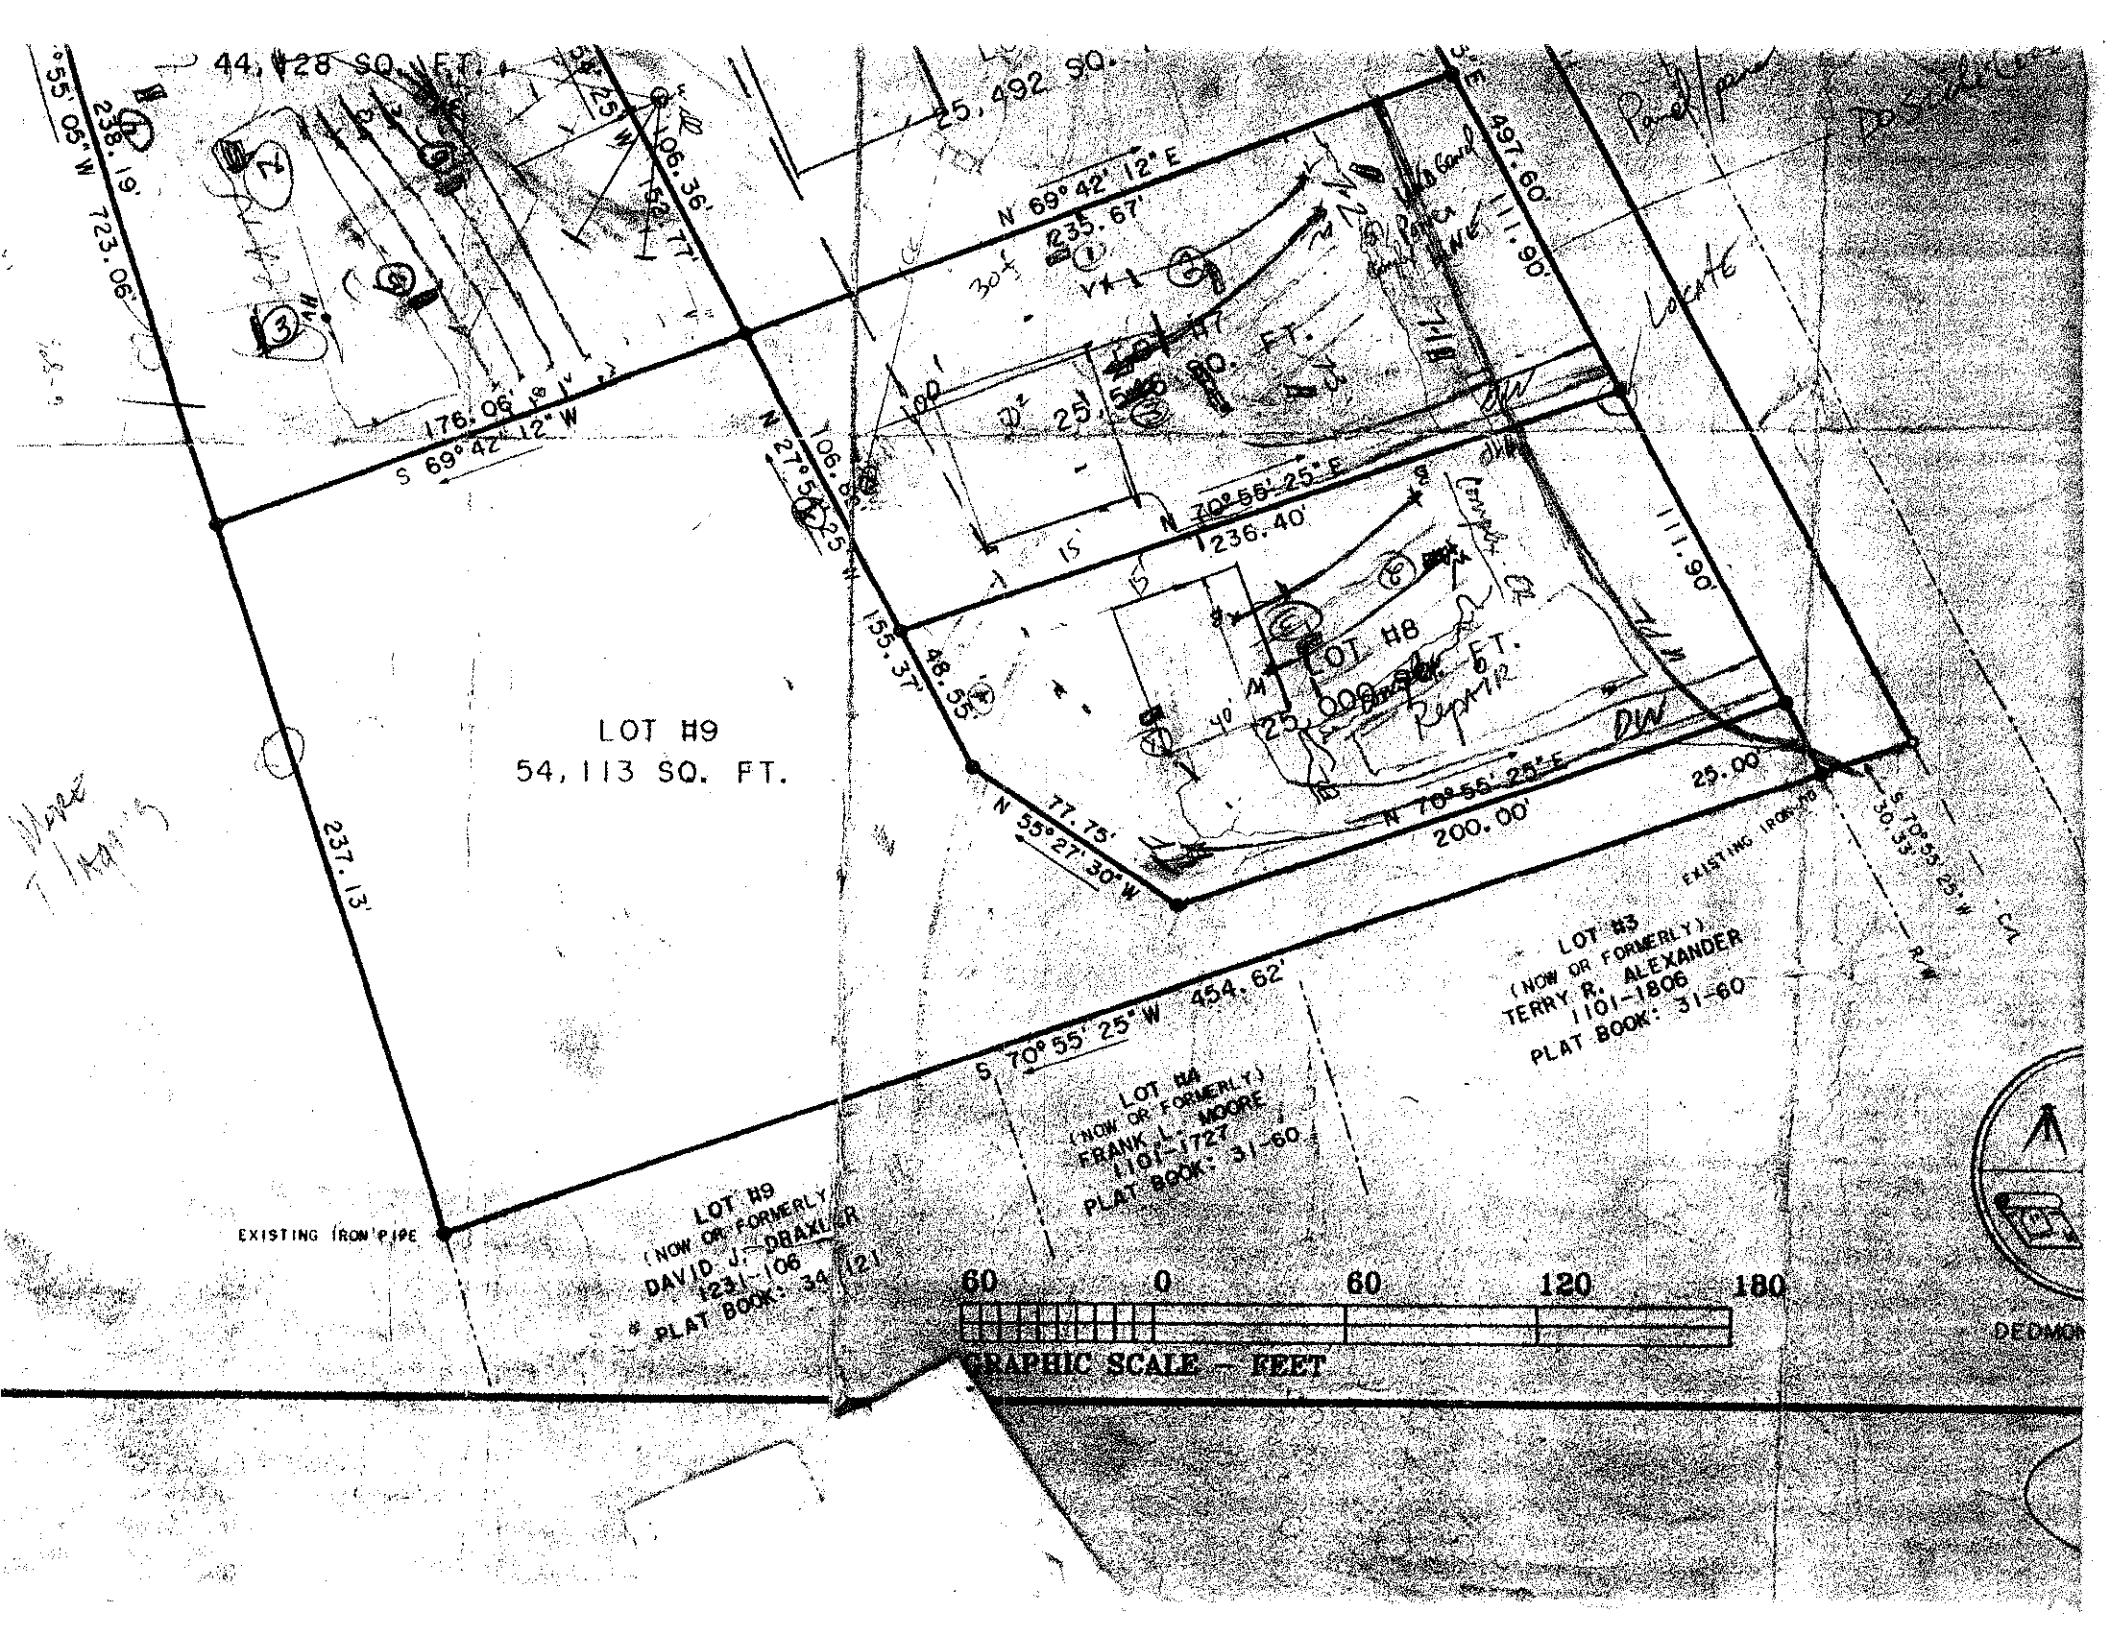
WNER: _____ APPLICATION DATE _____
DDRESS: _____
ROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): _____ DATE EVALUATED: 2-13-04
OCATION OF SITE: Lot 7 Longwood PROPERTY SIZE: _____
ATER SUPPLY: ☐ Private ☐ Public ☐ Well ☐ Spring ☐ Other _____ PROPERTY RECORDED: _____
VALUATION METHOD: ☐ Auger Boring ☐ Pit ☐ Cut
YPE OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	T-1	0-16	SBL R CL	FRSSSO SSKP					.3
		16-44	WK SBK-MASSIVE YR-RY LSAP	FRSSSP					
		44-60+	11 11	LSAP					
2	T-2	0-17/36	displaced SBK R-YR CL	FRSSSP SSKP	Common mottsap				.3
		17/36+	10 MASSIVE LSAP	FRSSSP					
3	T-3	0-4	WK SBK SRW CL	FRSSSP					.25-.3
		4-28	MK SBK RC/CK	FR SSSP SSKP					
		28-57	PR WK SBK-MASSIVE L/LSAP	FRSSSP	Limited				
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		
System Type(s)		
Site LTAR		

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): _____

EVALUATED BY: _____
OTHER(S) PRESENT: _____


44,128 SQ. FT.
25,492 SQ.
S 55° 05' W 238.19'
723.06'
106.36'
N 69° 42' 12" E
235.67'
497.60'
111.90'
S 69° 42' 12" W
176.06'
N 27° 50' 25" W
106.36'
N 70° 55' 25" E
236.40'
LOT H9
54,113 SQ. FT.
155.37'
48.35'
LOT H8
237.13'
N 55° 27' 30" W
77.75'
N 70° 55' 25" E
200.00'
25.00'
S 70° 55' 25" W 454.62'
EXISTING IRON PIPE
LOT H9
(NOW OR FORMERLY)
DAVID J. DRAXLER
1231-106
PLAT BOOK: 34
LOT H4
(NOW OR FORMERLY)
FRANK L. MOORE
1101-1727
PLAT BOOK: 31-60
LOT H3
(NOW OR FORMERLY)
TERRY R. ALEXANDER
1101-1806
PLAT BOOK: 31-60
60 0 60 120 180
GRAPHIC SCALE — FEET

DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: _____ APPLICATION DATE _____
ADDRESS: _____ DATE EVALUATED: 11-18-03
PROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): _____ PROPERTY SIZE: _____
LOCATION OF SITE: lot 7 Tanglewood PROPERTY RECORDED: _____
WATER SUPPLY: ☐ Private ☐ Public ☐ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☐ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LAND-SCAPE POSITION/ SLOPE %	HORI-ZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1		0-8	Comp/wk f sbk c	fi-vfi					
		8-36	wk fsbk mc/gl	frssp	common	mod sap			.25 > 8"
		36-72	massive gy/brn C	sap frssp					
2	6-8%	0-6	wk fsbk brn cl	frssp					
		6-27	m fsbk rc	fr sp sap					.3
		27-37	wk fsbk yc cl	frssp					
		37-64	massive LSap	fr frssp					
3		0-36	wk fsbk rc/cl	frssp	few mod sap				
		36-66	wk fsbk-massive LSap	frssp					.25-.3
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	LPP&RS	LPP&RS
Site LTAR	.25-.3	.25-.3

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): _____
EVALUATED BY: DWH
OTHER(S) PRESENT: _____

COMMENTS: _____