SION OF ENVIRONMENTAL HEALTH
ITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: ___
COUNTY: ID

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM


OWNER: Leche Homes APPLICATION DATE ___
ADDRESS: ___ DATE EVALUATED: 11/6/03
PROPOSED FACILITY: ___ PROPOSED DESIGN FLOW (.1949): ___ PROPERTY SIZE: ___
LOCATION OF SITE: Davidson Homes lot 113 PROPERTY RECORDED: ___
WATER SUPPLY: ☐ Private ☑ Public ☐ Well ☐ Spring ☐ Other ___
EVALUATION METHOD: ☐ Auger Boring ☑ Pit ☐ Cut
TYPE OF WASTEWATER: ☑ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	LSS 7%	0-10	BSCL GR	fr: SSSP S exp		46	PS	—	PS 3
		10-20	RC MSBK	fi: SP SS P					
		20-46	RCL MSBK	fr: SSSP S exp common SAP					
		46-56	SL/L SAP M	fr: SSSP S exp					
2		0-8	BSCL GR	fr SSSP S exp		42'			
		8-26	RC MMSBK	fi SP SS P					PS
		26-42	RCL MFSBK	fr: SSSP S exp common SAP Inc.		15			3
		42-60	SCL SAP M	fi: SSSP N exp					
			wet						
3		0-2	BSCL GR	fr: SSSP S exp		46			
		2-12	RC SBK	fi: SP SS P					
		12-46	RCL MSBK	fr: SSSP S exp common SAP			15		
		46-60	SL SAP	fr: SSSP N exp					
4		0-10	BSCL GR	fr: SSSP SS P					
		10-59	RC SBK	fi: SP SS P					15 3

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		
System Type(s)		
LTAR	3	3

OTHER FACTORS (.1946): ___
SITE CLASSIFICATION (.1948): ___
EVALUATED BY: Norman
OTHER(S) PRESENT: Chris Lewis

NTS: ___

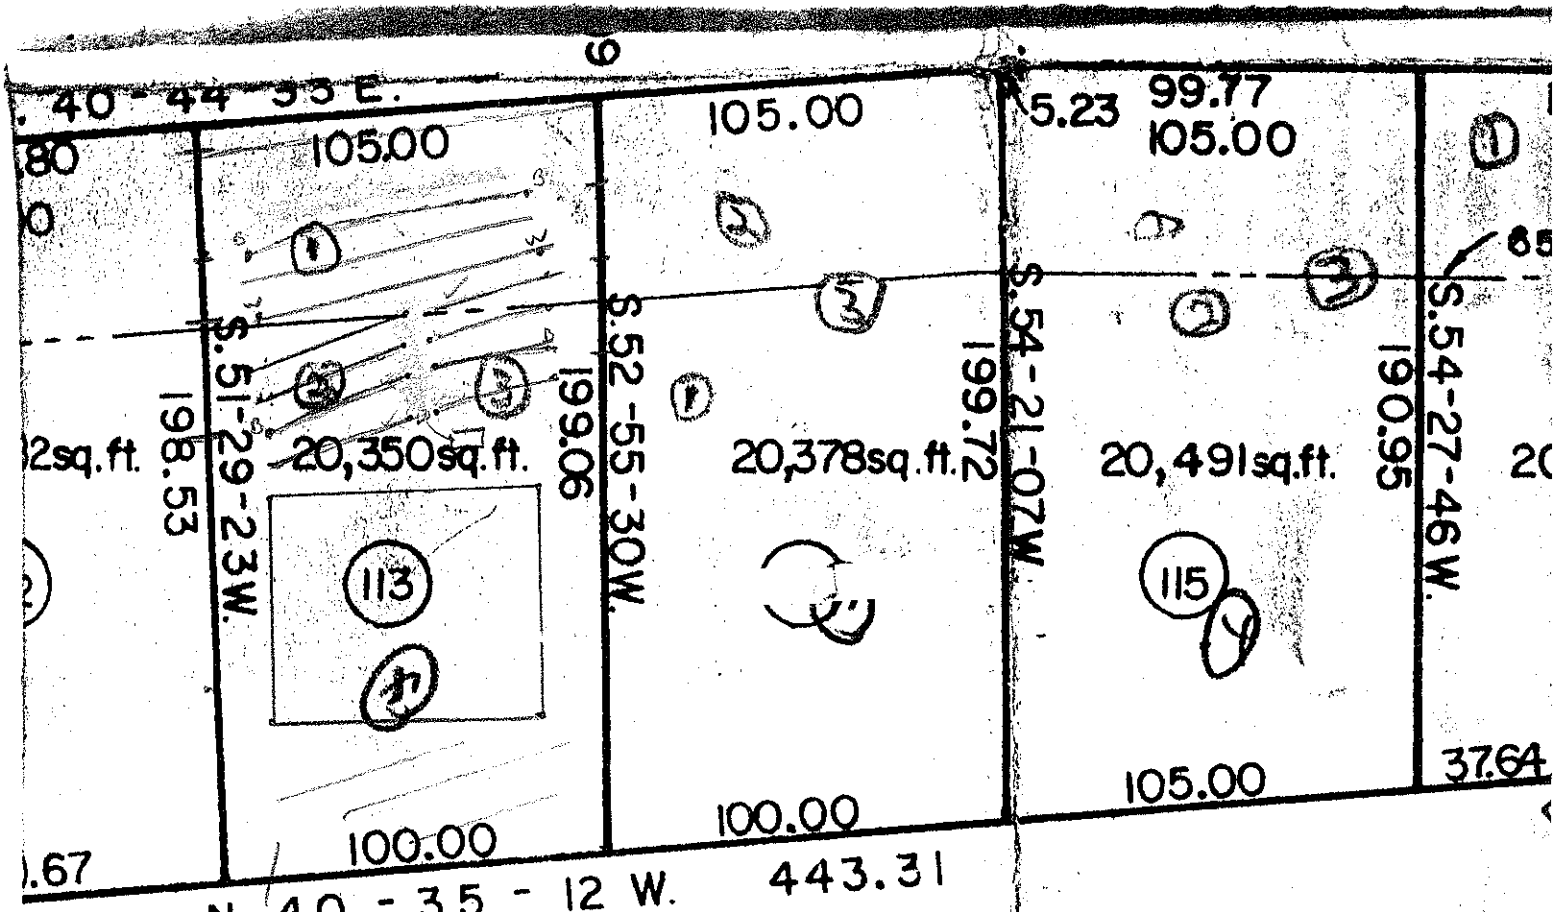

U.M. ARCHER
(NOW OR FORMERLY)