DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: ___
COUNTY: ___

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

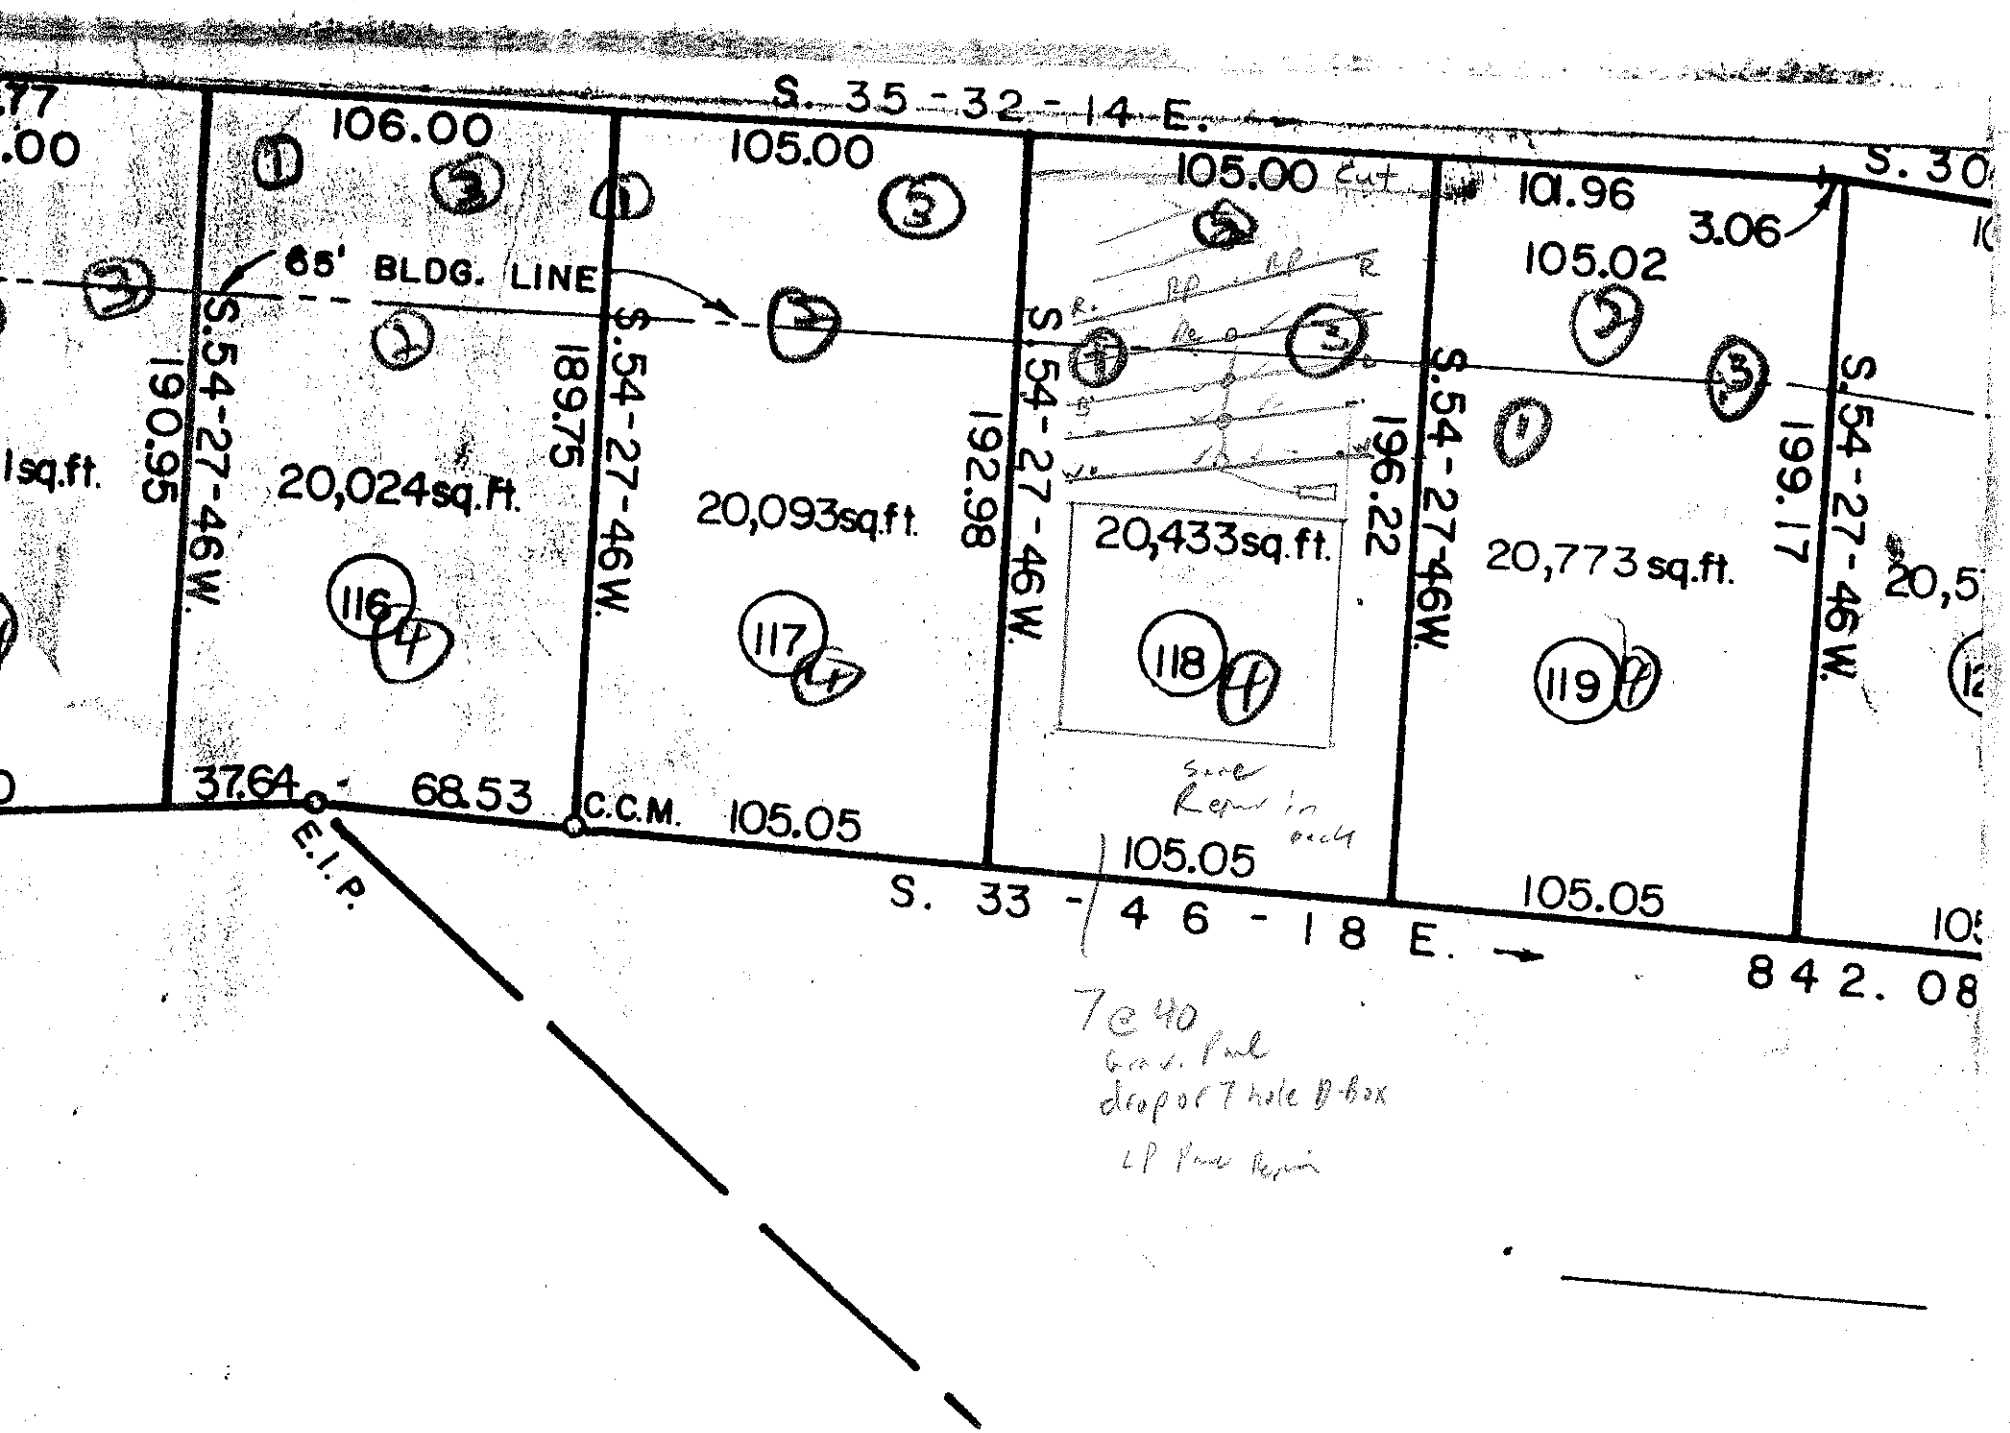
OWNER: Leche Homes APPLICATION DATE ___
ADDRESS: ___ DATE EVALUATED: 10/6/15
PROPOSED FACILITY: ___ PROPOSED DESIGN FLOW (.1949): ___ PROPERTY SIZE: ___
LOCATION OF SITE: 118 Davidson Downs PROPERTY RECORDED: ___
WATER SUPPLY: ☐ Private ☐ Public ☐ Well ☐ Spring ☐ Other ___
EVALUATION METHOD: ☐ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LAND-SCAPE POSITION/ SLOPE %	HORI-ZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	7% LSS	0-18	LC SBK	fr SP/SSP	SAP				PS .3
		18-44	LCL MASBK	fr SSP - organic SAP					
		44-64	OSAP M VSBK	fri SSP	mxP				
2		0-16	LC SBK	fr SP SAP					PS .3
		16-42	LCL MSBK	fr SSP					
		42-60	OSAP	fri SSP					
3		0-12	SSCL WEAKSBK	fri SSP SAP					PS .3
		12-30	LC SBK	fr SP SAP					
		30-56	LCL MASBK	fr SSP SAP					
4		0-35	LC SBK	fr/fi SP/SSP SAP					PS .3
		35-63	LCL MASBK	fri SSP SAP					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		
System Type(s)		
Site LTAR		

OTHER FACTORS (.1946): ___
SITE CLASSIFICATION (.1948): ___
EVALUATED BY: Freeman
OTHER(S) PRESENT: Sheriff

COMMENTS: ___


S. 35 - 32 - 14 E.
106.00
105.00
105.00 Cut
101.96
3.06
105.02
65' BLDG. LINE
S.54-27-46W.
190.95
189.75
192.98
196.22
199.17
20,024sq.Ft.
20,093sq.ft.
20,433sq.ft.
20,773 sq.ft.
116
117
118
119
37.64
68.53
C.C.M.
105.05
105.05
105.05
E.I.P.
S. 33 - 46 - 18 E.
842.08
Sewer Repair in each
7 @ 40
Conc. Pad
drop or T hole D-box
LP Pole Repair