DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

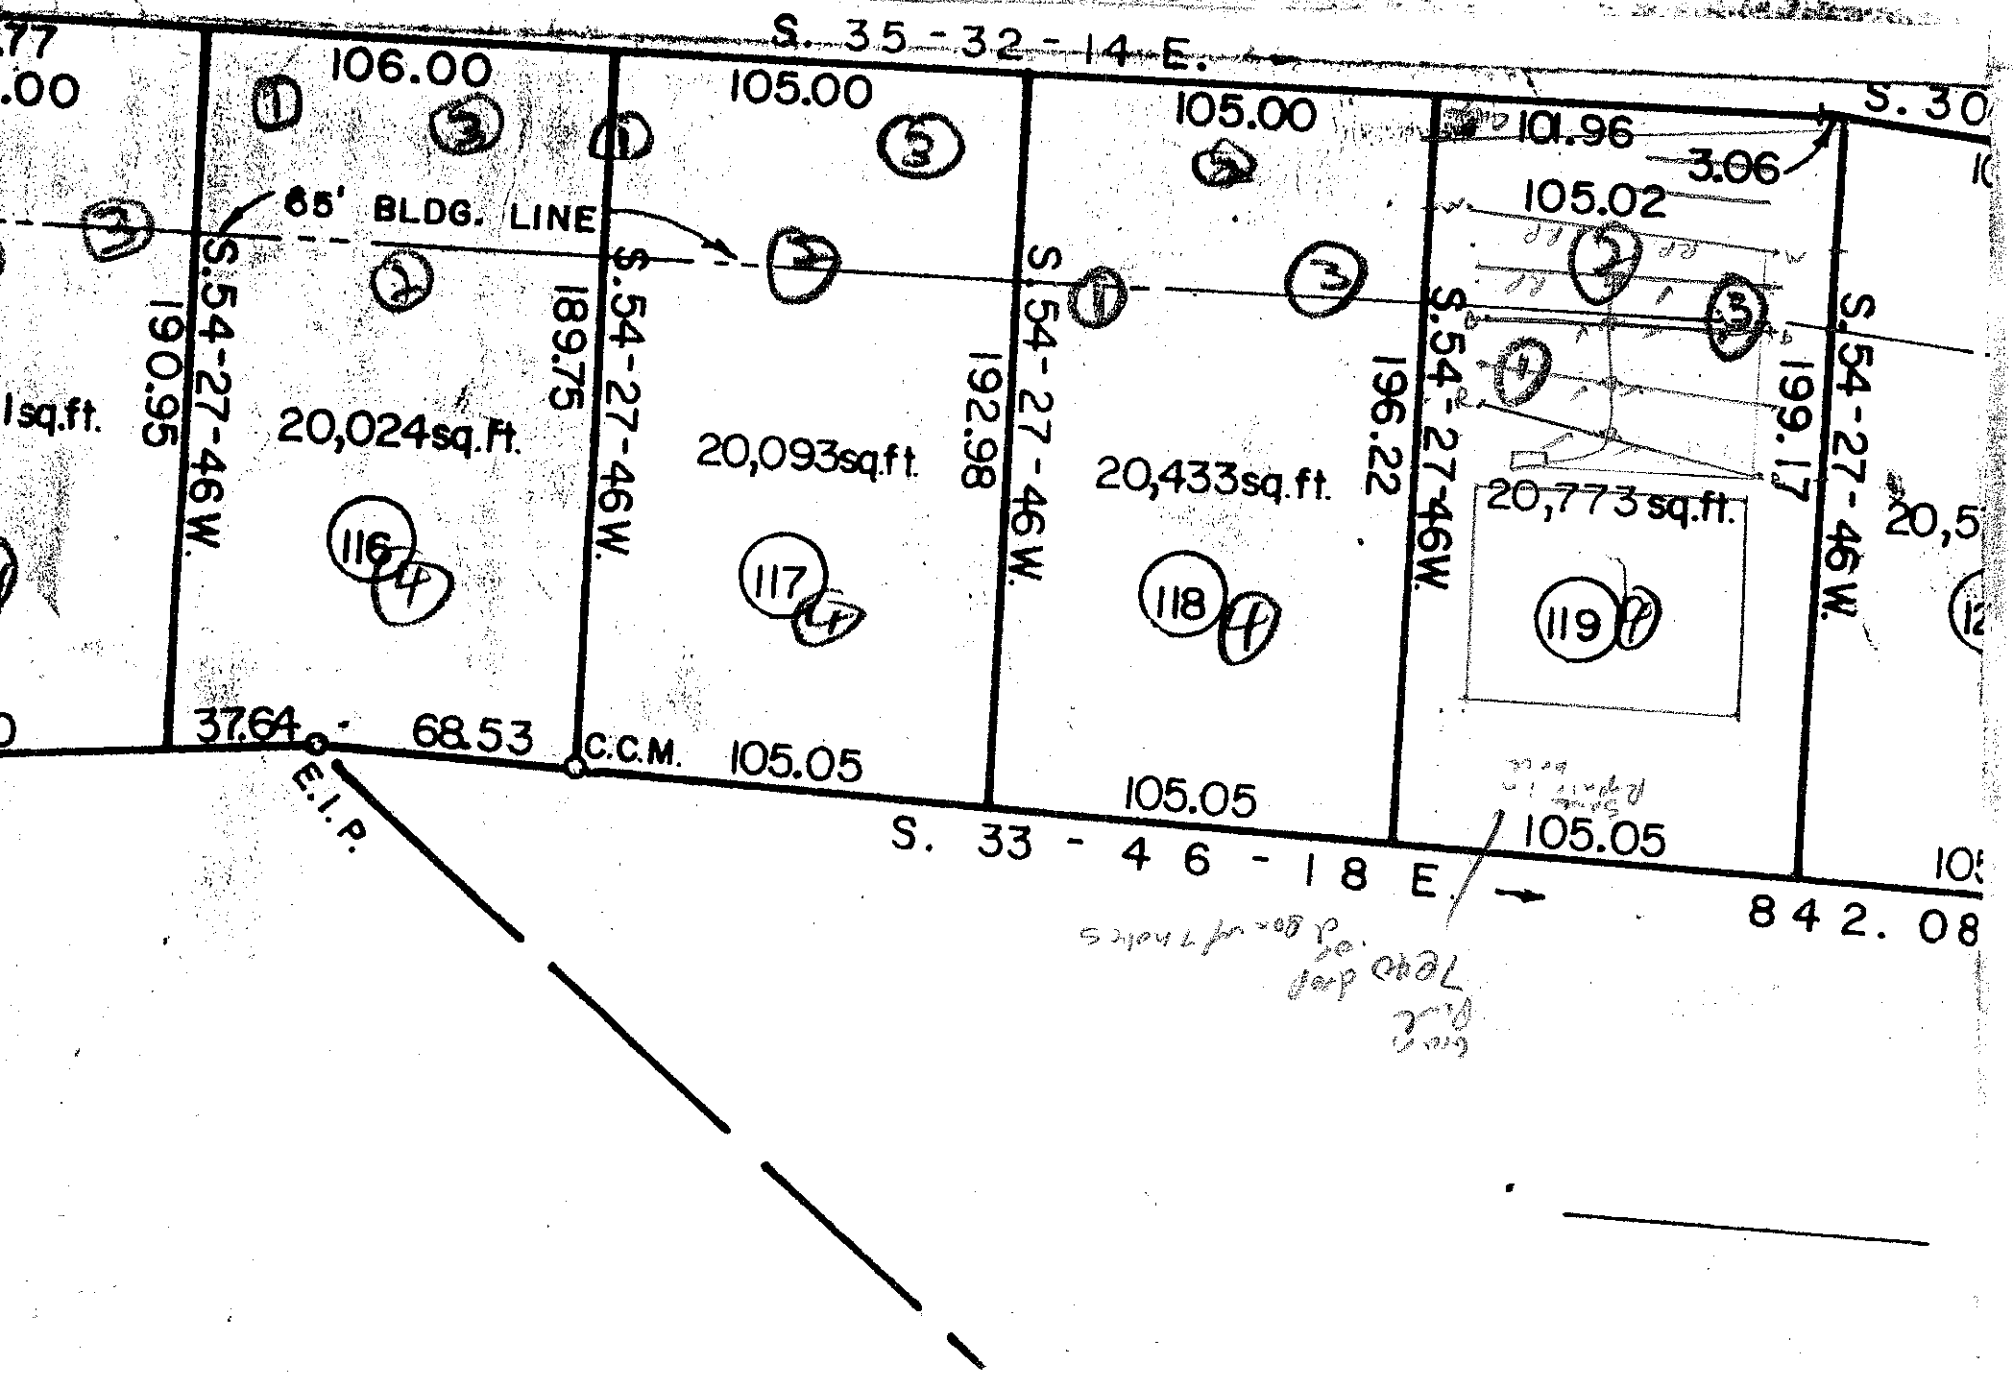
OWNER: Leche Homes APPLICATION DATE _____
ADDRESS: _____ DATE EVALUATED: 10/10/03
PROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): _____ PROPERTY SIZE: _____
LOCATION OF SITE: Lot 119 Davidson Downs PROPERTY RECORDED: _____
WATER SUPPLY: ☐ Private ☐ Public ☐ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☐ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LAND-SCAPE POSITION/ SLOPE %	HORI-ZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	LSS 6-8%	0-12	RC SAM	fr SP SS-P					
		12-29	RCL MSBK	fr SSSP SS-P					
		29-58	LSAM/SCL SAP	fr SS-P					
2	↓	0-12	RCL SAM	fr SP SS-P					
		12-36	RC SAM	fr SP SS-P					
		36-72	RCL MSBK	fr SSSP SS-P					
3	↓	0-20	RCL MSBK	fr SSP SS-P					
		20-56	RC SAM	fr SP SS-P	few faint MB's				
4		0-32	RCL MSBK	fr SSSP SS-P - many SAP					
		32-63	SL SAP M	fr SSPMSBK					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		
System Type(s)		
Site LTAR		

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): _____
EVALUATED BY: Freeman
OTHER(S) PRESENT: Cle - Sheet fill

COMMENTS: _____


S. 35 - 32 - 14 E.
106.00
105.00
105.00
101.96
3.06
105.02
65' BLDG. LINE
S.54-27-46W.
190.95
189.75
192.98
196.22
199.17
20,024sq.Ft.
20,093sq.ft.
20,433sq.ft.
20,773 sq.ft.
116
117
118
119
37.64
68.53
C.C.M.
105.05
105.05
105.05
E.I.P.
S. 33 - 46 - 18 E.
842.08