DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: 147617
COUNTY: 4721132699

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: JEFFREY MEDLIN
ADDRESS: 208 Beverly Lane Dr Stanley, NC 28677
PROPOSED FACILITY: SFR BSE
PROPOSED DESIGN FLOW (.1949): 360
LOCATION OF SITE: LOT 12 Brumley Acres
APPLICATION DATE: 12/27/17
DATE EVALUATED: 01/4/18
PROPERTY SIZE: ___
PROPERTY RECORDED: NO

WATER SUPPLY: ☐ Private ☐ Public ☐ Well ☐ Spring ☐ Other ___
EVALUATION METHOD: ☐ Auger Boring ☒ Pit ☐ Cut
TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	6%/0	0-6	scl wk gr	f sa non plas		36"			PS .3
		6-36	cnsl sbk	f ss sp scp					
		36-65	sl sp wk gr	f sa non plas					
					36-12" IF	-2.2" = 21.8" ≈ 21" TB			
						50' WELL SETBACK			
2	8%/0	0-8	scl wk gr	f sa non plas		42"			PS .25
		8-42"	cnsl sbk	f ss sp sts					
		42-60"	sl sap wk gr	f sa non plas					
					42-12" IF	-2.9" = 27.1" TB			
						50' WELL SETBACK			
3									
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	YES	YES
System Type(s)	CONV CONV	SAME
Site LTAR	.3	.3

OTHER FACTORS (.1946): ___
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: C. WILK
OTHER(S) PRESENT: FARMER'S SON

COMMENTS: ___

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*
CC (Concave Slope) CV (Convex Slope) D (Drainage Way) DS (Debris Slump) FP (Flood Plain) FS (Foot Slope) H (Head Slope) L (Linear Slope) N (Nose Slope) R (Ridge) S (Shoulder Slope) T (Terrace)	I	S (Sand) LS (Loamy Sand)	1.2 - 0.8	0.6 - 0.4
	II	SL (Sandy Loam) L (Loam)	0.8 - 0.6	0.4 - 0.3
	III	Si (Silt) SiCL (Silty Clay Loam) CL (Clay Loam) SCL (Sandy Clay Loam) SiL (Silt Loam)	0.6 - 0.3	0.3 - 0.15
	IV	SC (Sandy Clay) SiC (Silty Clay) C (Clay) O (Organic)	0.4 - 0.1 None	0.2 - 0.05 None

MINERALOGY/ CONSISTENCE	STRUCTURE
NEXP (Non-expansive) SEXP (Slightly Expansive) EXP (Expansive)	G (Single Grain) M (Massive) CR (Crumb) GR (Granular) SBK (Subangular Blocky) ABK (Angular Blocky) PL (Platy) PR (Prismatic)

MOIST	WET
VFR (Very Friable) FR (Friable) FI (Firm) VFI (Very Firm v. Very Sticky) EFI (Extremely Firm)	NS (Non-sticky) SS (Slightly Sticky) S (Sticky) VS (Very Sticky) NP (Non-plastic) SP (Slightly Plastic) P (Plastic) VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

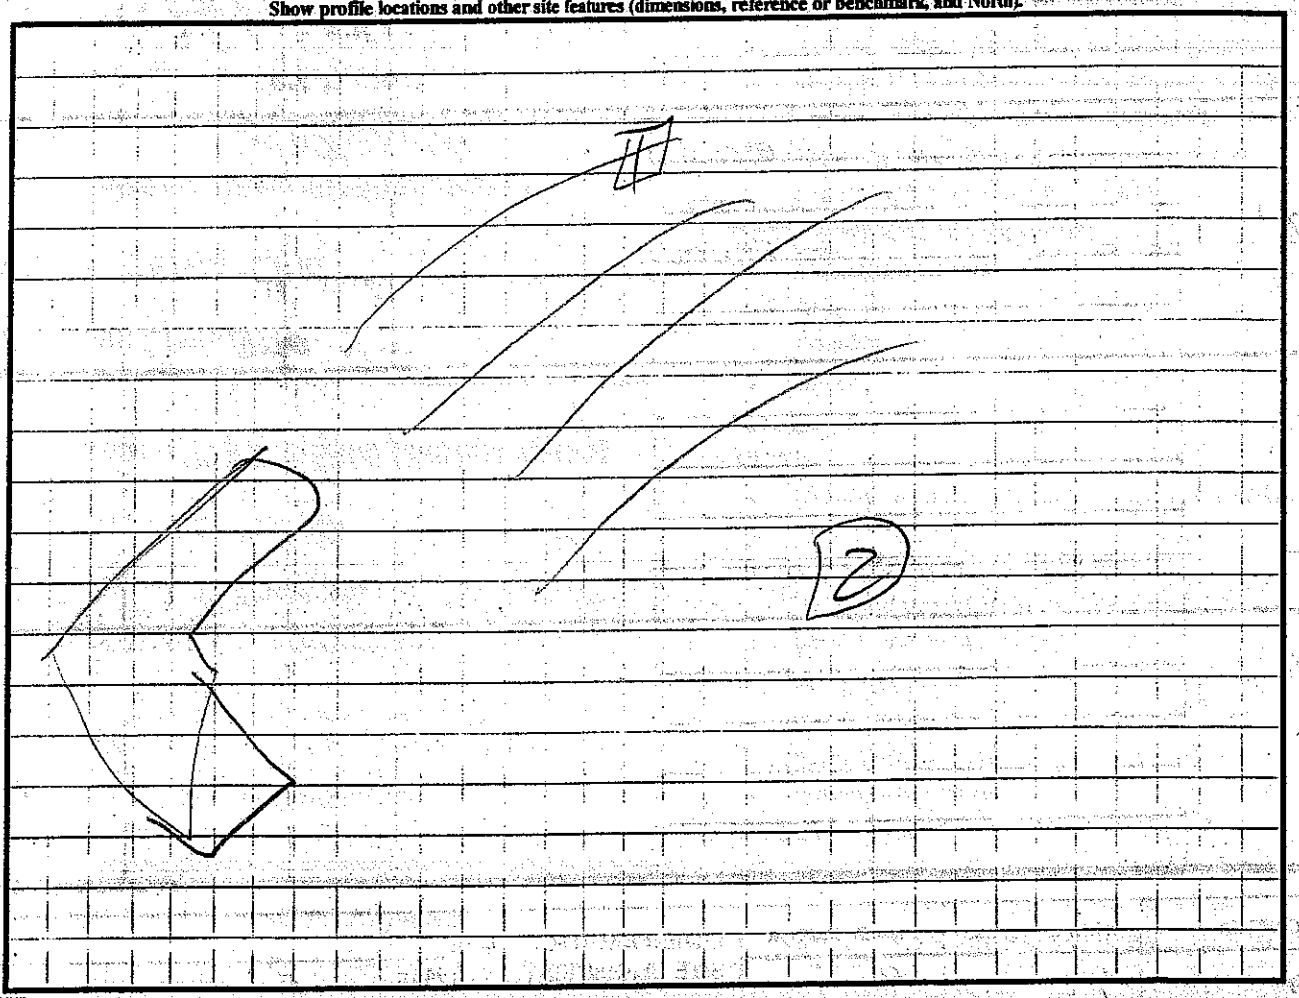

DENR (######)
Review (#####)

Permit # 147617

Pin # 4721132699

CUT OVER SCRUB TIMBER LAND

709

(690)

