DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

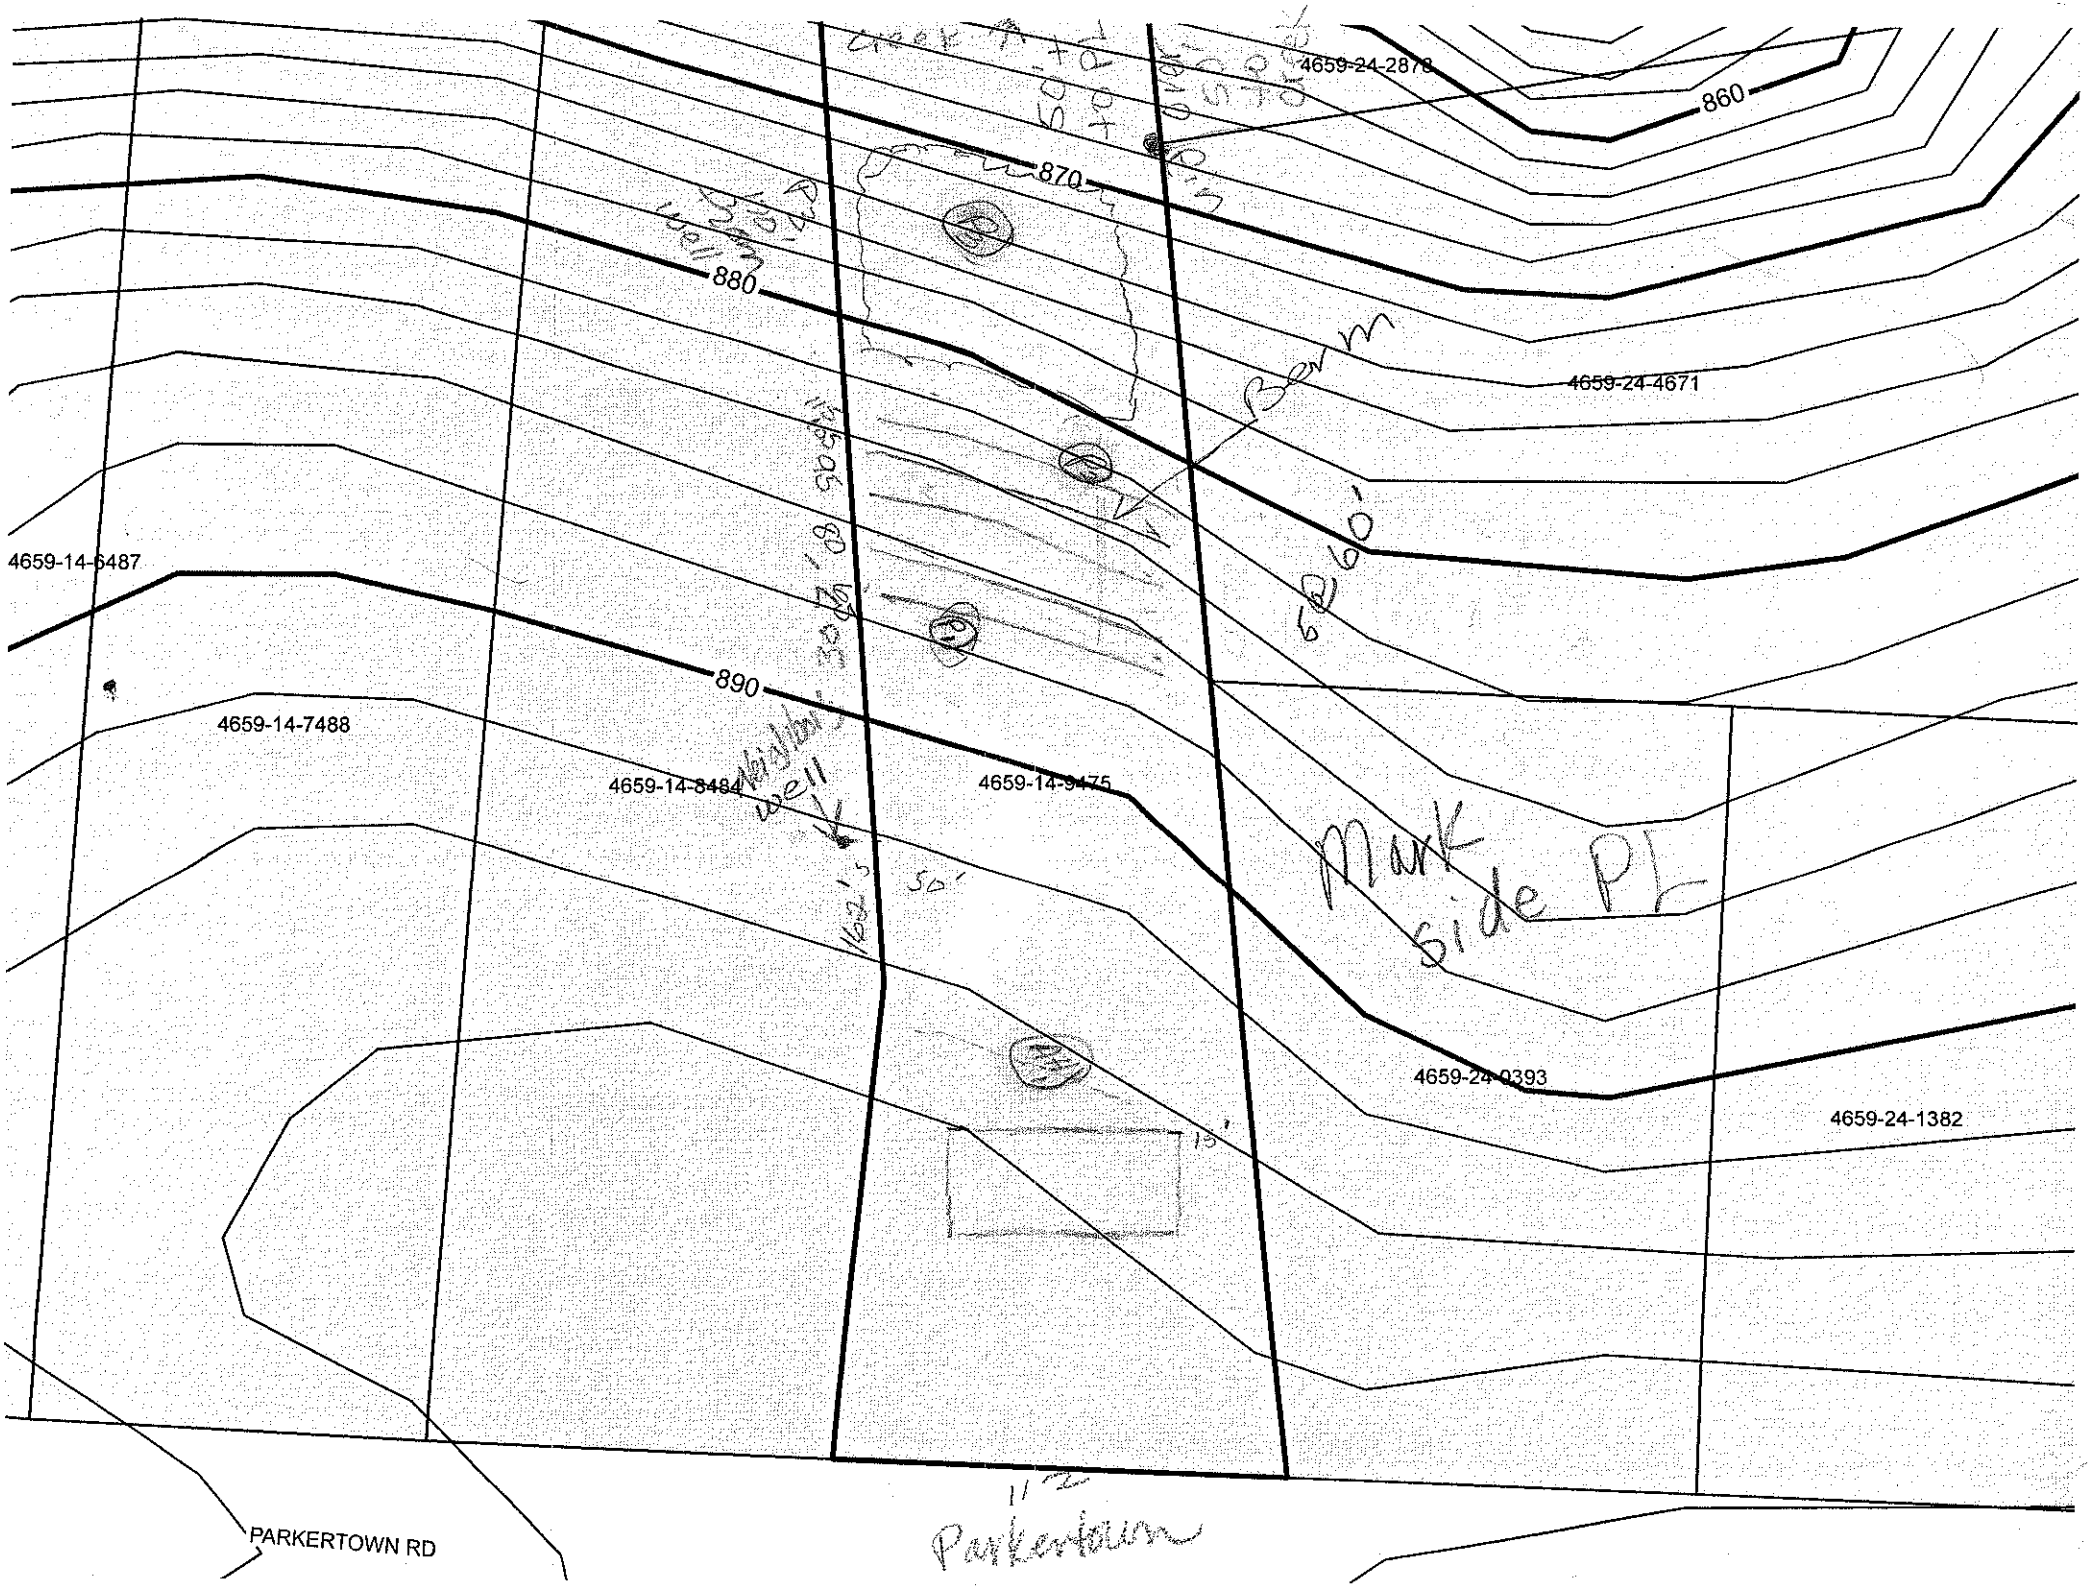
OWNER: Kreedom Homes — APPLICATION DATE _____
ADDRESS: _____ — DATE EVALUATED: 1-15-07
PROPOSED FACILITY: MH — PROPOSED DESIGN FLOW (.1949): _____ — PROPERTY SIZE: _____
LOCATION OF SITE: 21 N TL Parkertown on Rt 162 Parkertown — PROPERTY RECORDED: _____
WATER SUPPLY: ☐ Private ☐ Public ☒ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☐ Auger Boring ☐ Pit ☐ Cut — TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	OTHER PROFILE FACTORS .1943 SOIL DEPTH	OTHER PROFILE FACTORS .1956 SAPRO CLASS	OTHER PROFILE FACTORS .1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	Auger 1-15-07	0-3	gr loam	fr sss p	DkBr				.3
		3-24	sbk c	fr ss sps c	Red				
		24-40	wk sbk cl	fr ss sp	Red c-sap				
		40	L sap						
2	Pit 55' below well	0-15	wk sbk scl	fr ss sp	Red/Br				.3
		15-39	mo sbk c	fr sss p	Red				
		39-50	wk/mo sbk cl	fr ss sp	Red	c-sap f-R quartz			
3	15-20% 40' below #2	0-13	mo sbk scl	fr sss p	Red/Br				.3
		13-36	mo sbk c	fr sss p	Red				
		36-48	wk sbk cl	fr sss p	Red c-sap	pockets of f-rock		sap @ 36" less than 50% of pit	
		48-53	sl micaceous sap						
4	30' below #3	0-13	gr sl	fr sss p	Br				.3
		13-33	mo sbk c	fr sss p	Red				
		33-60	sl sap	fr sss p	micaceous				
			inc @ 40 45"						

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		
System Type(s)		
Site LTAR		

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): _____
EVALUATED BY: _____
OTHER(S) PRESENT: _____
COMMENTS: _____

UEN Revised


4659-24-2878
860
870
880
890
4659-24-4671
4659-14-6487
4659-14-7488
4659-14-8484
4659-14-9475
4659-24-0393
4659-24-1382
PARKERTOWN RD
Parkertown