
Soil & Site Evaluation for: Realco % Jimmy McKnight. 8-10-2000

Lot # 17., Ashley Woods. 3-Bedroom Doublewide 0.494 acres.

1000 gal septic / 1000 gal pump tank. LTAR - 0.25 in Rear. 0.3 on left side. - Rear System, 360 gpd at 0.25 = 1440 sq ft or 480 linear feet - X 75% = 360 linear feet @ 25% Reduced size system - Polystyrene or Chamber. Pump to large Drop System or Pressure manifold Repair would be Porus Block Panel - 3 lines of 67-70' Trench depth - 24" - 24" Pressure Head on manifold.

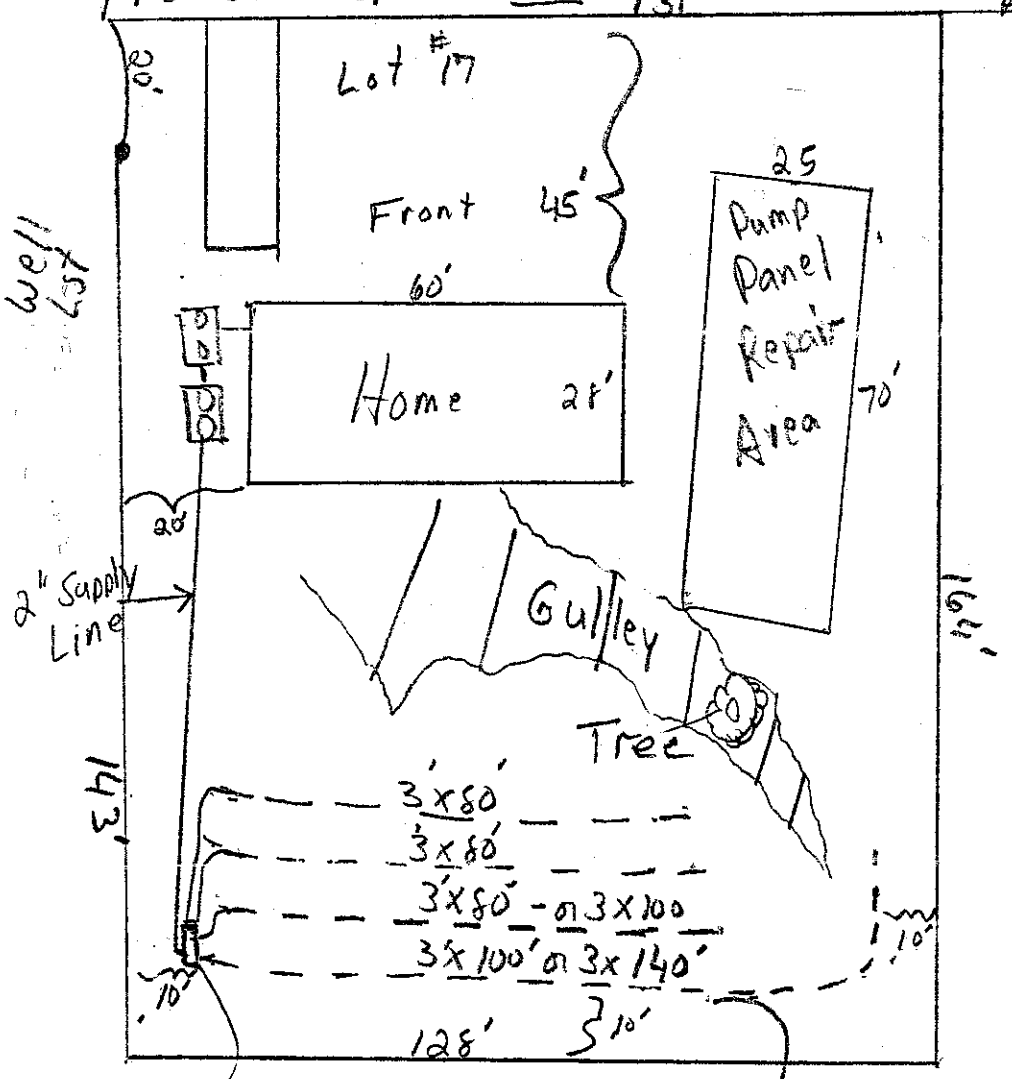

* The Repair Area may be able to accomodate 4-75's @ 25% Reduced System. Due to being better soil & Deep Soil.

* Note you could put 2-100' lines at top, it may work better.

Scale 1" = 30'

8-10-2000 Russell Williams