...ISION OF ENVIRONMENTAL HEALTH:
-SITE WASTEWATER SECTION

PROPERTY ID #: _____
COUNTY: _____

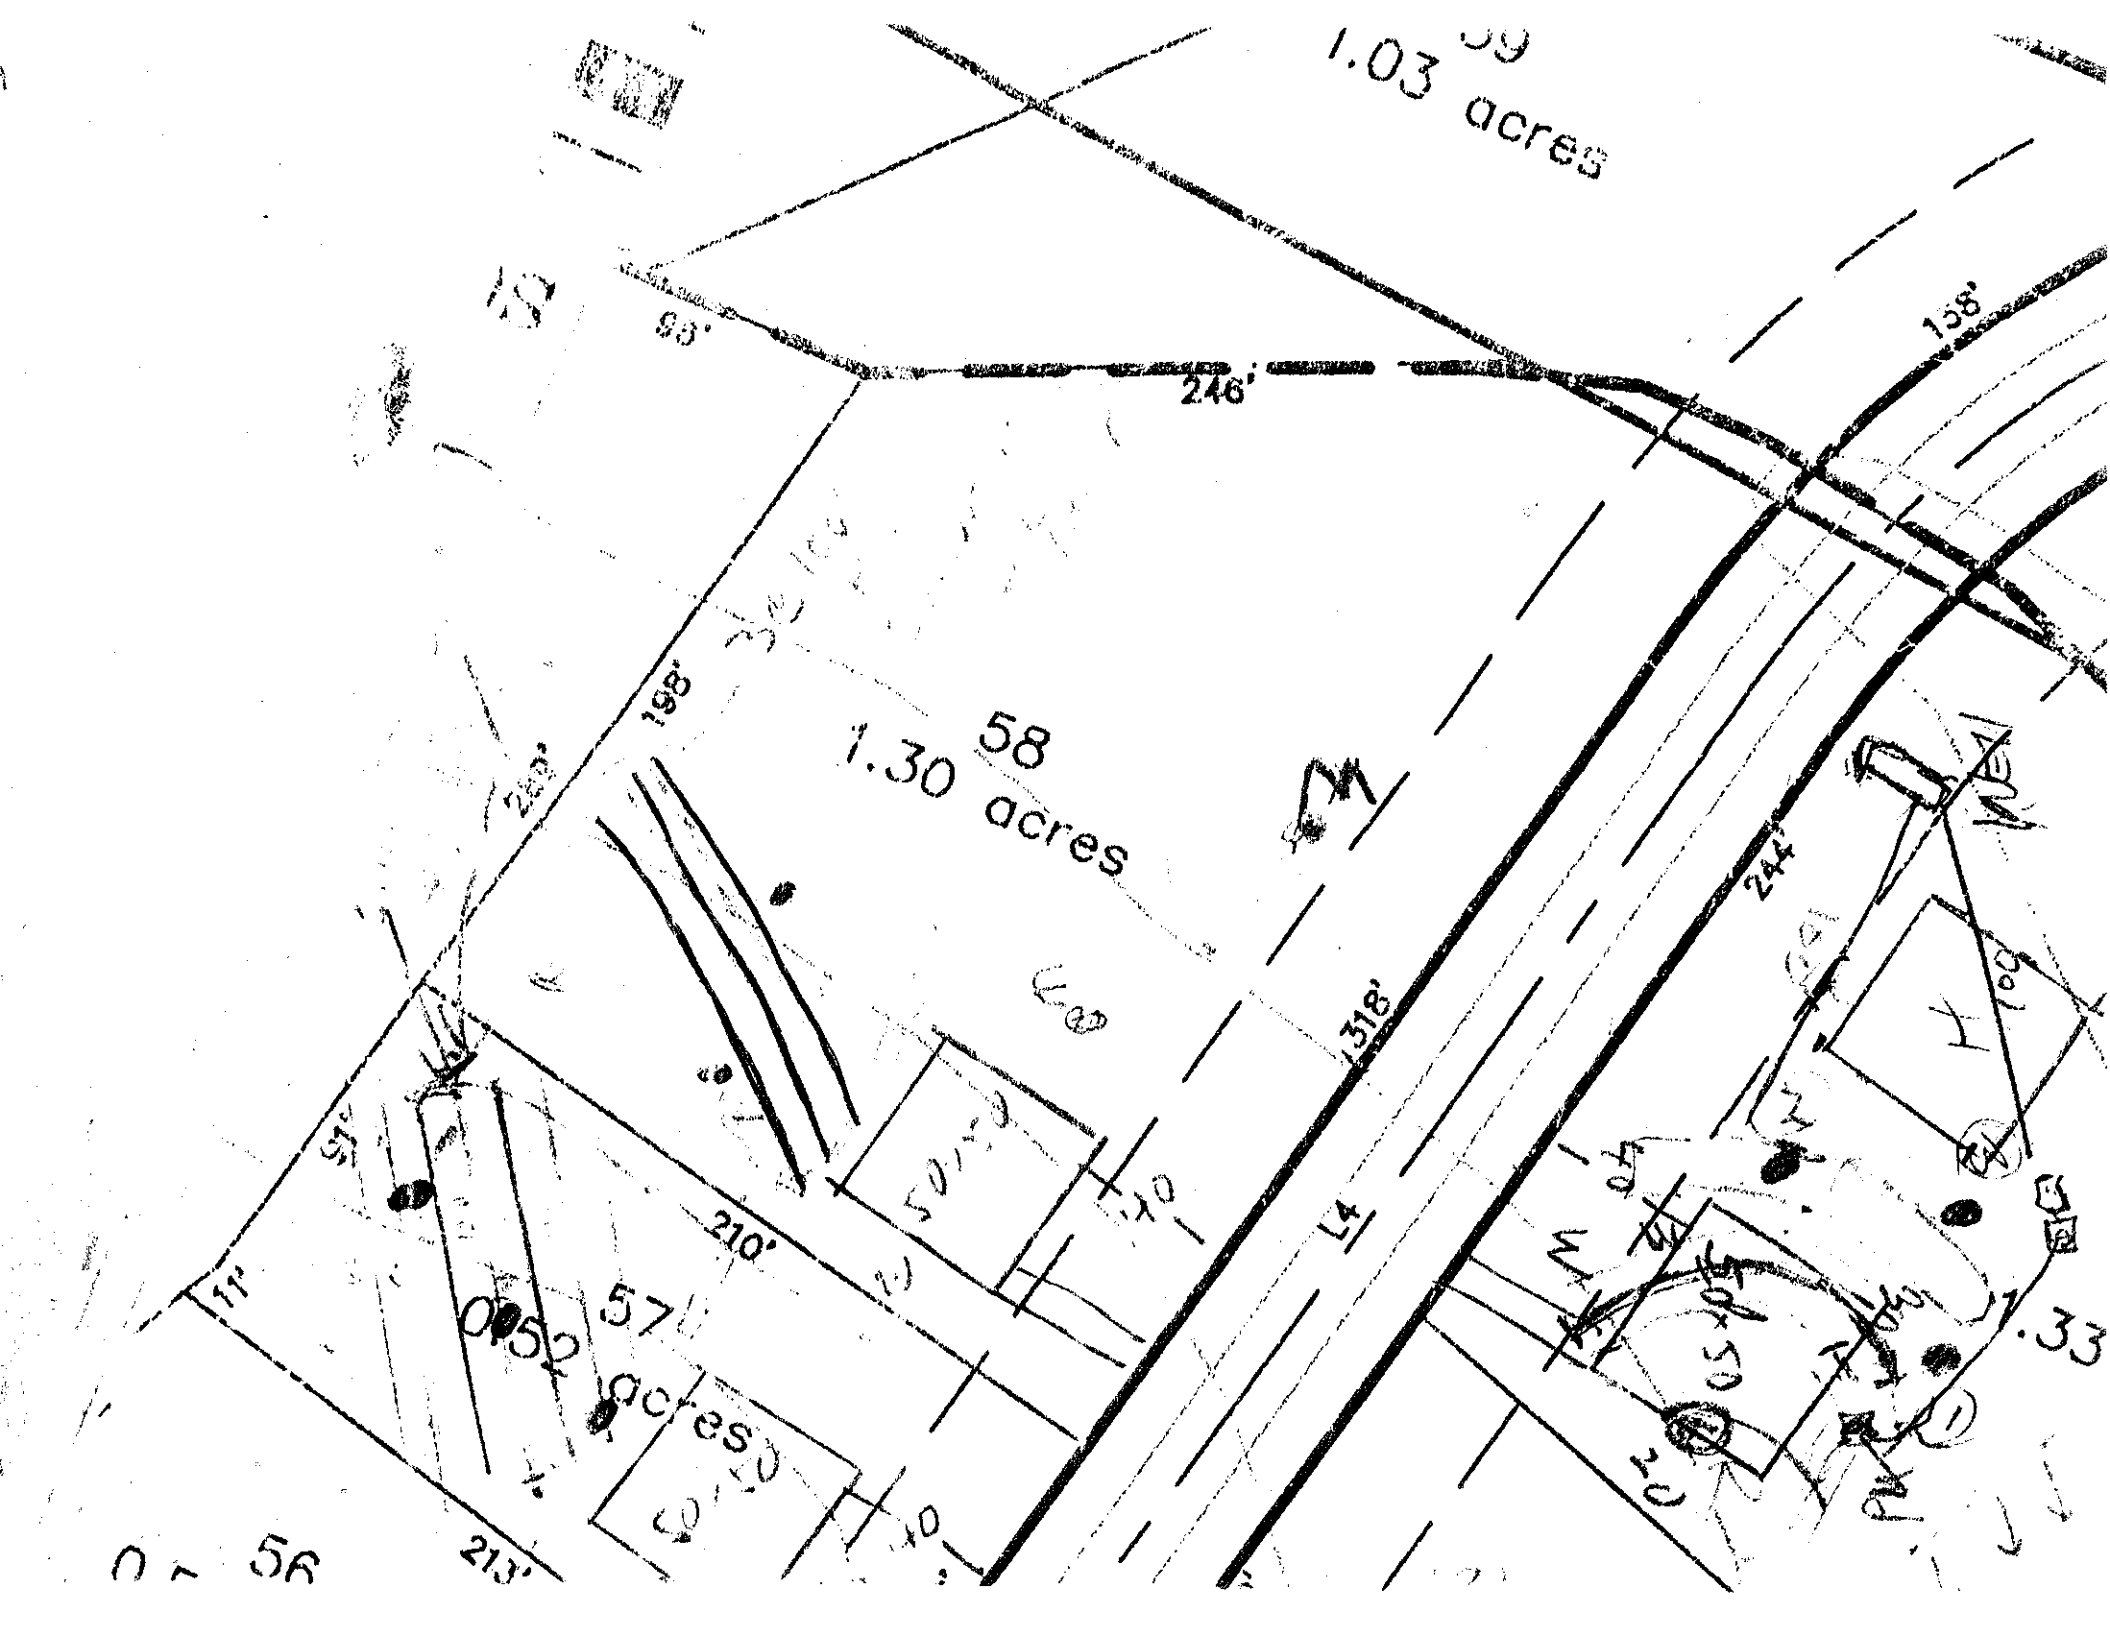
SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

...ER: Kunz APPLICANT: _____
DRESS: _____ APPLICATION DATE: _____ DATE EVALUATED: 9/16/08
)POSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): _____ PROPERTY SIZE: _____
CATION OF SITE: Lot 55 Brook Glen PROPERTY RECORDED: _____
TER SUPPLY: ☐ Private ☐ Public ☐ Well ☐ Spring ☐ Other _____
LUATION METHOD: ☐ Auger Boring ☐ Pit ☐ Cut
'E OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed

.1940 LAND-SCAPE POSITION/ SLOPE %	HORI-ZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
	0-6	GR/wSBK CSL/SiL	FR SSSP					
	6-23	SaBk RCl/L	FR SSSP					PS
	23-36	wFSBK BR C/L/L	FR SSSP	Few Inc 1 SAP				.3+
	36-64	L/FSL SAP	FR SSSP					
	0-7	GR/wSBK BSL/SiL	FR SSSP					
	7-22	SBk CL	FR SSSP					PS
	22-33	wFSBK C/L/L	FR SSSP	B/C Horizon Inc 1 SAP				.4-
	33-56	Mass/wSBK L	FR SSSP					
	0-4	gr loam sdy	fr SSSP					
	4-23	wfSBK RCl/L	fr SSSP					PS
	23-40	wfSBK L	fr SSSP					.3+
	40-60	M/SL SBK	fr SSSP MP					
		Parent material						

ESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
le Space (.1945)		
Type(s)		
AR		

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): _____
EVALUATED BY: _____
OTHER(S) PRESENT: _____


1.03 acres
98'
246'
138'
198'
58
1.30 acres
318'
244'
210'
57
0.52 acres
213'
56
L4
.33