Department of Environment, Health, and Natural Resources
Division of Environmental Health
On-site Wastewater Section

Sheet: 1 OF 1
PIN #: 4669-01-7696
Lot #: 7
Permit #: 172529
AppID:

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

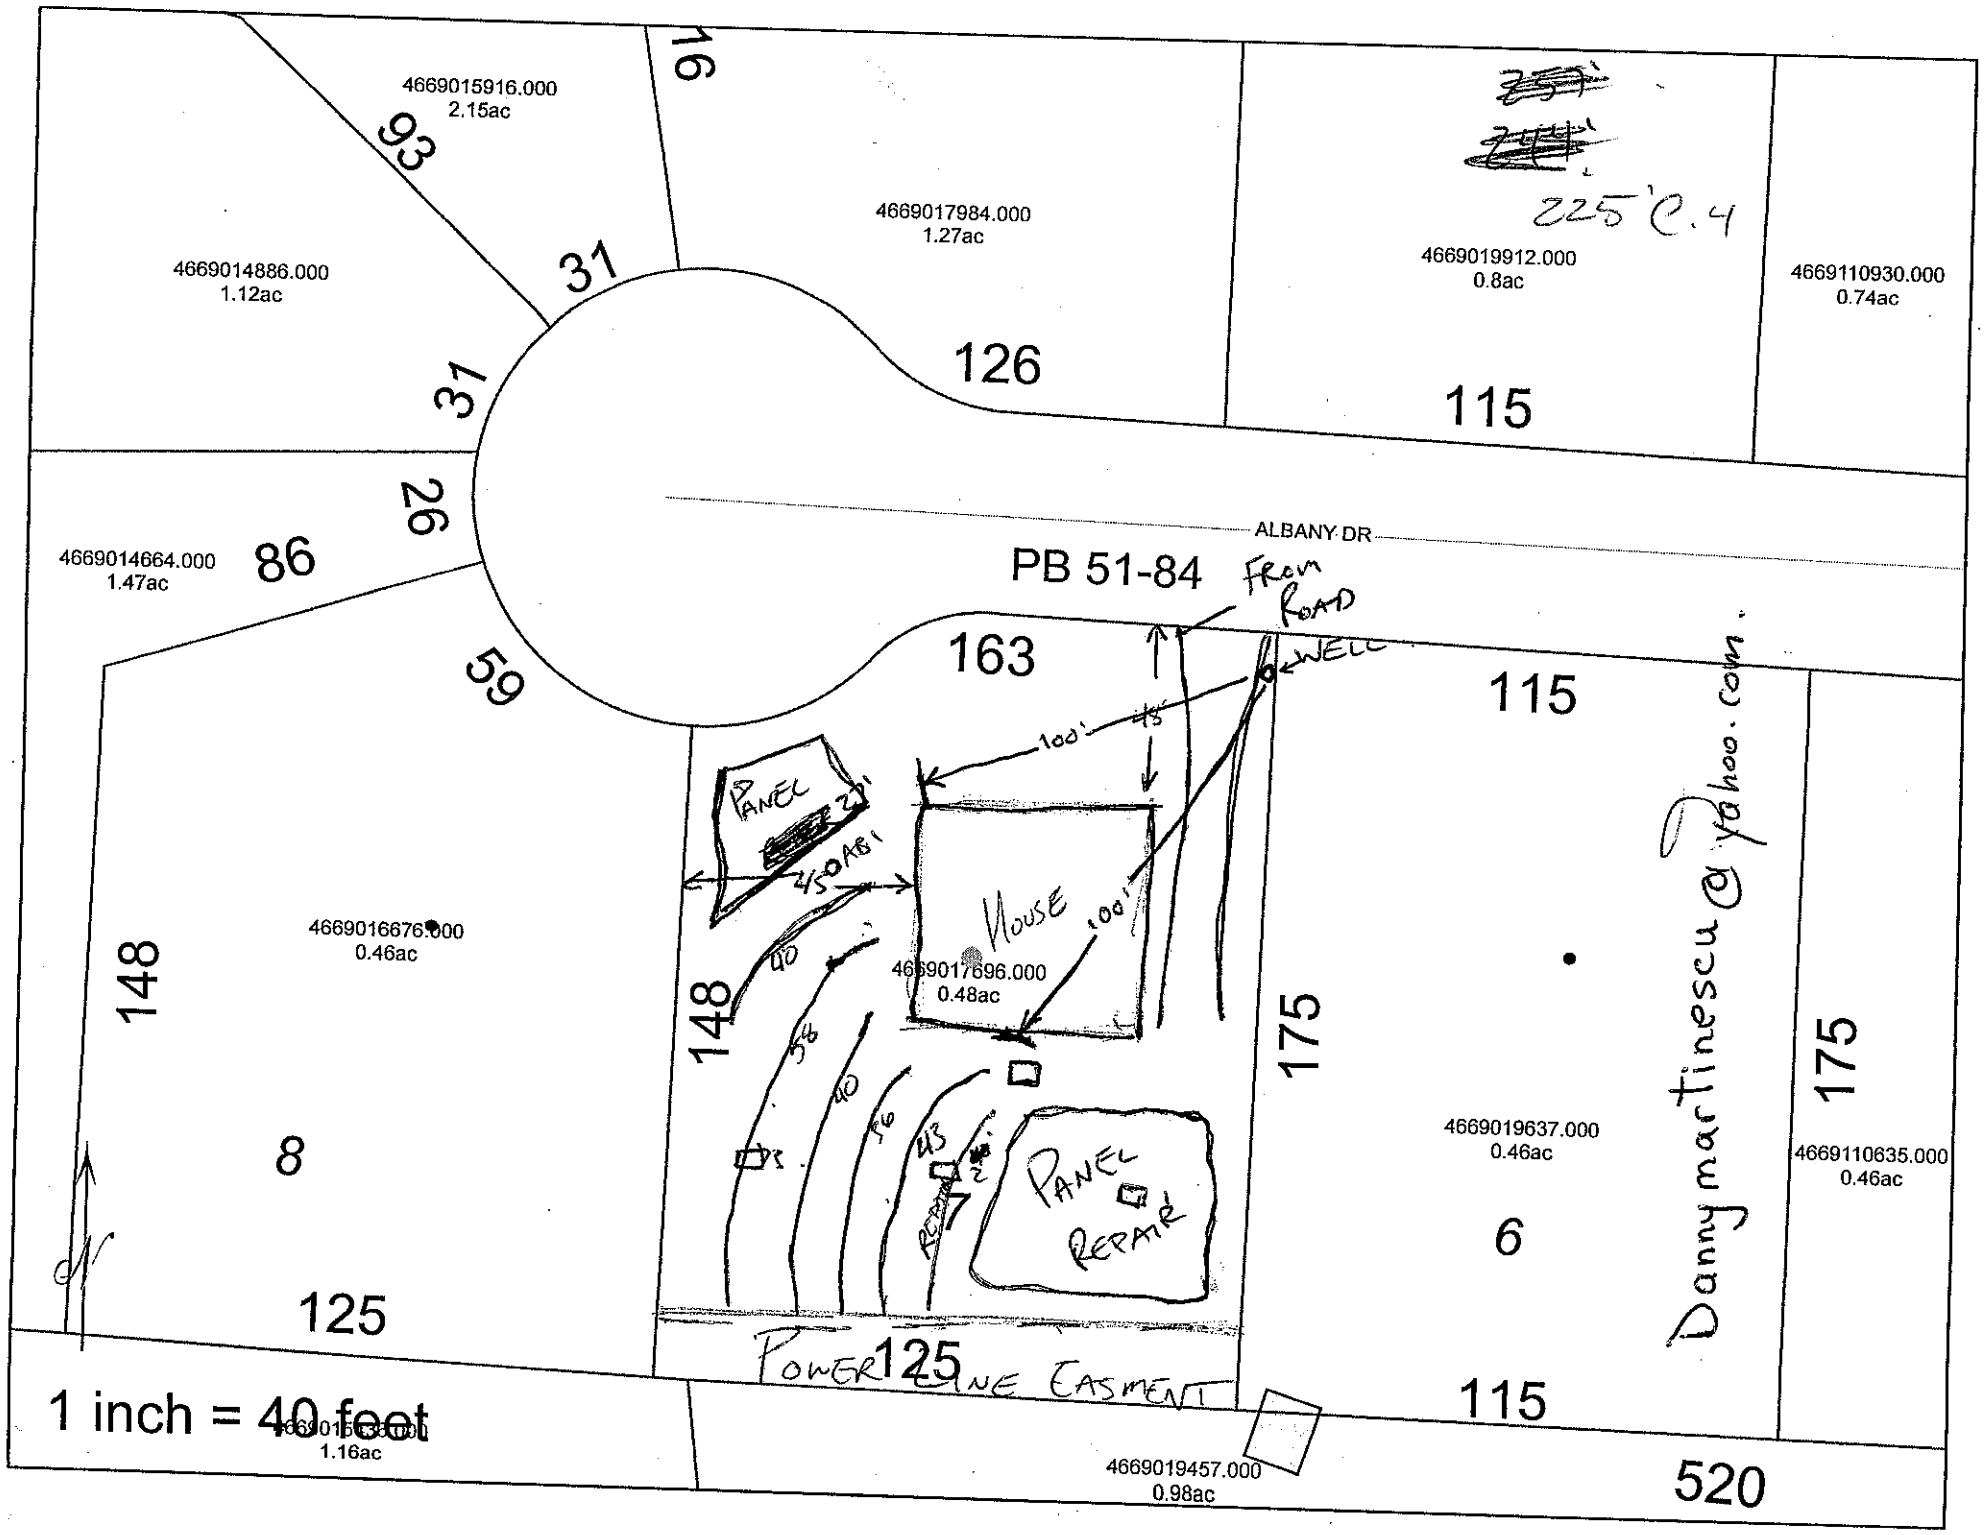
Owner: DANNY MARTINESCU
Address: 179 ALBANY DR.
Proposed Facility: SFR
Design Flow (.1949) 360
Location of Site: BETHANY PLACE LOT 7
Water Supply: [ ] Public [X] Individual [X] Well [ ] Spring [ ] Other
Evaluation Method: [X] Auger Boring [X] Pit [ ] Cut
Type of Wastewater: [X] Sewage [ ] Industrial Process [ ] Mixed

Applicant: SAME
Date Evaluated: 6/5/2012
Property Size: .472 AC
Property Recorded: YES

PROFILE #	.1940 Landscape Position/ Slope%	Horizon Depth (IN.)	SOIL MORPHOLOGY .1941 Structure/ Texture	.1941 Consistence Mineralogy	b PROFILE FACTORS .1942 Soil Wetness/ Color	.1943 Soil Depth (IN.)	.1956 Sapro Class	.1944 Restr Horiz	Profile Class & LTAR
PIT 1	LINEAR 5%	0-25	SCL,W,SBK	SS	NA	25"	S	65"+	.4
		25-65	SLSAP,MASS	NS					
PIT 2	LINEAR 5%	0-26	SCL,M,SBK	SS	NA	26"	S	65"+	.4
		26-65	SSAP,MASS	NS					
PIT 3	LINEAR 5%	0-20	C/CL.MSBK	SS	NA	20"	S	70"+	.4
		20-70	SLSAP,MASS	NS					
AB 1	LINEAR 5%	0-17	C,M,SBK	SS	NA	17"	S	60"+	.4
		17-60	SLSAP,MASS	NS					

Description	Initial System	Repair System
Available Space (.1945)	PS	PS
System Type(s)	G-25%	LP-PANEL
Site LTAR	.4	.4

Other Factors (.1946):
Soil Evaluation By: BEN ALDRIDGE
Others Present: DANNY MARTINESCU
Site Classification (.1948): PS
Site Evaluation By: BEN ALDRIDGE
Others Present: DANNY MARTINESCU


4669015916.000
2.15ac
4669014886.000
1.12ac
4669017984.000
1.27ac
4669019912.000
0.8ac
4669110930.000
0.74ac
225' C.4
4669014664.000
1.47ac
ALBANY DR
PB 51-84
From Road
WELL
PANEL
20'
45°ABS
100'
45'
HOUSE
4669016676.000
0.46ac
4669017696.000
0.48ac
40'
56'
40'
56'
43'
REPAIR
PANEL REPAIR
4669019637.000
0.46ac
4669110635.000
0.46ac
Dannymartinescu@yahoo.com
8
7
6
125
126
115
163
148
175
59
26
31
93
16
POWER LINE EASEMENT
4669015xxx.000
1.16ac
4669019457.000
0.98ac
520
1 inch = 40 feet