DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

Sheet ___ of ___
PROPERTY ID #: ___
COUNTY: ___

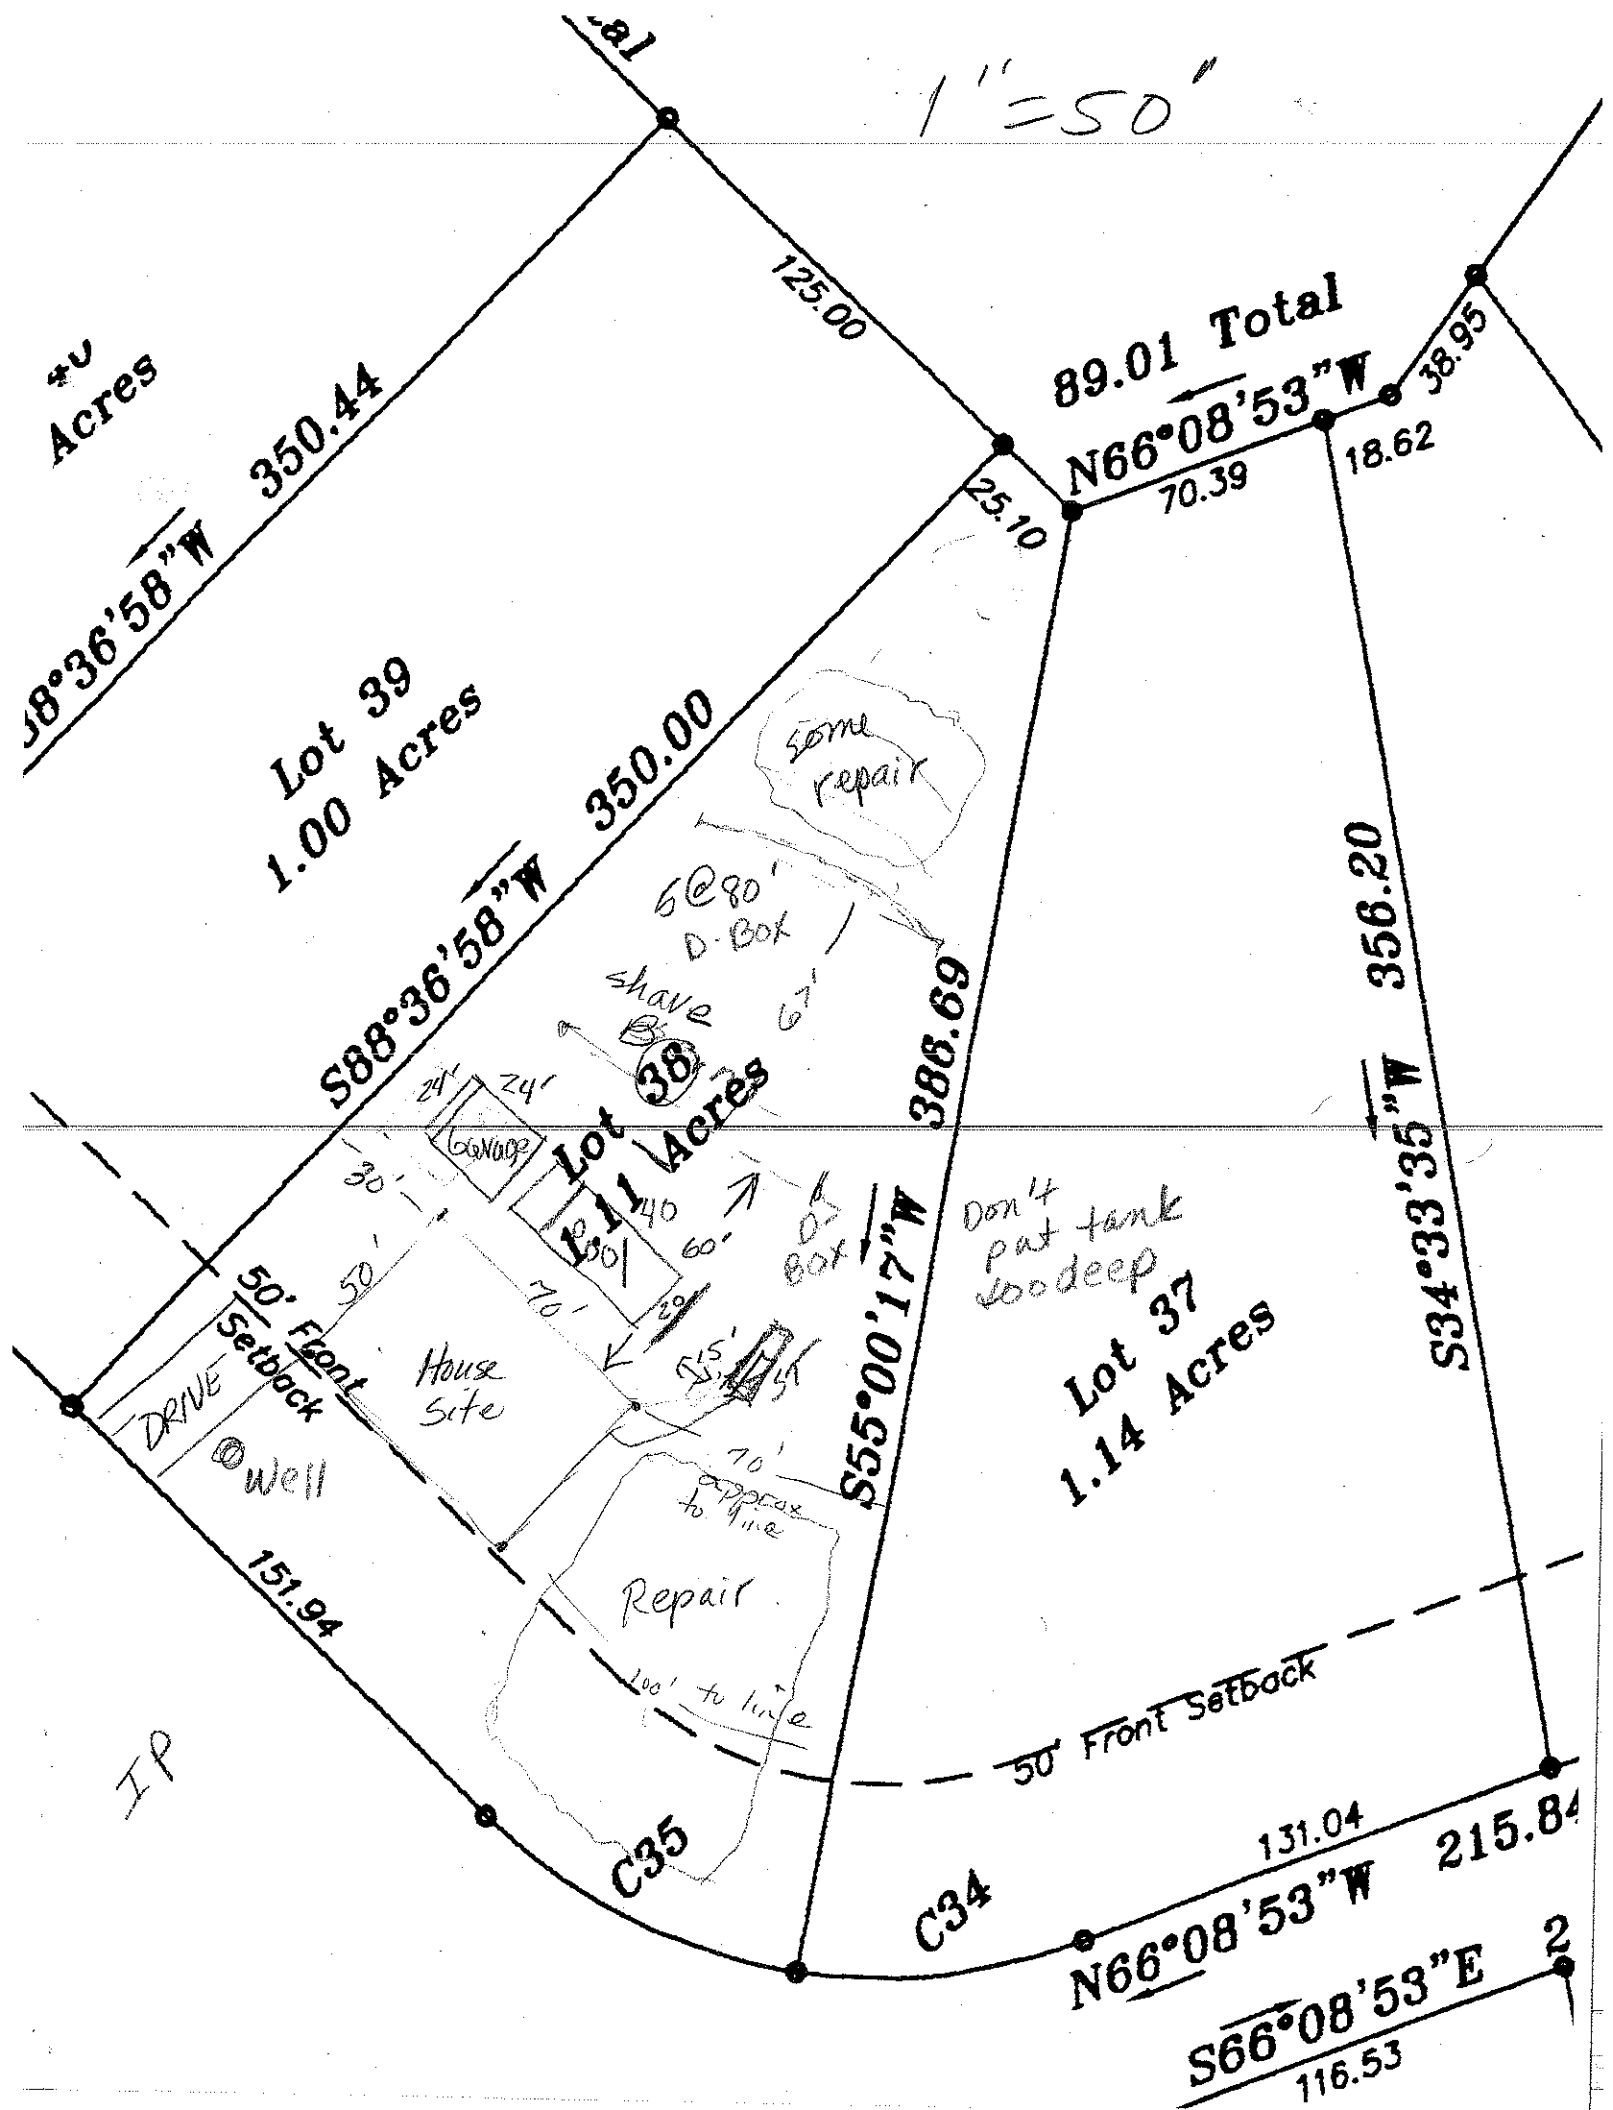
OWNER: TDTJ
ADDRESS: ___
PROPOSED FACILITY: ___
LOCATION OF SITE: Walden Ridge #38 PROPOSED DESIGN FLOW (.1949): ___ APPLICATION DATE ___
WATER SUPPLY: ☐ Private ☐ Public ☒ Well ☐ Spring ☐ Other ___ DATE EVALUATED: 5-23-06
EVALUATION METHOD: ☒ Auger Boring ☐ Pit ☐ Cut PROPERTY SIZE: ___
TYPE OF WASTEWATER: ☑ Sewage ☐ Industrial Process ☐ Mixed PROPERTY RECORDED: ___

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	3,5 - 4%	0-8	1gr l	Gr		48			.3
		8-20	1sbk cl						
		20-36	1sbk c	Sr SS SPSE					
		36-48	1sbk c + few incl. soap	micaceous					
2	40% Repair	0-8	1sbk scl			48			.3
		8-48	1sbk cl	Sr SS SPSE					
3		0-4	1sbk sl			48			.3
		4-18	1sbk cl						
		18-34	1sbk c	Sr SS SPSE					
		34-48	1sbk c + soap						

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
lable Space (.1945)	Yes	Yes
m Type(s)	2400 Gal Trench	2500 Gal Trench
TAR	.3	.3

ENTS: ___

OTHER FACTORS (.1946): ___
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: JMcWilliams
OTHER(S) PRESENT: ___


1" = 50'
125.00
89.01 Total
N66°08'53"W
38.95
18.62
70.39
25.10
Acres
350.44
S88°36'58"W
Lot 39
1.00 Acres
350.00
S88°36'58"W
some repair
6@80'
D-Box
shave
67'
24'
24'
Garage
Lot 38
1.11 Acres
388.69
356.20
S34°33'35"W
30'
30'
50' Front Setback
DRIVE
House Site
Well
70'
40
60'
D-Box
Don't put tank too deep
Lot 37
1.14 Acres
S55°00'17"W
70'
approx to line
Repair
100' to line
151.94
50' Front Setback
131.04
215.84
C35
C34
N66°08'53"W
S66°08'53"E
116.53
IP