DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: ___
COUNTY: ___

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

13782
4702396045

OWNER: Jerry & Willie
ADDRESS: ___
PROPOSED FACILITY: ___ PROPOSED DESIGN FLOW (.1949): 360
LOCATION OF SITE: Brooks Meadows Rd

APPLICATION DATE ___
DATE EVALUATED: ___
PROPERTY SIZE: 10.05 AC
PROPERTY RECORDED: Yes

WATER SUPPLY: ☐ Private ☒ Public ☐ Well ☐ Spring ☐ Other ___
EVALUATION METHOD: ☐ Auger Boring ☒ Pit ☐ Cut
TYPE OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	12% L	0-12"	Cmsl GR	Loose					05
		12-60"	Rock						
2	12% L	0-2"	SL WK SR	Fr Nonplas		36"			PS .3
		2-36"	Cmsl SBK	Fr Ssp Pl					
		36-60"	SL Ssp Cmsl	Vfr Ssp Pl					
3	3% L	0-16"	SL WK SBK	Fr Nonplas		60"+			PS .3
		16-60"	Cmsl SBK	Fr Ssp Pl					
4	8% L	0-17	SL WK SBK	Fr Nonplas		23"			PS .5
		17-48	Cmsl SBK	Fr Ssp Pl					
		48-72"	SL Ssp WK	Fr Nonplas					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	GRAV 25	LD 25
System Type(s)	YES	YES
Site LTAR	.3	.3

OTHER FACTORS (.1946): ___
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: L. COOK
OTHER(S) PRESENT: ___

COMMENTS: ___

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	Si (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiCL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			**MOIST**	**WET**
S (Shoulder Slope)		SiL (Silt Loam)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SiC (Silty Clay)			FI (Firm)	S (Sticky)
		C (Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None	None	EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

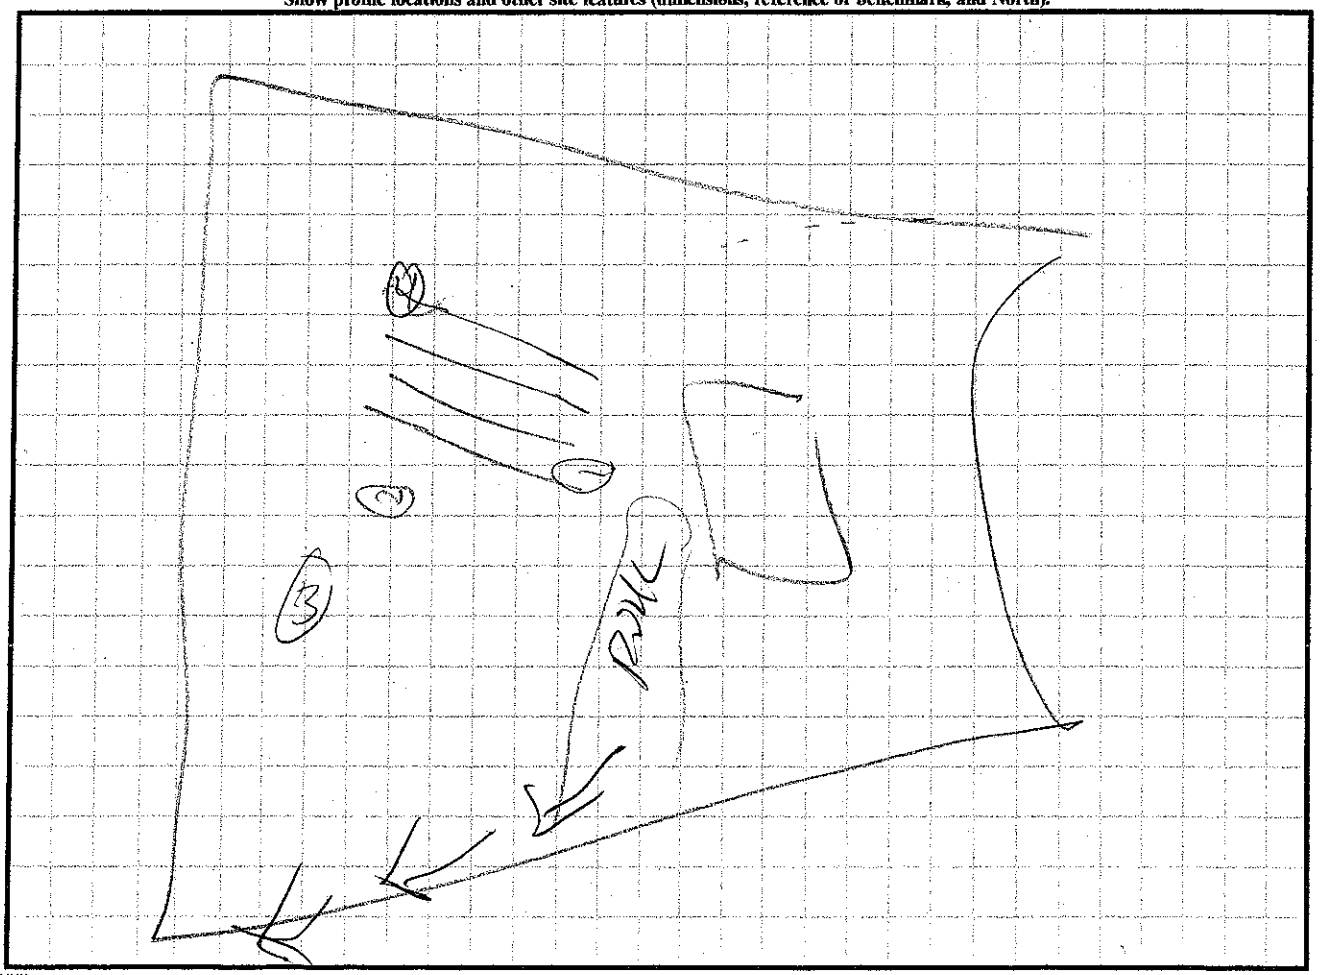

DENR (######)
Review (#####)