DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: ___
COUNTY: ___

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

123135
4703-77-5027

OWNER: CLARKS CHAPEL CHURCH
ADDRESS: 806 EUFOLA ROAD STATESVILLE NC 28625
PROPOSED FACILITY: CHURCH
PROPOSED DESIGN FLOW (.1949): 2325
LOCATION OF SITE: 806 EUFOLA ROAD STATESVILLE, NC 28625
APPLICATION DATE: 8-12-04
DATE EVALUATED: 9-12-04
PROPERTY SIZE: 6.73 + 36.92
PROPERTY RECORDED: no

WATER SUPPLY: ☐ Private ☒ Public ☐ Well ☐ Spring ☐ Other ___
EVALUATION METHOD: ☒ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	6% L	0-6	sel wk gr	l sp nsp nsl		>48"			PS .3
		6-36	c mod sbk	fi sp sns/p					
		36-48"	sl wk gr	l ss sp sns/p					
2	+2								US
	3 HOLES HIT FLUVAQUENT		BULK @	18"					
3	8% L	0-6	sel wk gr	l ns sp nsl		>48"			PS .3
		6-24"	cl mod sbk	l ss sp sns/p					
		24-36	c mod sbk	fi sp sns/p					
		36-48"	sl wk gr	l ss sp sns/p					
4	8%	0-24"	sel wk gr	fr ss sp sns/p		>48"			PS .3
		24-48"	c mod sbk	fi sp sns/p	10YR 7/4 mixed 24-48"				
					OLD STUMP	HOLE	(4)		

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	YES	YES
System Type(s)	PUMP 25% RED	SAME
Site LTAR	.3	.3

OTHER FACTORS (.1946): ___
SITE CLASSIFICATION (.1948): ___
EVALUATED BY: L. COOK
OTHER(S) PRESENT: ___

COMMENTS: ___

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope) CV (Convex Slope) D (Drainage Way) DS (Debris Slump) FP (Flood Plain) FS (Foot Slope) H (Head Slope) L (Linear Slope) N (Nose Slope) R (Ridge) S (Shoulder Slope) T (Terrace)	I	S (Sand) LS (Loamy Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive) SEXP (Slightly Expansive) EXP (Expansive)	G (Single Grain) M (Massive) CR (Crumb) GR (Granular) SBK (Subangular Blocky) ABK (Angular Blocky) PL (Platy) PR (Prismatic)
	II	SL (Sandy Loam) L (Loam)	0.8 - 0.6	0.4 - 0.3		
	III	Si (Silt) SiCL (Silty Clay Loam) CL (Clay Loam) SCL (Sandy Clay Loam) SiL (Silt Loam)	0.6 - 0.3	0.3 - 0.15		
	IV	SC (Sandy Clay) SiC (Silty Clay) C (Clay)	0.4 - 0.1	0.2 - 0.05		
		O (Organic)	None	None		

MOIST	WET
VFR (Very Friable)	NS (Non-sticky)
FR (Friable)	SS (Slightly Sticky)
FI (Firm)	S (Sticky)
VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
EFI (Extremely Firm)	NP (Non-plastic)
	SP (Slightly Plastic)
	P (Plastic)
	VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

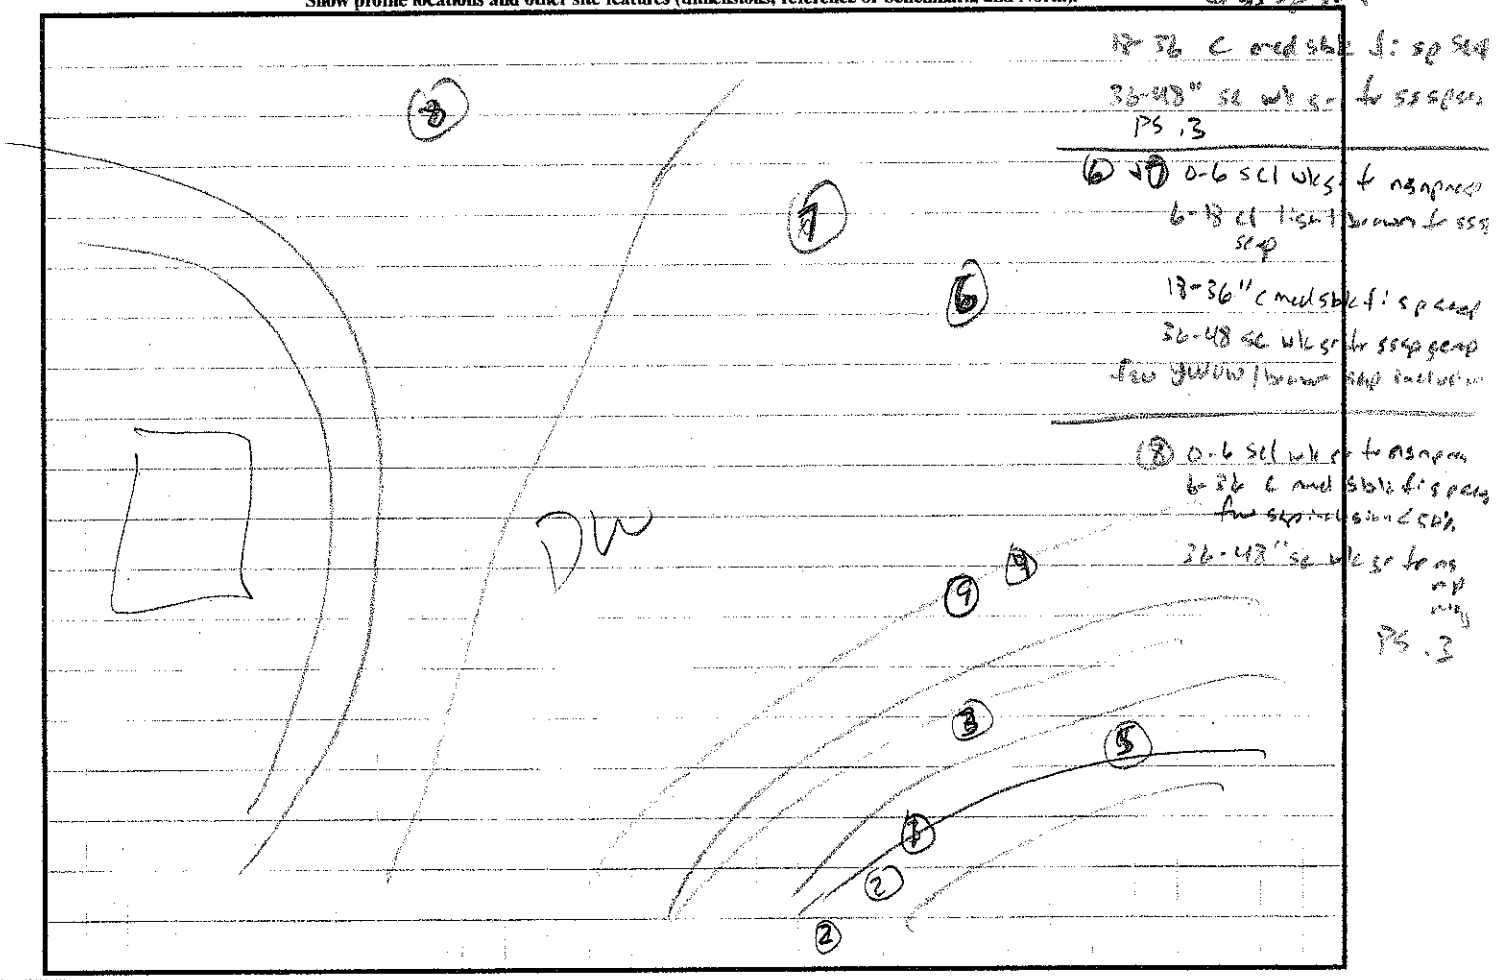

DENR (######)
Review (#####)

(9) BESIDE OLD STUMP HOLE ≈ 25'
0-6" sil wk sg - fr nsnpnev
6-36 c med sbk fi sp stky
36-48" sc wk sg fr sspsp
PS .3