DEPARTMENT OF ENVIRONMENT, HEALTH, AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of
PROPERTY ID #:
COUNTY: RANDOLPH

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM 4709-99-3481(.)

OWNER: HORNE BLDG, INC APPLICANT: SAME
ADDRESS: 254 FAIRWOOD DR, STUL, NC 28625 APPLICATION DATE: 4-7-03 DATE EVALUATED: 5-5-03
PROPOSED FACILITY: 3BR H w/ cs PROPOSED DESIGN FLOW (.1949): 360 PROPERTY SIZE: 3 ACRES
LOCATION OF SITE: 210 LAUREL CREEK ROAD, STUL, 28625 PROPERTY RECORDED: ___
WATER SUPPLY: ☑ Private ☐ Public ☑ Well ☐ Spring ☐ Other ___
EVALUATION METHOD: ☑ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☑ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFIL CLASS & LTAR
1	N 15%	0-6	GRAVELLY SBK	GRAVELLY C FR SSSP					PS 0.3
		6-34	SBK	C FR SS/SP SSSP					
		34-48	SBK	CL FR SSSP					
2	N 12%	0-4	SBK	GRAVELLY CL FR SSSP					PS 0.3
		4-38	SBK	C FR SS/SP SSSP					
		38-48	SBK	CL FR SSSP					
3	SLIGHT H 12%	0-8	SBK	CL FR SSSP					PS 0.3
		8-48	SBK	C FR SS/SP SSSP					
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	S	S
System Type(s)	II	III
Site LTAR	0.3	0.3

OTHER FACTORS (.1946): NONE
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: S. HEDRICK
OTHER(S) PRESENT: JEFF HORNE

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR	LPP .1957 LTAR	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	SI (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SICL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			MOIST	WET
S (Shoulder Slope)		SLC (Silt Loam Clay)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SIC (Silty Clay)			FI (Firm)	S (Sticky)
					VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None		EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft²

Show profile locations and other site features (dimensions, reference or benchmark, and North).

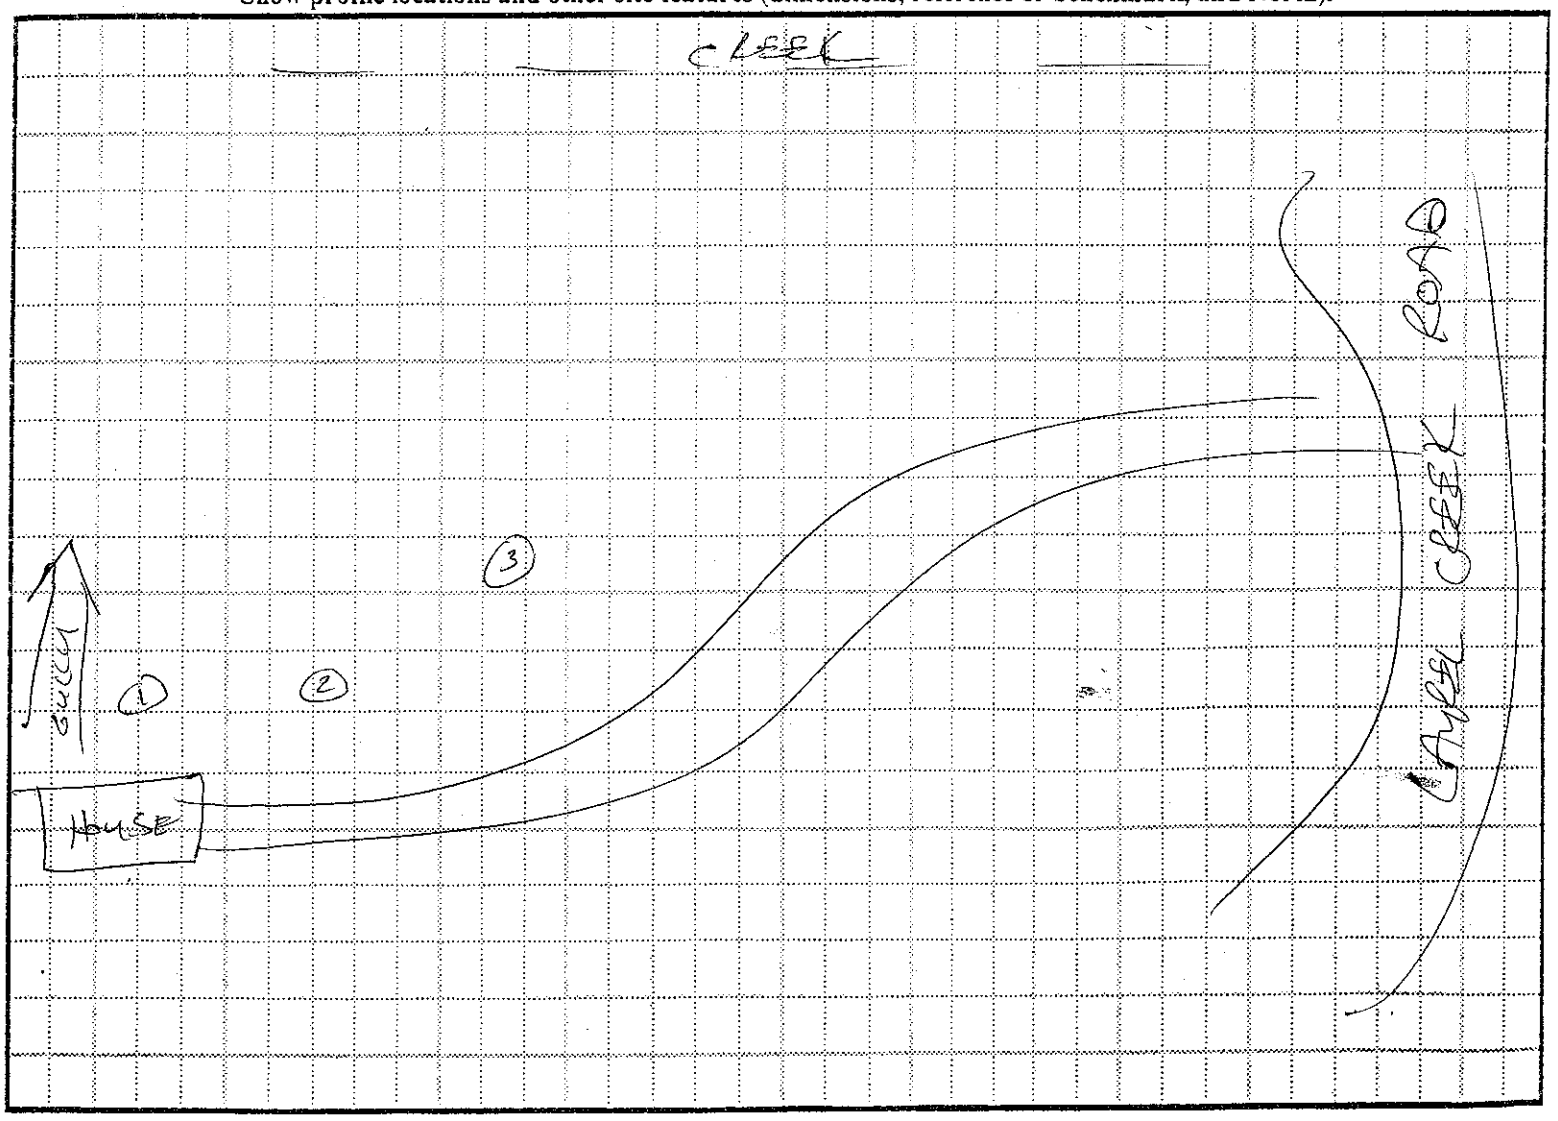

DEPARTMENT OF ENVIRONMENT, HEALTH, AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of _
PROPERTY ID #: _____
COUNTY: IREDELL


SOIL/SITE EVALUATION 2 of 2
for ON-SITE WASTEWATER SYSTEM 4709-99-3981

OWNER: HORNE BLDG, INC APPLICANT: SAME
ADDRESS: _____ APPLICATION DATE: _____ DATE EVALUATED: 3-15-09
PROPOSED FACILITY: 3BR HOUSE PROPOSED DESIGN FLOW (.1949): 360 PROPERTY SIZE: 3 ACRES
LOCATION OF SITE: 210 LAUREL CREEK RD PROPERTY RECORDED: _____
WATER SUPPLY: ☑ Private ☐ Public ☑ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☑ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☑ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFIL CLASS & LTAR
1	FS 25%	0-14	SBK GRAVELLY C	FR SS/SP SOAP					PS 0.3
		14-32	SBK C	FR SS/SP SOAP					
		32-48	SBK SC	FR SS/SP SOAP					
2	SLIGHT N	0-12	SBK GRAVELLY C	FR SS/SP SOAP					PS 0.3
		12-48	SBK C	FR SS/SP SOAP					
3									
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	S	S
System Type(s)	II	III
Site LTAR	0.3	0.3

OTHER FACTORS (.1946): NONE
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: S. HEDRICK
OTHER(S) PRESENT: _____

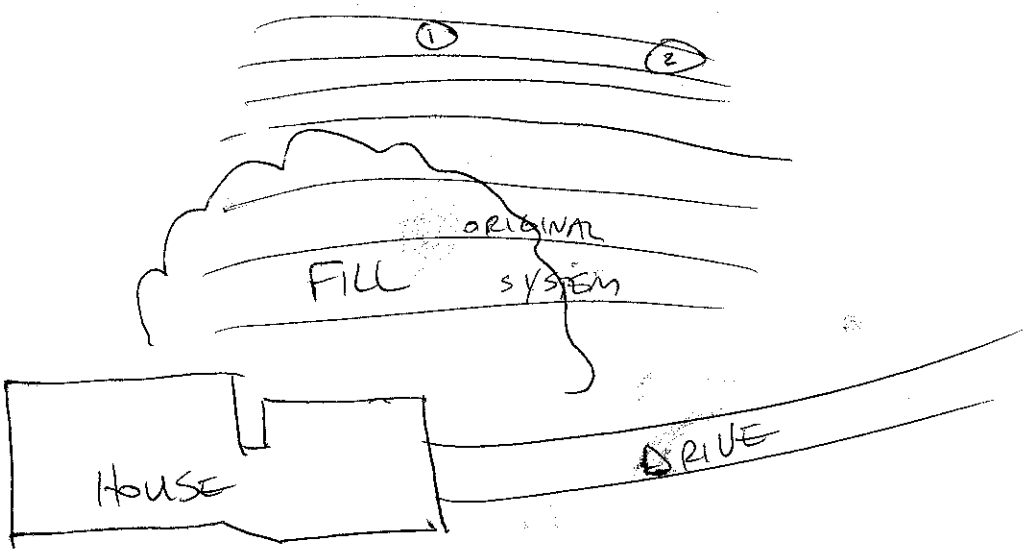
1
2
ORIGINAL
FILL
SYSTEM
HOUSE
DRIVE