DEPARTMENT OF ENVIRONMENT, HEALTH, AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #:
COUNTY:

SOIL/SITE EVALUATION for ON-SITE WASTEWATER SYSTEM

OWNER: Tony + Elizabeth Cline
ADDRESS:
APPLICANT:
PROPOSED FACILITY: SFR
APPLICATION DATE:
LOCATION OF SITE: Lot 69 Timberwalk
PROPOSED DESIGN FLOW (.1949): 4Bdrm
DATE EVALUATED: 5-17-06
WATER SUPPLY: ☑ Private ☐ Public ☒ Well ☐ Spring ☐ Other
PROPERTY SIZE:
EVALUATION METHOD: ☒ Auger Boring ☐ Pit ☐ Cut
PROPERTY RECORDED:
TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	6-7% S	0-10	mgr brn sl	fr ss sp					.3
		10-27	wk m sbk red cl	fr sp ss ep					
		27-48	wk sbk red cl	fr ss sp					
2	8% S	0-8	mgr brn sl	fr ss sp					.3
		8-42	wk sbk red cl	fr ss sp ep					
		42"+	wt a "floater rock"						
3	6% R/S	0-5	mgr sl/scl	fr ss sp					.3
		5-24	wk m sbk red cl	fr sp ss ep					
		24-48	wk sbk red cl	fr ss sp					
			few small rock fragments						
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	pm cond.	pm 25% red.
Site LTAR	.3	.3

OTHER FACTORS (.1946):
SITE CLASSIFICATION (.1948): PS
EVALUATED BY:
OTHER(S) PRESENT:

COMMENTS:

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL 1955 LTAR	LPP 1957 LTAR	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky,
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	SI (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SICL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			MOIST	WET
S (Shoulder Slope)		SLC (Silt Loam Clay)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SIC (Silty Clay)			FI (Firm)	S (Sticky)
					VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None		EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

259
142/61

NOTES


HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

100' + to Neighbors Well

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft²

Show profile locations and other site features (dimensions, reference or benchmark, and North).

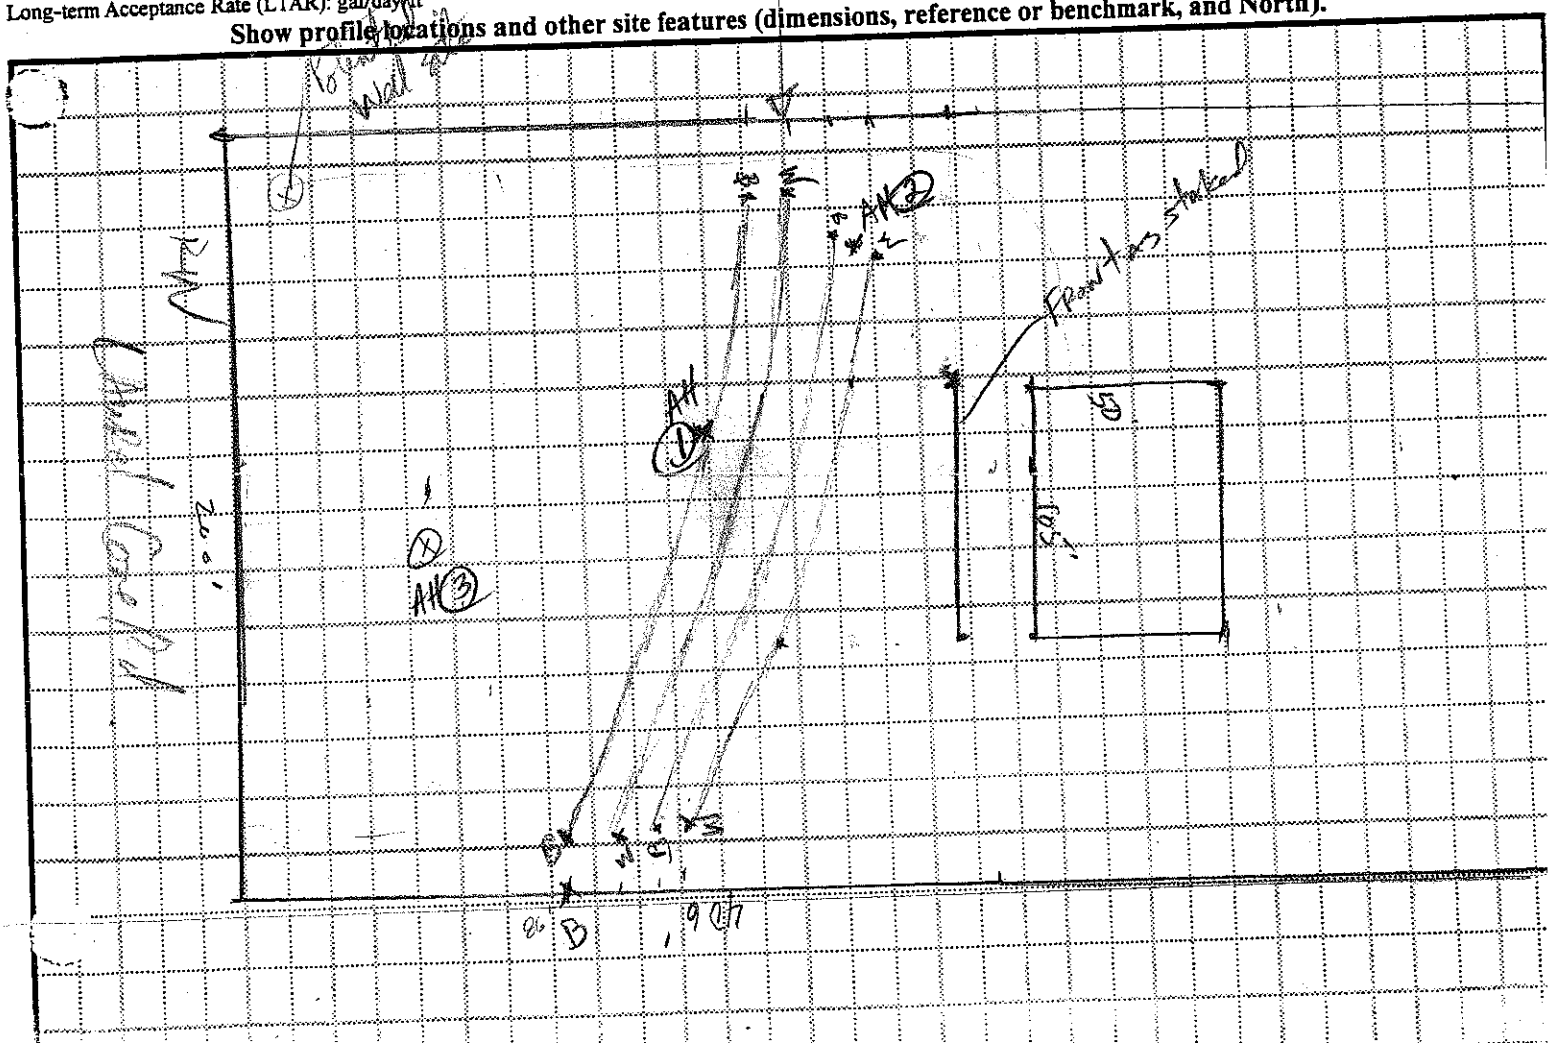

DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: 13542
COUNTY: 4711-43-7232

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: ~~Allen~~ COOK CLYDE
ADDRESS: 7406 OLDE CT Stanley NC 28164
PROPOSED FACILITY: 4 BR HSE PROPOSED DESIGN FLOW (.1949): 400
LOCATION OF SITE: HARPER WATER LOT #69
APPLICATION DATE: 1-20-06
DATE EVALUATED: 1-24-07
PROPERTY SIZE: 1.81 AC
PROPERTY RECORDED: ___

WATER SUPPLY: ☐ Private ☐ Public ☒ Well ☐ Spring ☐ Other ___
EVALUATION METHOD: ☐ Auger Boring ☒ Pit ☐ Cut TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	±2 SAME 15D/0	0-6	SCL WK GR	FRIABLE	OVERALL SPOTTED	36-42" 48" SOIL	~ AT PIT		PS .3
		6-48"	CMOD SBK	FSS SPEC					
		48-54"	SILTY SAP	FRIABLE					
3	2D 0/0	0-6	SCL WK GR	FRIABLE		36"			PS .3
		6-36	CMOD SBK	FSS SPEC					
		36-54"	SILTY SAP	FRIABLE	REDOX				
2									
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	YES	YES
System Type(s)	CONV 25%	25% LP / CAP
Site LTAR	.3	.3

OTHER FACTORS (.1946): ___
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: L. COOK
OTHER(S) PRESENT: ___

COMMENTS: ___

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope) CV (Convex Slope) D (Drainage Way) DS (Debris Slump) FP (Flood Plain) FS (Foot Slope) H (Head Slope) L (Linear Slope) N (Nose Slope) R (Ridge) S (Shoulder Slope) T (Terrace)	I	S (Sand) LS (Loamy Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive) SEXP (Slightly Expansive) EXP (Expansive)	G (Single Grain) M (Massive) CR (Crumb) GR (Granular) SBK (Subangular Blocky) ABK (Angular Blocky) PL (Platy) PR (Prismatic)
	II	SL (Sandy Loam) L (Loam)	0.8 - 0.6	0.4 - 0.3		
	III	Si (Silt) SiCL (Silty Clay Loam) CL (Clay Loam) SCL (Sandy Clay Loam) SiL (Silt Loam)	0.6 - 0.3	0.3 - 0.15		
	IV	SC (Sandy Clay) SiC (Silty Clay) C (Clay) O (Organic)	0.4 - 0.1 None	0.2 - 0.05 None		

MOIST	WET
VFR (Very Friable)	NS (Non-sticky)
FR (Friable)	SS (Slightly Sticky)
FI (Firm)	S (Sticky)
VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
EFI (Extremely Firm)	NP (Non-plastic)
	SP (Slightly Plastic)
	P (Plastic)
	VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

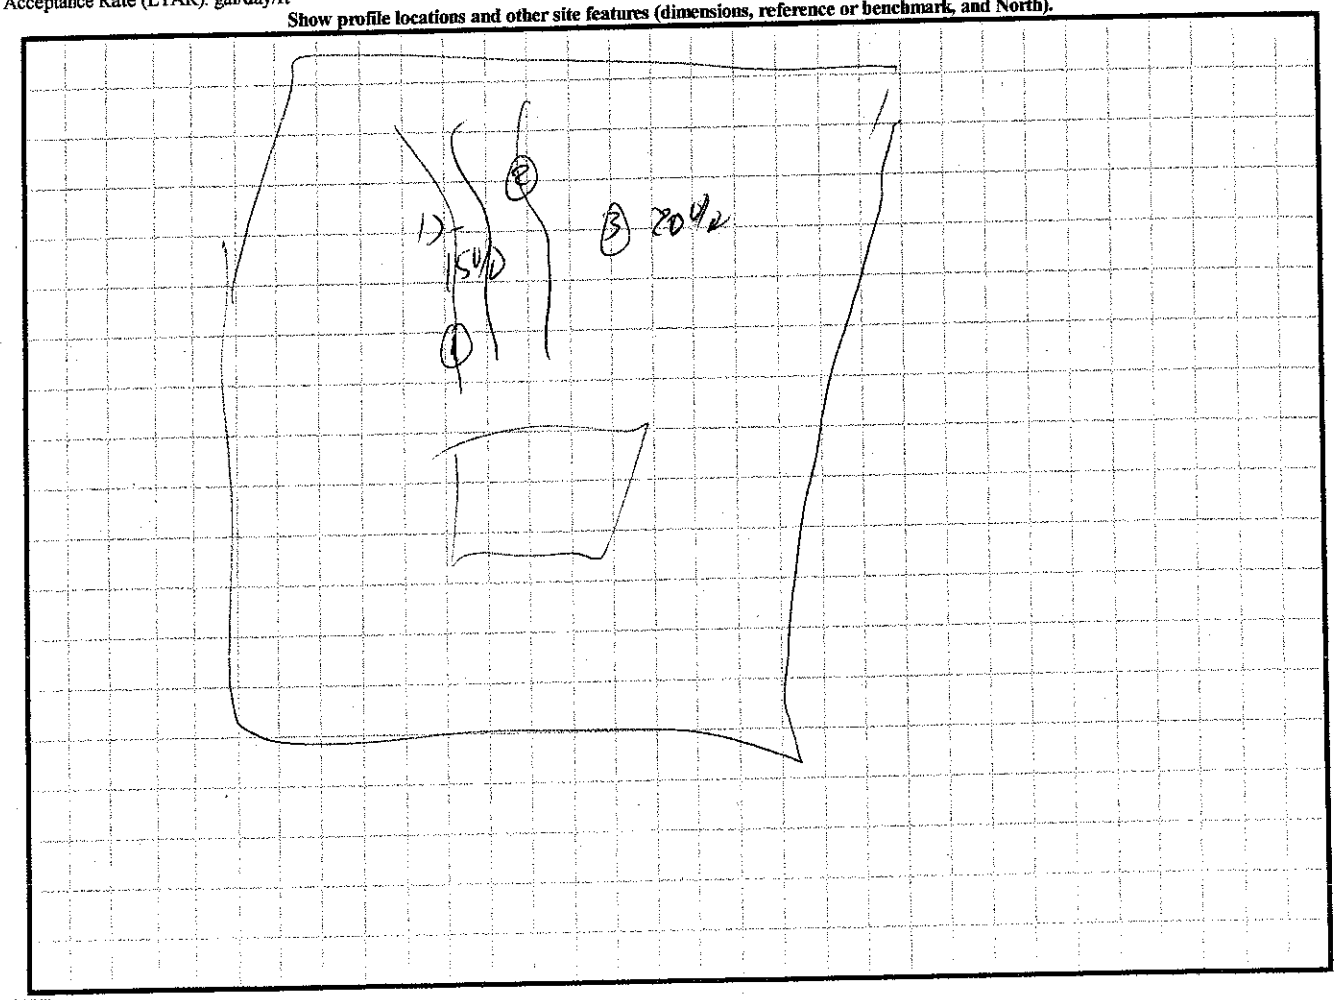

DENR (######)
Review (#####)