DENR/DEH

ON-SITE WASTEWATER SECTION

Sheet 1 of 1
PROPERTY ID #: 471334086
COUNTY: Iredell

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: Thomas Stewart
ADDRESS: 119 Redmond Dairy Rd.
PROPOSED FACILITY: SFD
PROPOSED DESIGN FLOW (.1949): 600 gpd
LOCATION OF SITE: 152 Celeste Cufola
WATER SUPPLY: • Private • Public • Well • Spring • Other N/A
EVALUATION METHOD: • Auger Boring • Pit • Cut
TYPE OF WASTEWATER: • Sewage • Industrial Process • Mixed

APPLICATION DATE 5-30-16
DATE EVALUATED: 7-9-16
PROPERTY SIZE: 5.0 acres
PROPERTY RECORDED: Yes

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	2% L	6-10	CL SBK	Fr Mod SE	48"	48"	48"	48" LC	PS 0.3
		10-26	RC SABK	Fr Mod SE					
		26-48	BC SAP Incl ABK	Fr Mod SE					
2	4% slight NS	6-23	RC ABK	Fr Mod SE	48"	46"	46"	46"	PS 0.3
		23-46	BC SAP Incl ABK	Fr Mod SE					
		46-48	SAP						
3	4% Slight NS	0-30	RC WABK	Fr Mod SE	48"	48"	48"	48"	PS 0.3
		30-48	CL SBK/ABK	Fr Mod SE					
4	4% Slight NS	0-8	BSCL SBK	Fr Mod SE	48"	48"	48"	48"	PS 0.3
		8-31	RC ABK	Fr Mod SE					
		31-48	BC SBK/ABK	Fr Mod SE					
			Few Sap Inclusions						

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	II	III
Site LTAR	0.3	0.3

OTHER FACTORS (.1946): N/A
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: [signature]
OTHER(S) PRESENT: N/A

COMMENTS: TB @ 34" Max.

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope) CV (Convex Slope) D (Drainage Way) DS (Debris Slump) FP (Flood Plain) FS (Foot Slope) H (Head Slope) L (Linear Slope) N (Nose Slope) R (Ridge) S (Shoulder Slope) T (Terrace)	I	S (Sand) LS (Loamy Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive) SEXP (Slightly Expansive) EXP (Expansive)	G (Single Grain) M (Massive) CR (Crumb) GR (Granular) SBK (Subangular Blocky) ABK (Angular Blocky) PL (Platy) PR (Prismatic)
	II	SL (Sandy Loam) L (Loam)	0.8 - 0.6	0.4 - 0.3		
	III	Si (Silt) SiCL (Silty Clay Loam) CL (Clay Loam) SCL (Sandy Clay Loam) SiL (Silt Loam)	0.6 - 0.3	0.3 - 0.15		
	IV	SC (Sandy Clay) SiC (Silty Clay) C (Clay)	0.4 - 0.1	0.2 - 0.05		
		O (Organic)	None	None		

MOIST	WET
VFR (Very Friable)	NS (Non-sticky)
FR (Friable)	SS (Slightly Sticky)
FI (Firm)	S (Sticky)
VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
EFI (Extremely Firm)	NP (Non-plastic)
	SP (Slightly Plastic)
	P (Plastic)
	VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)


Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

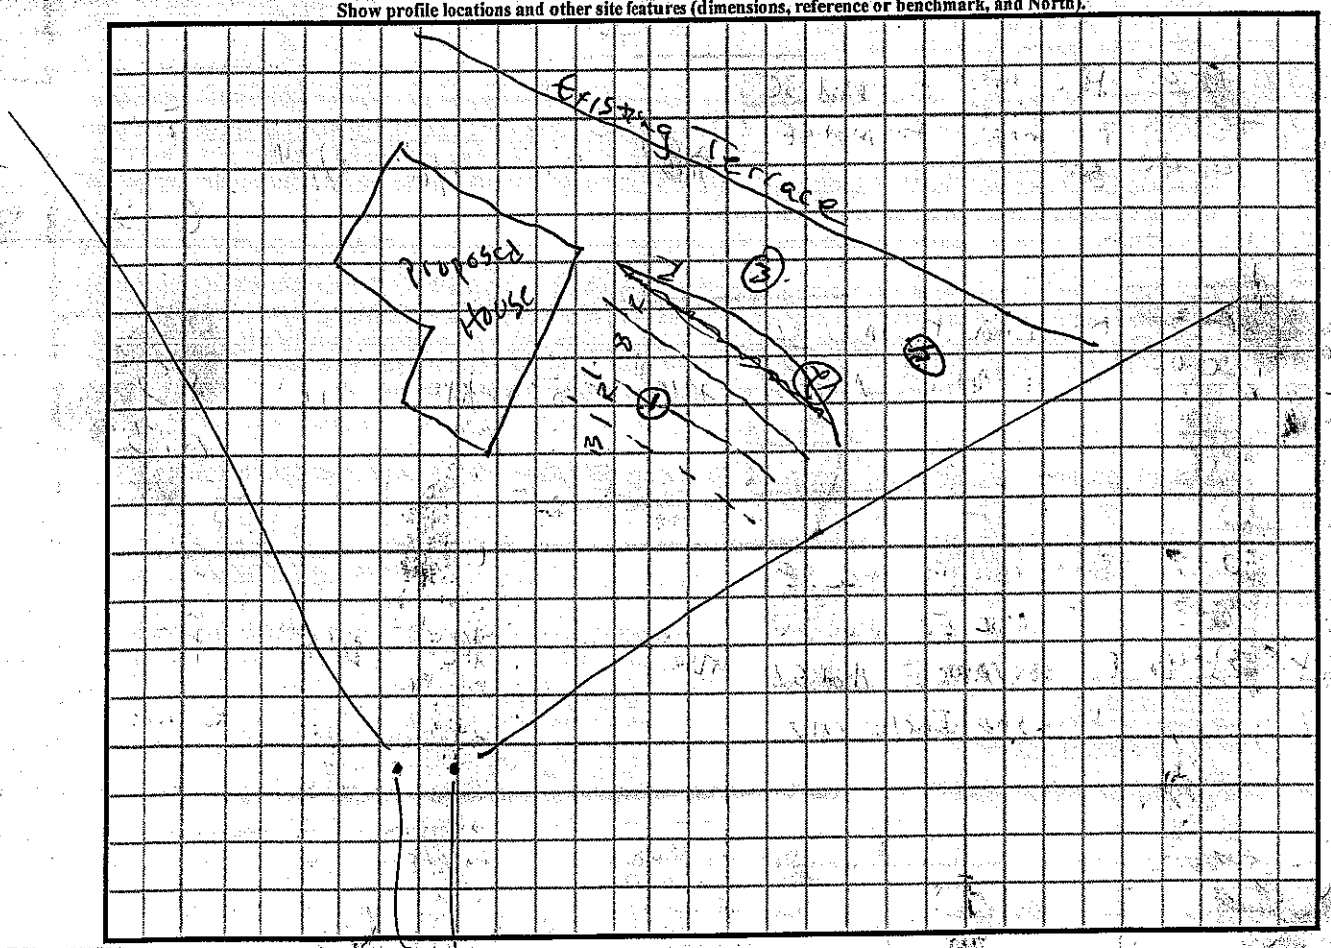

DENR (######)
Review (#####)

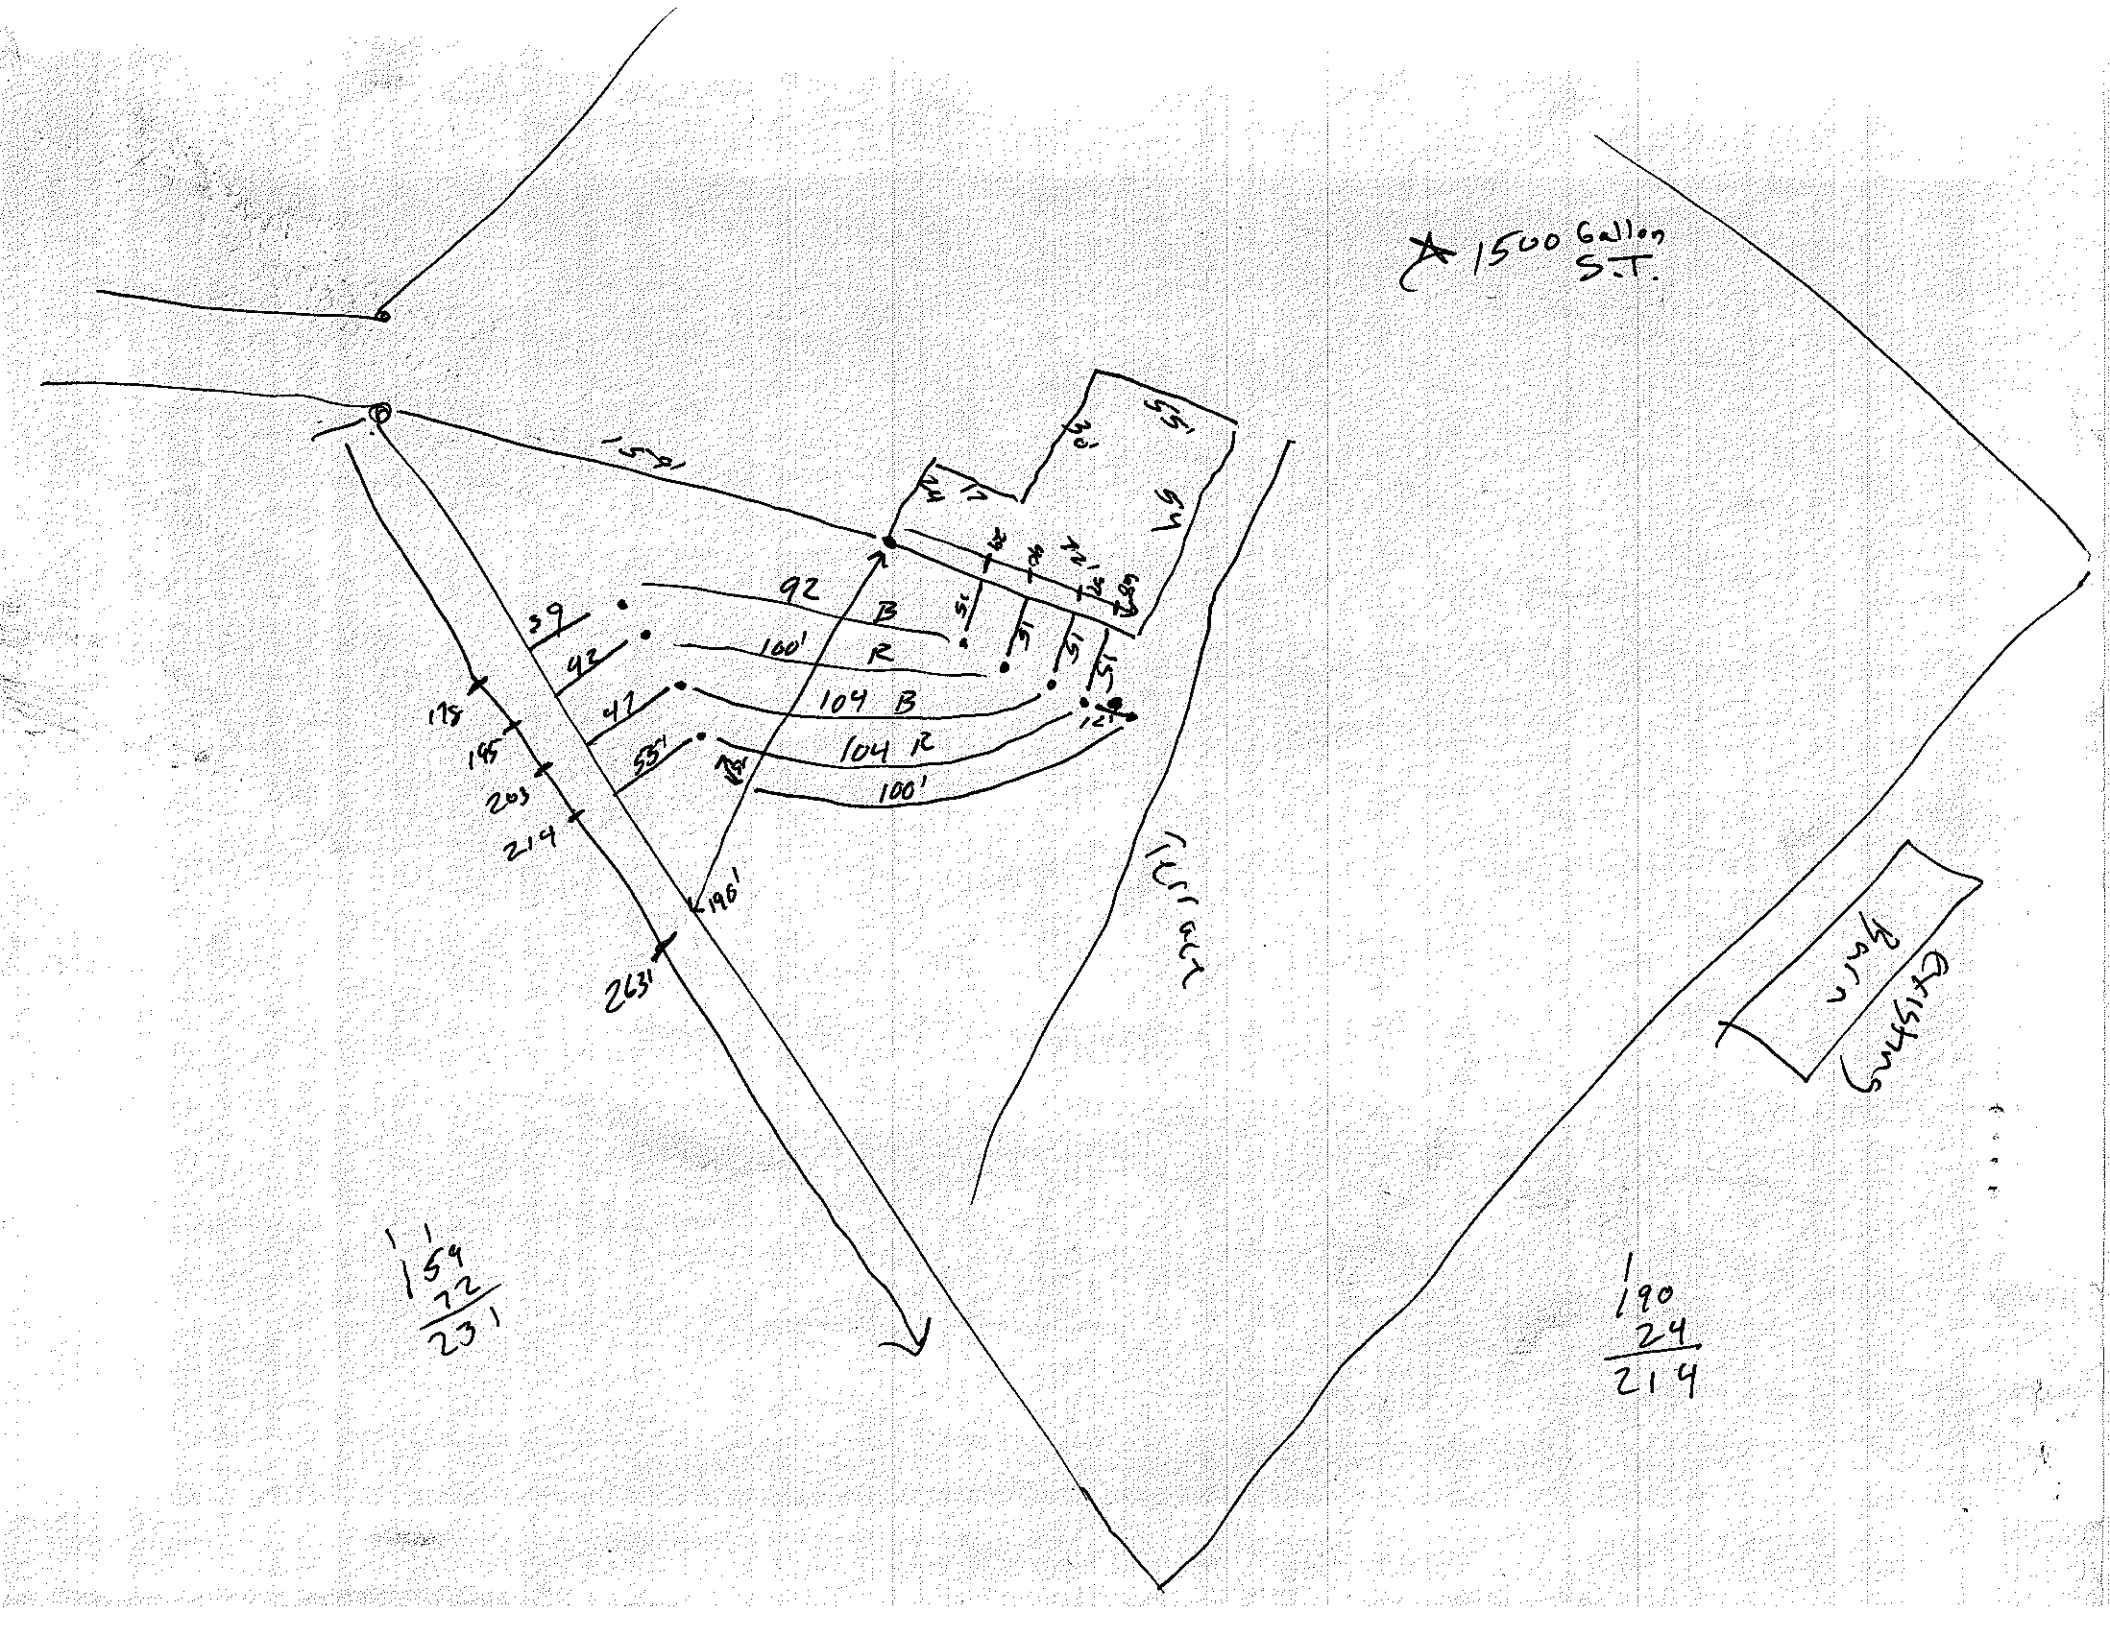
1500 Gallon S.T.
Garage
Existing
92
B
100'
R
104 B
104 R
100'
39
92
47
55'
178
145
205
214
196'
263'
55'
30'
54
55'
55'
55'
55'
55'
12'
12'
1 1
159
72
231
1
190
24
214