158077
4715706111

DENR/DEH

ON-SITE WASTEWATER SECTION

Sheet 1 of 1
PROPERTY ID #:
COUNTY: Iredell

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: Billy Little
ADDRESS: 165 Brittain Hase lane Statesville 28160
PROPOSED FACILITY: Misc
LOCATION OF SITE: Island Ford (R) Canner (TR) Guaterhase
APPLICATION DATE 9-1-09
DATE EVALUATED: 10-27-09
PROPERTY SIZE: 23 Ac
PROPOSED DESIGN FLOW (.1949): 360
PROPERTY RECORDED:
WATER SUPPLY: • Private • Public • Well • Spring • Other
EVALUATION METHOD: • Auger Boring • Pit • Cut
TYPE OF WASTEWATER: • Sewage • Industrial Process • Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	L 9%	0-9	CWBL	SSSPSepfr					PS
		9-34	CABL	SSSPSepfr					
		34-48	CWBL	SSSPSepfr					.25
					NA	48	NA	NA	
2	L 10%	0-7	CWBL	SSSPSepf					PS
		7-27	CABL	SSSPSPfr					
		27-30	CABL	SSSPSepf	mottling				.25
					10YR6/8	48	NA	NA	
3	L 12%	0-9	CABL	SSSPSepfr					PS
		9-35	CABL	SSSPSepfr	mica inclusions				
		35-48	CWBL	SSSPSepfr					.25
					NA	48	NA	NA	
4	L 12%	0-9	CWBL	SSSPSPL					PS
		9-30	CABL	SSSPSepf	mottling				
		30-48	CWBL	SSSPSPfr					.25
					10/2/6/2	48	NA	NA	

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	1440/360	1440/360
System Type(s)	25%C	25%C
Site LTAR	.25	.25

OTHER FACTORS (.1946): NBS
SITE CLASSIFICATION (.1948): NBS
EVALUATED BY: Hugh Cook
OTHER(S) PRESENT:

COMMENTS:

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	Si (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiCL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			**MOIST**	**WET**
S (Shoulder Slope)		SiL (Silt Loam)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SiC (Silty Clay)			FI (Firm)	S (Sticky)
		C (Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None	None	EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

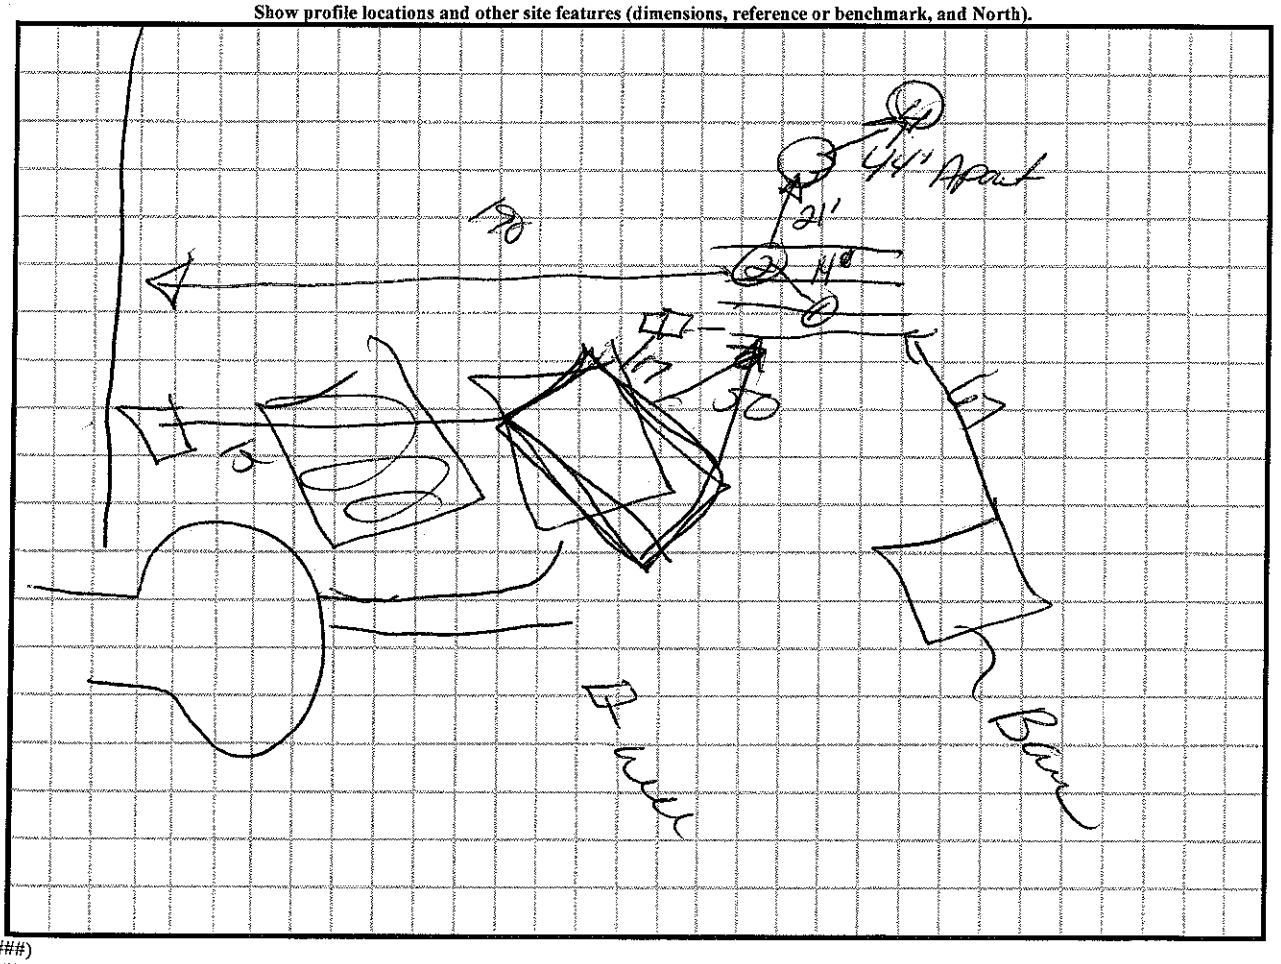

DENR (######)
Review (#####)