DENR/DEH

ON-SITE WASTEWATER SECTION

Sheet 1 of 1
PROPERTY ID #: 4717109533
COUNTY: Iredell

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: Darlene Goforth — APPLICATION DATE 5-27-15
ADDRESS: 821 Wood St. — DATE EVALUATED: 6-1-15
PROPOSED FACILITY: SFD — PROPOSED DESIGN FLOW (.1949): 240gpd — PROPERTY SIZE: 27.96 acres
LOCATION OF SITE: 1051 Midway Rd. — PROPERTY RECORDED: Yes
WATER SUPPLY: (Private) • Public • Well • Spring • Other N/A
EVALUATION METHOD: (Auger Boring) • Pit • Cut — TYPE OF WASTEWATER: (Sewage) • Industrial Process • Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ.	PROFILE CLASS & LTAR
1	16% NS	0-15	C very micaceous SBK	Fr Mod SE	+48"	@36"	36"	36"	PS 0.25
		15-36	BC ↑mica WSBK	Fr Mod SE					
		36-48	SAP						
2	12% NS	0-31	C very micaceous SBK	Fr Mod SE	+36"	36"	36"	36"	PS 0.25
		31-36	BC mica SBK	Fr Mod SE					
		36"	Rock	Floater??					
			Quartz?? Floaters						
3	14% NS	0-24	C very micaceous SBK	Fr Mod SE	+36"	36"	36"	36"	PS 0.25
		24-36	BC ↑mica WSBK	Fr Mod SE					
		36-	Rock/Floaters??						
			Quartz Floaters						
4	15% NS	0-20	C ↑Mica SBK	Fr Mod SE	+41"	41"	41"	41"	PS 0.25
		20-41	BC ↑mica WSBK	Fr Mod SE					
		41	Rock						

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	II	III
Site LTAR	0.25	0.25

OTHER FACTORS (.1946): N/A
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: Justin Henderson
OTHER(S) PRESENT: N/A

COMMENTS: TB @ 24" High Side N/A

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL 1955 LTAR*	LPP 1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	Si (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiCL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			MOIST	WET
S (Shoulder Slope)		SiL (Silt Loam)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SiC (Silty Clay)			FI (Firm)	S (Sticky)
		C (Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None	None	EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

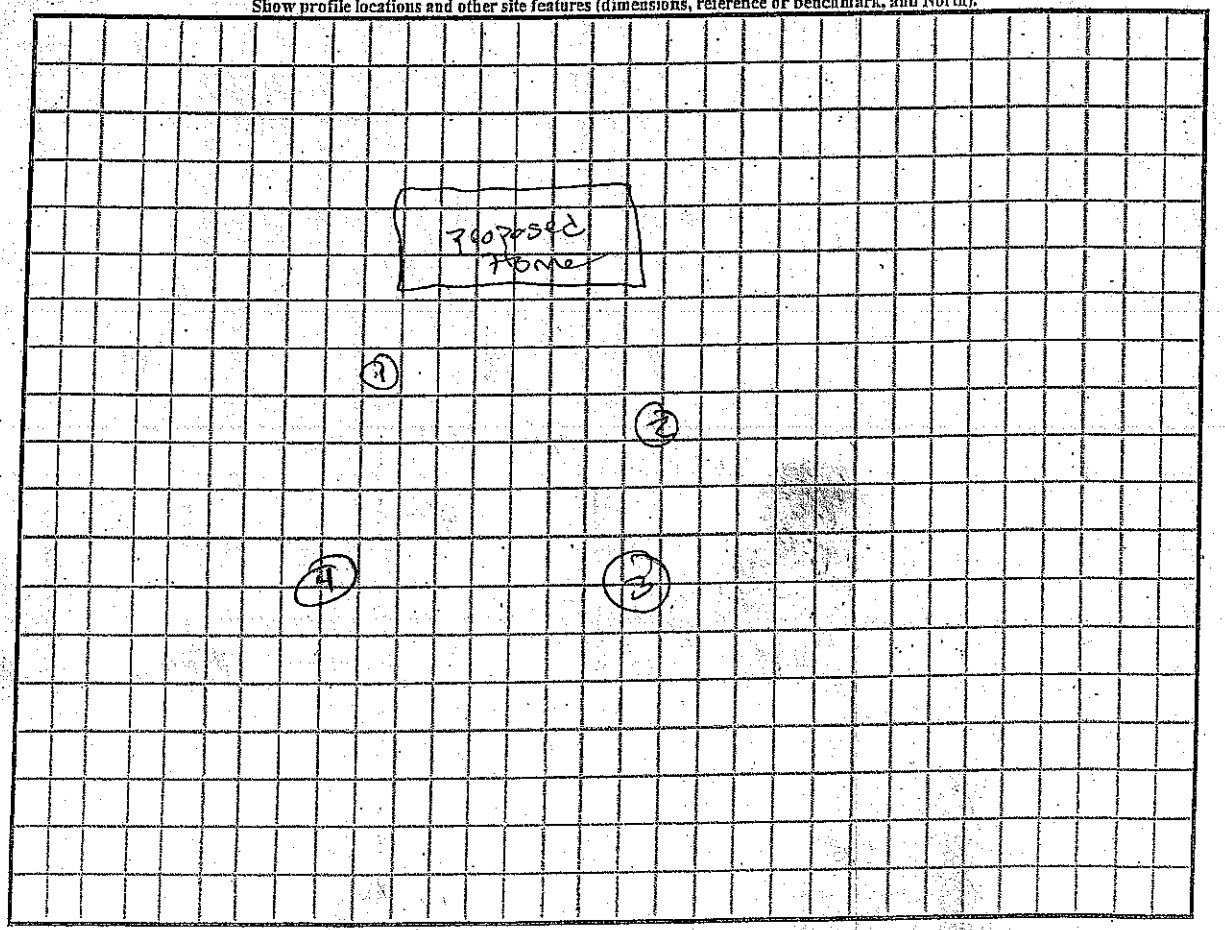

DENR (#######)
Review (######)

Park
Play Area
Road
Path
Building
Tree
Well
Pump
Gate
Fence
Boundary
Compound
Office
Store
Shed
Garage
Workshop
Entrance
Exit
Road
Path
Building
Tree
Well
Pump
Gate
Fence
Boundary
Compound
Office
Store
Shed
Garage
Workshop
Entrance
Exit