DENR/DEH

ON-SITE WASTEWATER SECTION

Sheet 1 of 1
PROPERTY ID #: 4717-56-6612
COUNTY: Iredell

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: Bobby Wilcox
ADDRESS: 146 Cove Gap Rd Statesville
PROPOSED FACILITY: 3 BR Home
LOCATION OF SITE: 173 Cove Gap Rd.
WATER SUPPLY: • Private • ~~Public~~ • ~~Well~~ • ~~Spring~~ • ~~Other~~ Exist. well
EVALUATION METHOD: • Auger Boring • ~~Pit~~ • ~~Cut~~

APPLICATION DATE 5-7-10
DATE EVALUATED: 8 June 10
PROPERTY SIZE: 10+ ac.
PROPERTY RECORDED:
TYPE OF WASTEWATER: • Sewage • ~~Industrial Process~~ • ~~Mixed~~

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	L 670	0-21	sbk / scl	fr / sl sty pl	>18	>18	NA	ND	0.3 PS
		21-48+	sbk / c	fr / sl sty pl					
2	L 690	0-18	sbk / scl	fr / sl sty pl	>18	>18	NA	ND	PS 0.3
		18-48+	sbk / c	fr / sl sty pl					
3	L 690	0-22	sbk / scl	fr / sl sty pl	>18	>18	ND	NA	PS 0.7
		22-48+	sbk / c	fr / sl sty pl					
4	L 690	0-20	sbk / scl	fr / sl sty pl	>18	>18	NP	NP	PS 0.2
		20-36	sbk / c	fr / sl sty pl					
		36-48+	sbk / cl	fr / sl sty pl					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	III	III
Site LTAR	0.3	0.3

OTHER FACTORS (.1946): NA
SITE CLASSIFICATION (.1948): PS

EVALUATED BY: TCH
OTHER(S) PRESENT: Ginger Dowdle

COMMENTS:

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	Si (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiCL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			**MOIST**	**WET**
S (Shoulder Slope)		SiL (Silt Loam)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SiC (Silty Clay)			FI (Firm)	S (Sticky)
		C (Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None	None	EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

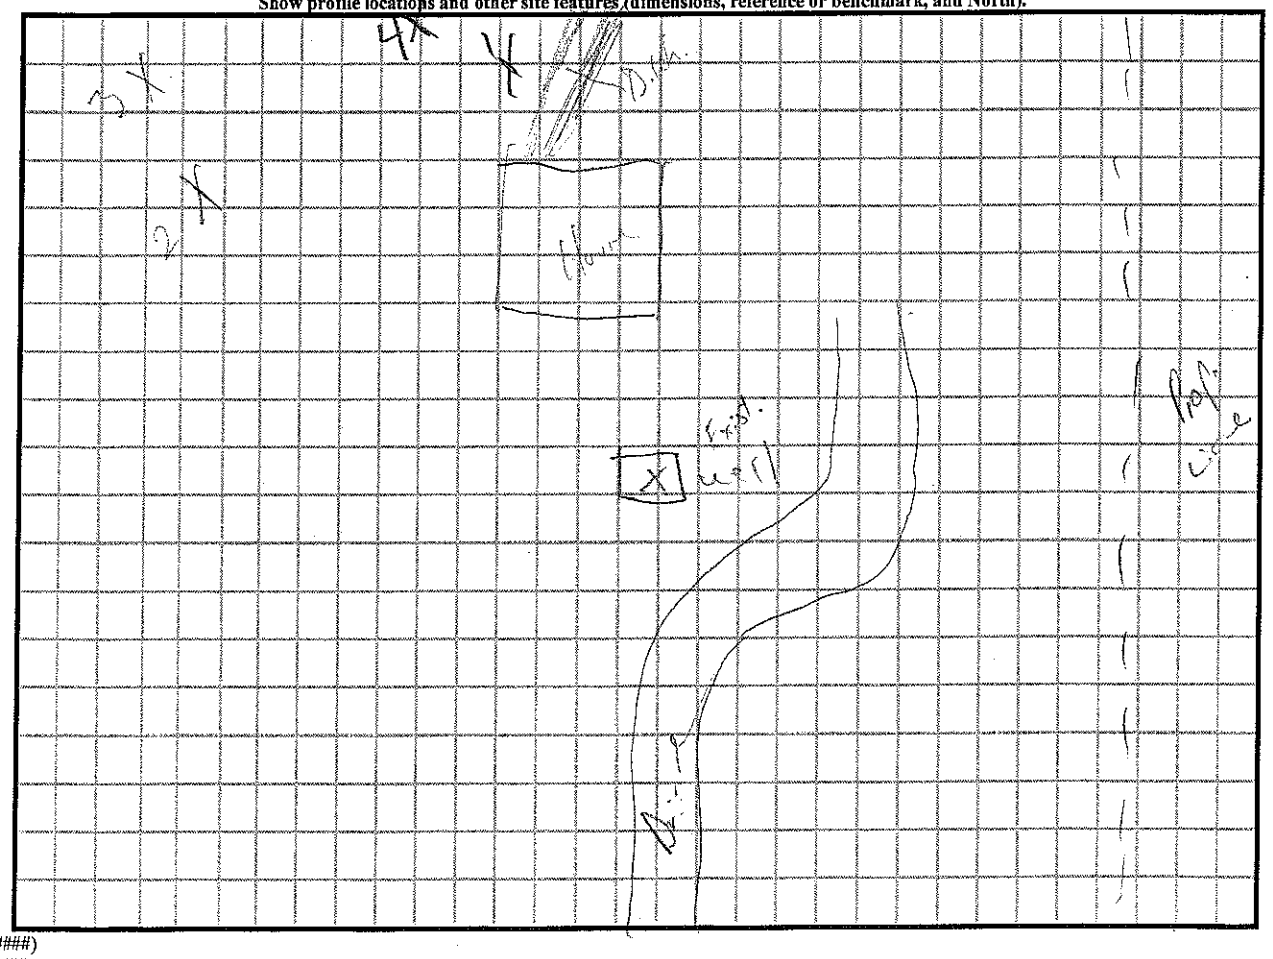

DENR (######)
Review (#####)