DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet 1 of 1
PROPERTY ID #:
COUNTY: IREDELL
4720-56-9709

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: LAKE NORMAN STATE PARK
ADDRESS: 159 INLAND SEA LANE TROUTMAN NC 28166
PROPOSED FACILITY: PICNIC AREA
PROPOSED DESIGN FLOW (.1949): 1200 GPD
LOCATION OF SITE: STATE PARK AT OLD SWIMMING AREA
APPLICATION DATE:
DATE EVALUATED: 6-20-06
PROPERTY SIZE: 1527.15 ACRES
PROPERTY RECORDED:

WATER SUPPLY: ☐ Private ☑ Public ☐ Well ☐ Spring ☐ Other
EVALUATION METHOD: ☑ Auger Boring ☑ Pit ☐ Cut
TYPE OF WASTEWATER: ☑ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	N 10%	0-7	GR SL	VFR SSSP					PS 0.25
		7-11	SBK CL	FR SSSP					
		11-32	MMSBK C	FI SSSP					
		32-48	WFSBK SAP MVF CL	FR SSSP					
2	N 10%	0-6	GR SL	VFR SSSP					PS 0.25
		6-12	SBK CL	FR SSSP					
		12-32	MMSBK C	FI SSSP					
		32-48	WFSBK SAP MVF CL	FR SSSP					
3	N 8%	0-4	GR SL	VFR SSSP					PS 0.25
		4-10	SBK CL	FR SSSP					
		10-30	MMSBK C	FI SSSP					
		30-48	WFSBK SAP MVF CL	FR SSSP					
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	III	III
Site LTAR	0.25	0.25

OTHER FACTORS (.1946): NONE
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: S. HEDRICK
OTHER(S) PRESENT: CASEY RINEHART

COMMENTS:

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope) CV (Convex Slope) D (Drainage Way) DS (Debris Slump) FP (Flood Plain) FS (Foot Slope) H (Head Slope) L (Linear Slope) N (Nose Slope) R (Ridge) S (Shoulder Slope) T (Terrace)	I	S (Sand) LS (Loamy Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive) SEXP (Slightly Expansive) EXP (Expansive)	G (Single Grain) M (Massive) CR (Crumb) GR (Granular) SBK (Subangular Blocky) ABK (Angular Blocky) PL (Platy) PR (Prismatic)
	II	SL (Sandy Loam) L (Loam)	0.8 - 0.6	0.4 - 0.3		
	III	Si (Silt) SiCL (Silty Clay Loam) CL (Clay Loam) SCL (Sandy Clay Loam) SiL (Silt Loam)	0.6 - 0.3	0.3 - 0.15	**MOIST**	**WET**
	IV	SC (Sandy Clay) SiC (Silty Clay) C (Clay)	0.4 - 0.1	0.2 - 0.05	VFR (Very Friable) FR (Friable) FI (Firm) VFI (Very Firm v. Very Sticky)	NS (Non-sticky) SS (Slightly Sticky) S (Sticky) VS (Very Sticky)
		O (Organic)	None	None	EFI (Extremely Firm)	NP (Non-plastic) SP (Slightly Plastic) P (Plastic) VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

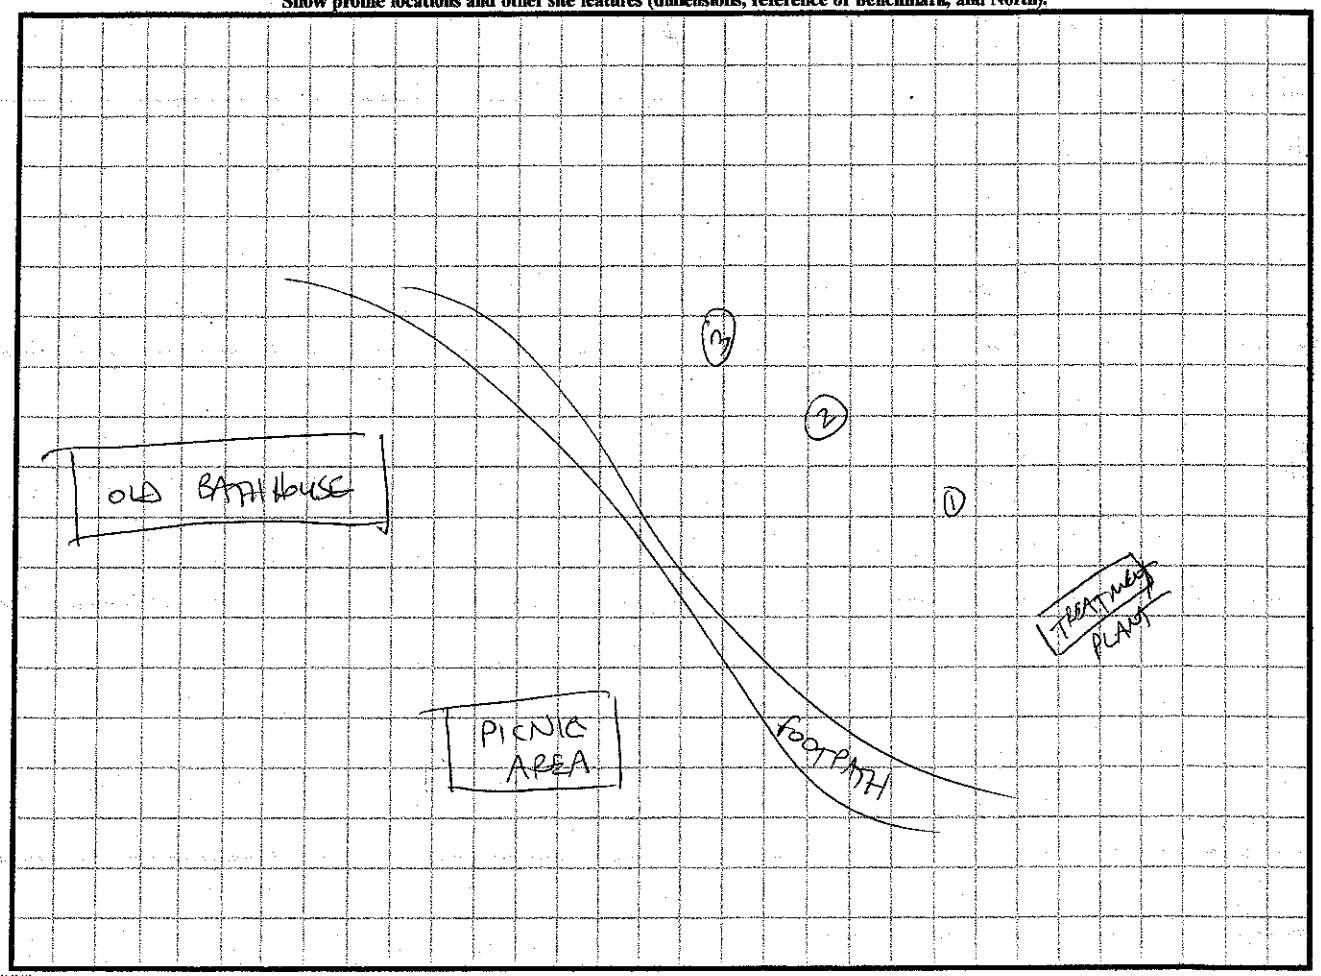

DENR (######)
Review (#####)