DENR/DEH

ON-SITE WASTEWATER SECTION

Sheet 1 of 2
PROPERTY ID #: 4721976166
COUNTY: IREDELL

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: JENNIFER BRINKLEY
ADDRESS: 199 STONEGATE LANE, STATESVILLE
PROPOSED FACILITY: 1 BR POOL HOUSE PROPOSED DESIGN FLOW (.1949): 240
LOCATION OF SITE: 199 STONEGATE LANE
WATER SUPPLY: ✓ Private • Public • Well • Spring • Other
EVALUATION METHOD: ✓ Auger Boring • Pit • Cut

APPLICATION DATE: 1-20-12
DATE EVALUATED: 2-15-12
PROPERTY SIZE: 73.87 AC
PROPERTY RECORDED: YES
TYPE OF WASTEWATER: ✓ Sewage • Industrial Process • Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	L 7%	0-6	SBK CL	FR SEP	N/A	U @ 6"+	N/A	N/A	U
		6+	ROCK/WEATHERED ROCK						
2	L 8%	0-26	SBK C	FR SS/SP SEP	N/A	PS TO 48"	N/A	N/A	PS 0.3
		26-30	SBK SC	FR SEP					
		30-48	SBK CL	VFR SEP					
3	R 2%	0-20	SBK CL	FR SEP	N/A	~~PS~~ PS TO 20"+	N/A	N/A	PS ~~TO~~ 20" 0.3 / U @ 20"+
		20+	WEATHERED ROCK						
4	L 7%	0-24	SBK CL	FR SEP	NA	PS TO 24"+	N/A	N/A	PS TO 24"/0.3 / U @ 24"+
		24+	WEATHERED ROCK						

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	S	S
System Type(s)	II	II
Site LTAR	0.3	0.3

OTHER FACTORS (.1946): NONE
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: S. HENDRICK
OTHER(S) PRESENT: JERRY EKERIDGE, JENNIFER BRINKLEY

COMMENTS: AN "ACCEPTED SYSTEM" MAY ALSO BE USED

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope) CV (Convex Slope) D (Drainage Way) DS (Debris Slump) FP (Flood Plain) FS (Foot Slope) H (Head Slope) L (Linear Slope) N (Nose Slope) R (Ridge) S (Shoulder Slope) T (Terrace)	I	S (Sand) LS (Loamy Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive) SEXP (Slightly Expansive) EXP (Expansive)	G (Single Grain) M (Massive) CR (Crumb) GR (Granular) SBK (Subangular Blocky) ABK (Angular Blocky) PL (Platy) PR (Prismatic)
	II	SL (Sandy Loam) L (Loam)	0.8 - 0.6	0.4 - 0.3		
	III	Si (Silt) SiCL (Silty Clay Loam) CL (Clay Loam) SCL (Sandy Clay Loam) SiL (Silt Loam)	0.6 - 0.3	0.3 - 0.15		
	IV	SC (Sandy Clay) SiC (Silty Clay) C (Clay)	0.4 - 0.1	0.2 - 0.05		
		O (Organic)	None	None		

MOIST	WET
VFR (Very Friable)	NS (Non-sticky)
FR (Friable)	SS (Slightly Sticky)
FI (Firm)	S (Sticky)
VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
EFI (Extremely Firm)	NP (Non-plastic) SP (Slightly Plastic) P (Plastic) VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

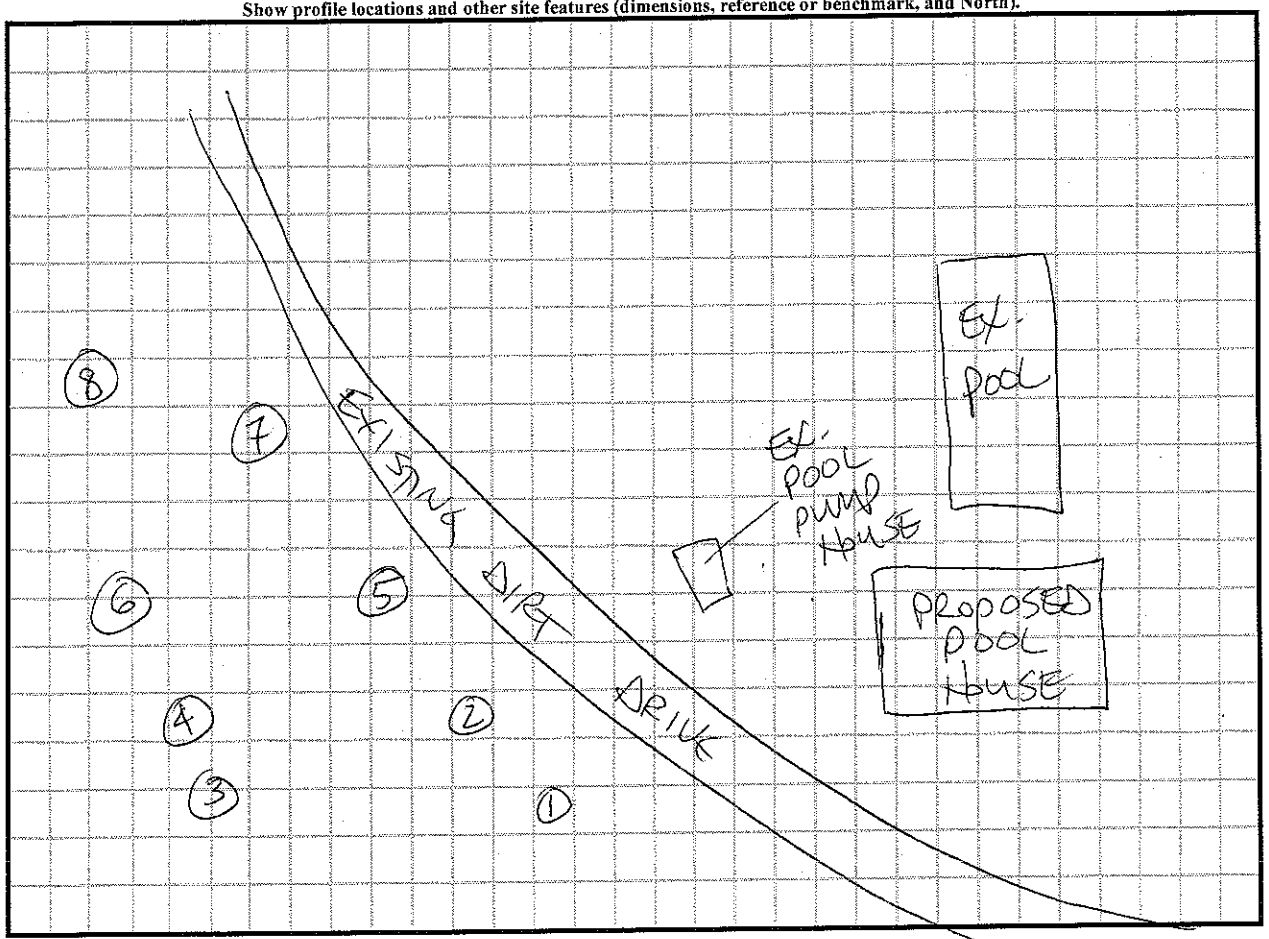

DENR (######)
Review (#####)