DENR/DEH

ON-SITE WASTEWATER SECTION

Sheet 1 of 2
PROPERTY ID #: 4722-48-5581
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: Victor Crouch
ADDRESS: 1538 Ravenwood Road
PROPOSED FACILITY: 3 BR Home
LOCATION OF SITE: 180 Charis Ln. State Rt 1 / Williamston Hwy 17
WATER SUPPLY: • Private • Public • Well • Spring • Other _____
EVALUATION METHOD: • Auger Boring • Pit • Cut

APPLICATION DATE 19 May 10
DATE EVALUATED: 19 June 10
PROPOSED DESIGN FLOW (.1949): 360 gpd
PROPERTY SIZE: 0.96 ac.
PROPERTY RECORDED: _____
TYPE OF WASTEWATER: • Sewage • Industrial Process • Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	L 6%	0-15	sbk / cl	fr / sl-sy/	7.18	7.18	NA	NA	PS 0.3
		15-48+	sbk / c	fi / sl-sy/					
2	L/N 10%	0-22	sbk / cl	fr / sl-sy	7.18	22	sapric		
		22+	sap						
3	L 6%	0-15	sbk / cl	fr / sl-sy	7.18	7.18	NA	NA	PS 0.3
		15-48+	sbk / c	fi / sl-sy					
4	L 6%	0-16	sbk / cl	fr / sl-sy	7.18	7.18	NA	NA	PS 0.3
		16-39	sbk / c	fi / sl-sy					
		39-48+	sbk / cl	fr / sl-sy					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	III	III
Site LTAR	0.3	0.3

OTHER FACTORS (.1946): NA
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: [illegible]
OTHER(S) PRESENT: _____

COMMENTS: _____

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	Si (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiCL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			**MOIST**	**WET**
S (Shoulder Slope)		SiL (Silt Loam)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SiC (Silty Clay)			FI (Firm)	S (Sticky)
		C (Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None	None	EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

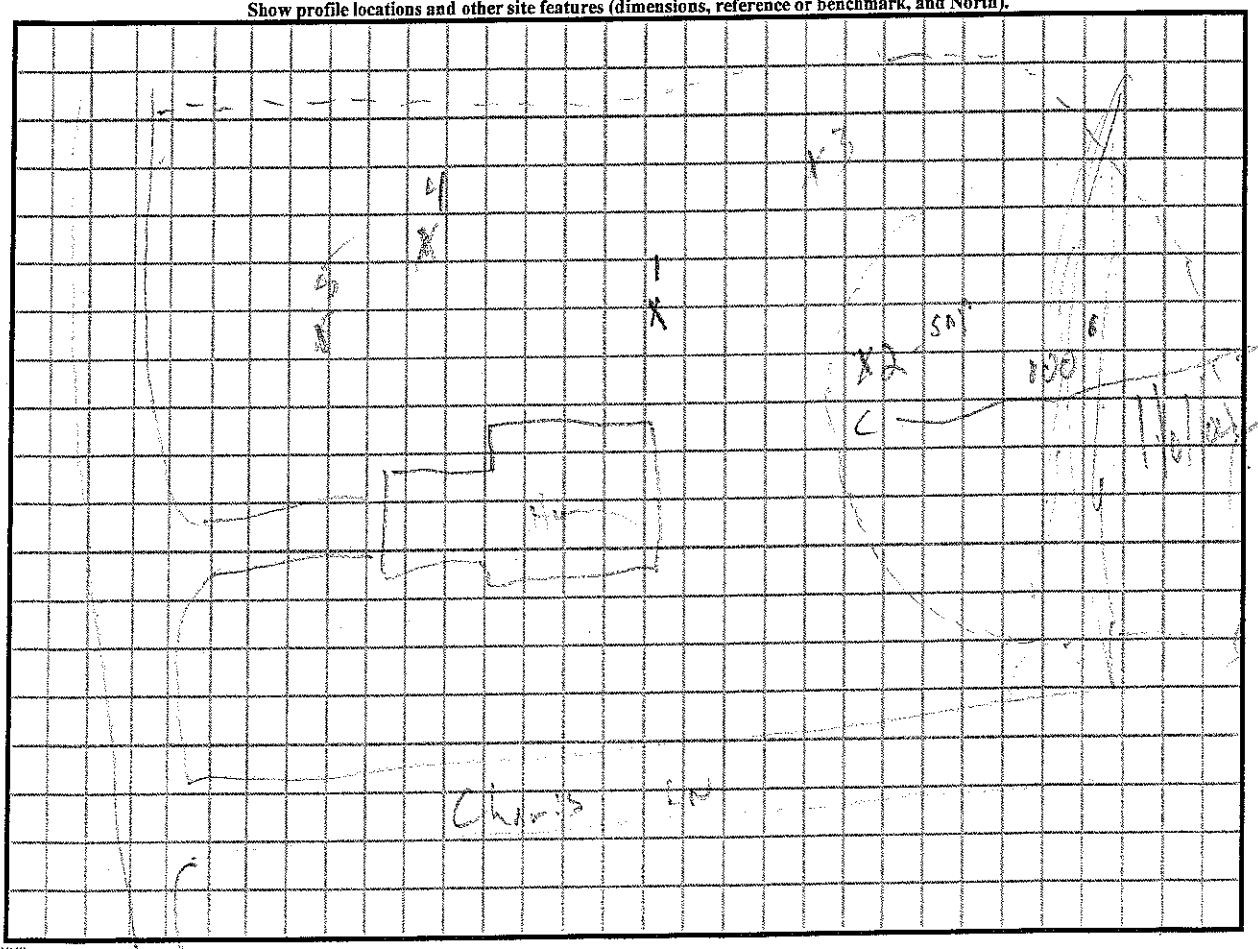

DENR (######)

Review (#####)

DENR/DEH

ON-SITE WASTEWATER SECTION

Sheet 2 of 2
PROPERTY ID #:
COUNTY:

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: Victor Creek
ADDRESS:
PROPOSED FACILITY: 3BR hm PROPOSED DESIGN FLOW (.1949): 360 g/d
LOCATION OF SITE:
WATER SUPPLY: • Private • Public • Well • Spring • Other
EVALUATION METHOD: • Auger Boring • Pit • Cut

APPLICATION DATE 19 May 10
DATE EVALUATED: 14 Jun 10
PROPERTY SIZE:
PROPERTY RECORDED:
TYPE OF WASTEWATER: • Sewage • Industrial Process • Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	L 7%	0-11	gr sl / cl	fr lso-p	7.5YR	7.5YR	Ap	Ap	PS 03
		11-39	sbk / c	fr lso-p					
		39-118+	wgsbk / cl	fr lso-p					
2									
3									
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		
System Type(s)		
Site LTAR		

OTHER FACTORS (.1946):
SITE CLASSIFICATION (.1948):
EVALUATED BY:
OTHER(S) PRESENT:

COMMENTS: