DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: 4723265929
COUNTY: 154 113

SOIL/SITE EVALUATION for ON-SITE WASTEWATER SYSTEM

OWNER: Home Shades APPLICATION DATE 12/16/08
ADDRESS: 111 Rex Rd Salisbury NC 28147 DATE EVALUATED: 12/22/08
PROPOSED FACILITY: 3BR HSE PROPOSED DESIGN FLOW (.1949): 360 PROPERTY SIZE: 2.6 ac
LOCATION OF SITE: British Hills 24 PROPERTY RECORDED: Yes
WATER SUPPLY: ☐ Private ☒ Public ☐ Well ☐ Spring ☐ Other
EVALUATION METHOD: ☒ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	10/0 L	0-6"	scl wkgr	fr ns np sl sp					PS .3
		6-36"	c mod sbk	fr sp sl sp					
		36-48"	c wk sbk	fr ss sp sl sp					
2	1.5% L	0-6	scl wkgr	fr ns np sl sp					PS .3
		6-36	c mod sbk	fr sp sl sp					
		36-48"	c wk sbk	fr ss sp sl sp					
			sap. inclusions	< 50%					
3	1.5% L	0-6"	scl wkgr	fr ns np sl sp					PS .3
		6-40"	c mod sbk	fr sp sl sp					
		40"-48"	c wk sbk	fr ss sp sl sp					
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	YES	YES
System Type(s)	GW 25	LPSD 1.25
Site LTAR	.3	.3

OTHER FACTORS (.1946):
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: L. Cook
OTHER(S) PRESENT: K. Rowden

COMMENTS: Initial system in 2% slope or less, LTAR width

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTUR
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	SCL (Sandy Clay Loam)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiL (Silt Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SiCL (Silty Clay Loam)			MOIST	WET
S (Shoulder Slope)		Si (Silt)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SiC (Silty Clay)			FI (Firm)	S (Sticky)
		C (Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None		EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

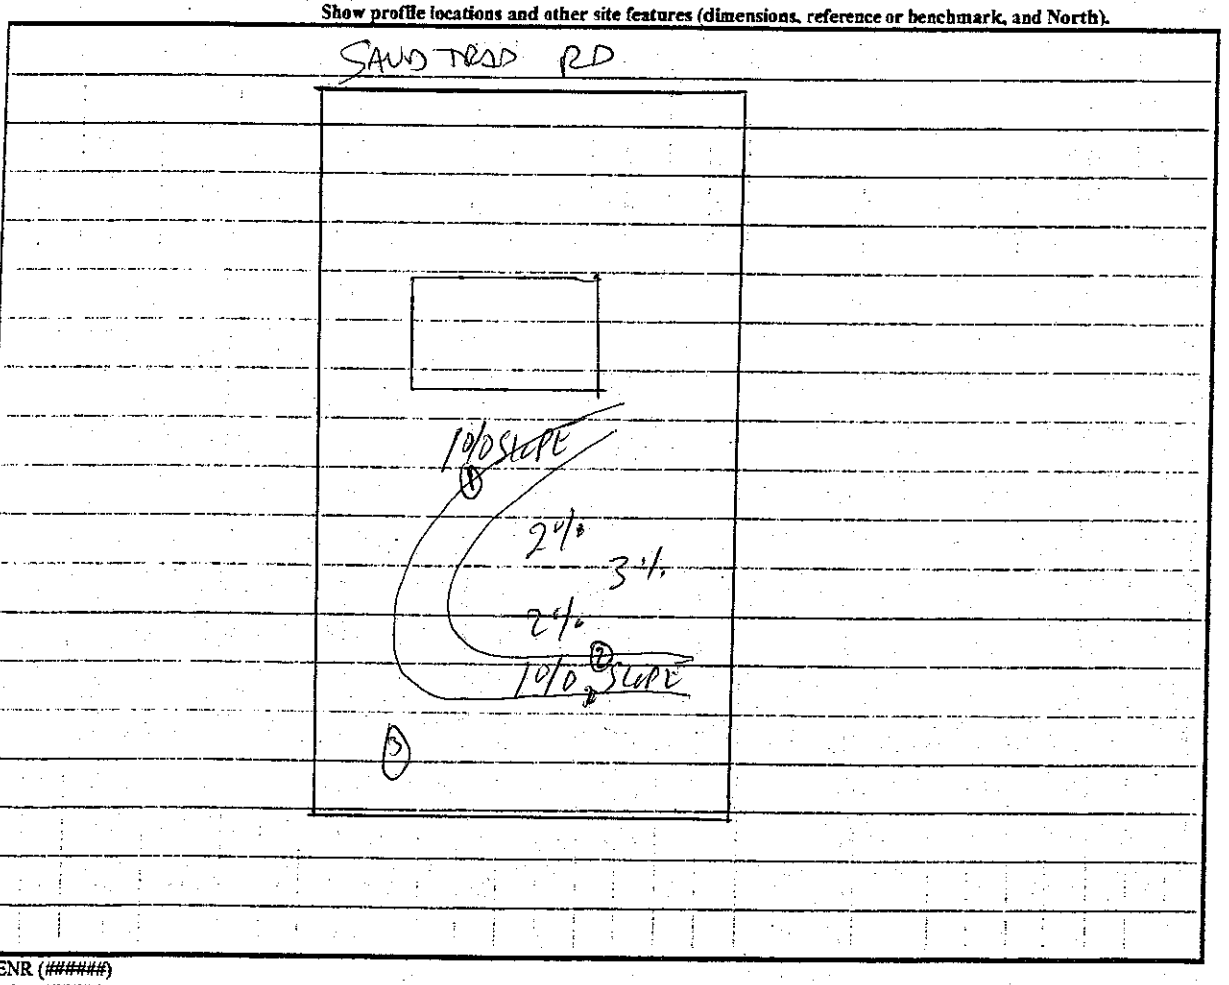

DENR (######)
Review (#####)