159655
4762 377603

DENR/DEH

ON-SITE WASTEWATER SECTION

Sheet 1 of 1
PROPERTY ID #:
COUNTY: Iredell

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: Carey-Jane Hawk
ADDRESS: 000 Morgan LN Statesville NC
PROPOSED FACILITY: House
PROPOSED DESIGN FLOW (.1949): 360
LOCATION OF SITE: Williams Rd to Medway to Shut Dog to Morgan
WATER SUPPLY: • Private • (Public) • Well • Spring • Other
EVALUATION METHOD: • (Auger Boring) • Pit • Cut

APPLICATION DATE 1-15-10
DATE EVALUATED: 1-30-10
PROPERTY SIZE: 1.75
PROPERTY RECORDED:
TYPE OF WASTEWATER: • (Sewage) • Industrial Process • Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	Repair 8% L	0-10	C ABK	SSSP SAPF	mica	48	NA	NA	.25
		10-24	C SSBK	SSSPSAPF					
		24-48	C SBK	SSSPSAPK					
2	6% L	0-7	C ABK	SSSPSAPF	mica	48	NA	NA	.25
		7-48	C ABK	SSSPSAPK					
3	6% L	0-9	C ABK	SSSPSAPF	mica	48	NA	NA	.25
		9-38	C SSBK	SSSPSAPF					
		38-40	C SBK	SSSPSAPK					
4	Repair 5% L	0-8	C ABK	SSSPSAPF	mica	48	NA	NA	.25
		8-40	C SSBK	SSSPSAPF					
		40-48	C SBK	SSSPSAPK					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	1440/360	1440/360
System Type(s)	2536	2536/R
Site LTAR	.25	.25

OTHER FACTORS (.1946): NA
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: Kevin Cook
OTHER(S) PRESENT: None

COMMENTS:

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	Si (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiCL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			**MOIST**	**WET**
S (Shoulder Slope)		SiL (Silt Loam)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SiC (Silty Clay)			FI (Firm)	S (Sticky)
		C (Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None	None	EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

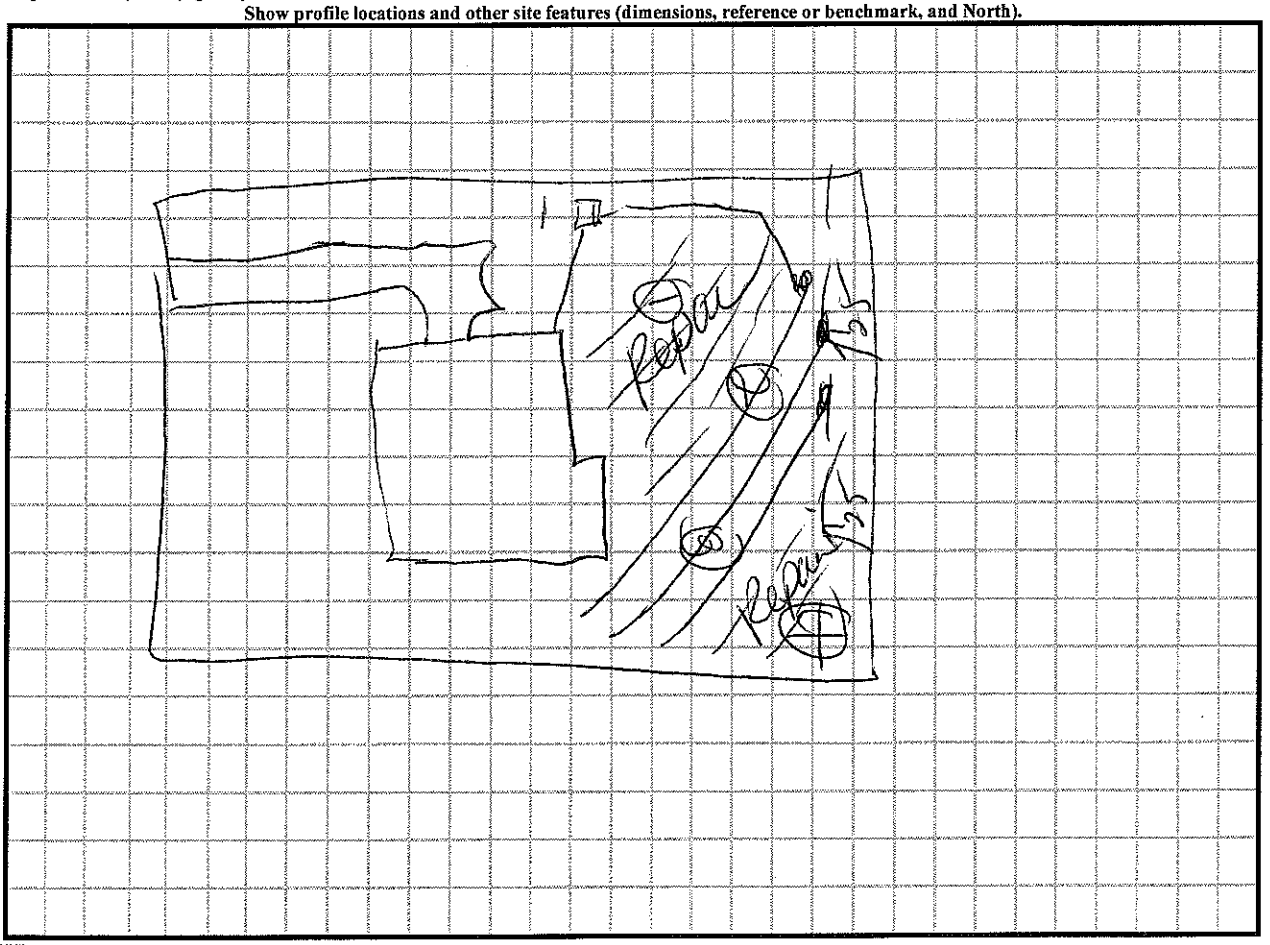

DENR (######)

Review (#####)