DENR/DEH

ON-SITE WASTEWATER SECTION

Sheet 1 of 1
PROPERTY ID #: 4726-60-0052
COUNTY: Iredell

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: Robert Fatta
ADDRESS: 146 Morrison Ck. Rd. Statesville
PROPOSED FACILITY: 3 bdr. Home PROPOSED DESIGN FLOW (.1949): 360 gpd
LOCATION OF SITE: 146 Morrison Ck. Rd.
WATER SUPPLY: • Private • Public • Well • Spring • Other
EVALUATION METHOD: • Auger Boring • Pit • Cut

APPLICATION DATE 6 Sept 10
DATE EVALUATED: 5 JAN 11
PROPERTY SIZE: 3.1 ac.
PROPERTY RECORDED:
TYPE OF WASTEWATER: • Sewage • Industrial Process • Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	L/N	0-8	g-l/L	vfr l sof	7.5YR	7.5YR	NA	NR	PS 0.3
		8-28	SBK/SiC	fr l sof					
		28-48+	gr/SL	vfr l sof					
2	L/N	0-8	g-l/L	vfr l sof	7.5YR	7.5YR	NA	NA	PS 0.3
		8-14	SBK/SCL	fr l sof					
		14-29	SBK/SL	fr l sof					
		29-48+	gr/SL	vfr l sof/p					
3	L/N	0-6	g-l/L	vfr l sof/p	7.5YR	7.5YR	NA	NR	PS 0.7
		6-22	SBK/CL	fr l sof/p					
		22-30	SBK/SC	fr l sof					
		30-48+	g-l/SL	vfr l sof/p					
4	L/N	0-9	g-l/L	vfr l sof/p	7.5YR	7.5YR	NA	NA	PS 0.7
		9-24	SBK/SCL	fr-fr l sof					
		24-48+	g-l/SL	vfr l sof					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		PS
System Type(s)		III
Site LTAR		0.7

OTHER FACTORS (.1946): PS
SITE CLASSIFICATION (.1948): PS

EVALUATED BY: TCH
OTHER(S) PRESENT: Mr & Mrs. Fatta / Jared Linz

COMMENTS:

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	Si (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiCL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			MOIST	WET
S (Shoulder Slope)		SiL (Silt Loam)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SiC (Silty Clay)			FI (Firm)	S (Sticky)
		C (Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None	None	EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

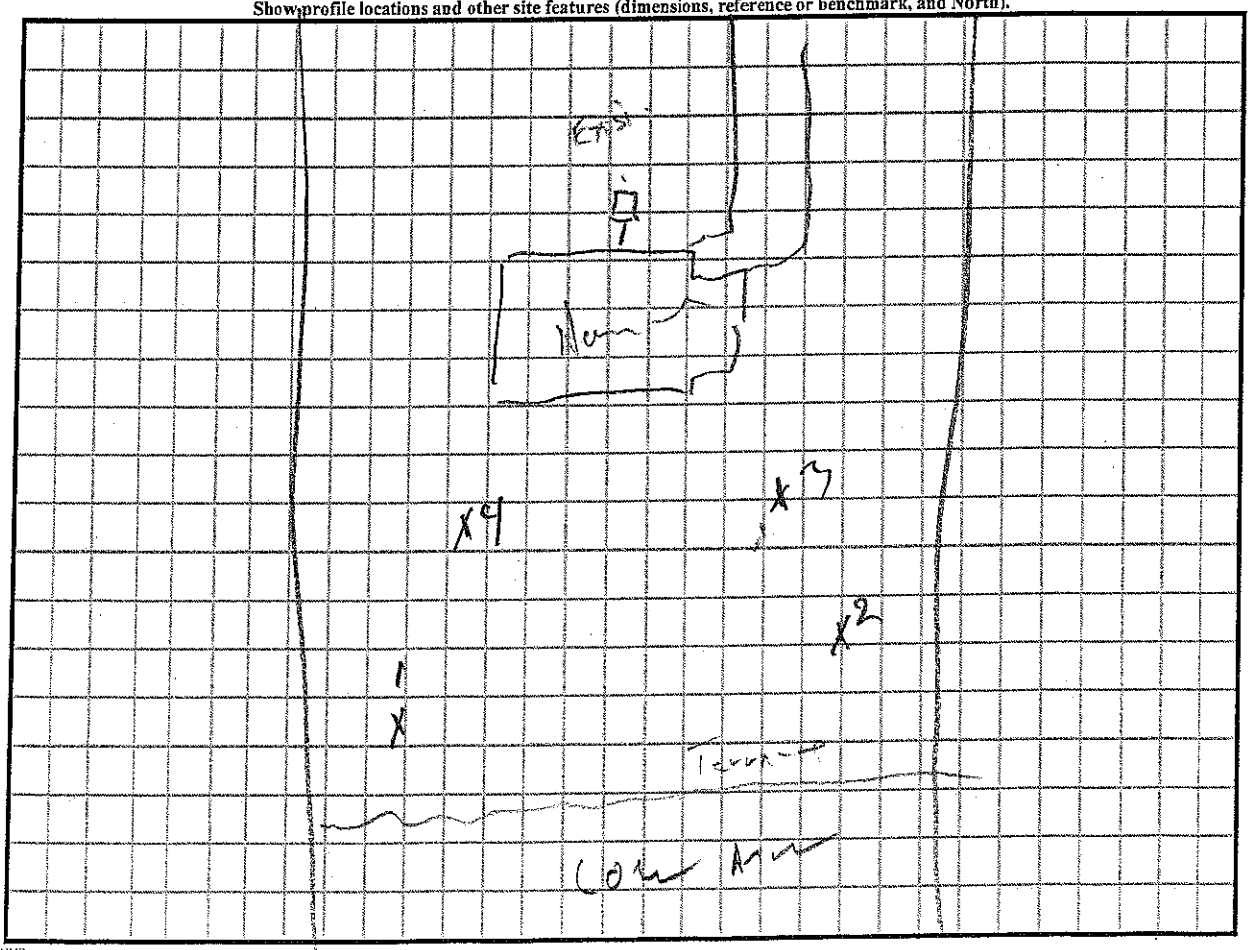

DENR (######)
Review (#####)