DENR/DEH

ON-SITE WASTEWATER SECTION

Sheet 1 of 2
PROPERTY ID #: 4727-71-6960
COUNTY: IREDELL

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: MARTIN HENDRICKS — APPLICATION DATE: 3/21/11
ADDRESS: 236 NEW STERLING RD STONY POINT, NC 28678 — DATE EVALUATED: 4/4/11
PROPOSED FACILITY: 3BR H w/cs — PROPOSED DESIGN FLOW (.1949): 360 — PROPERTY SIZE: 0.69 ACRES
LOCATION OF SITE: RED CHIMNEY MEADOWS Lot #1 — PROPERTY RECORDED: _____
WATER SUPPLY: • Private • ✓Public • Well • Spring • Other _____
EVALUATION METHOD: ✓Auger Boring • Pit • Cut — TYPE OF WASTEWATER: ✓Sewage • Industrial Process • Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	L 37	0-2	GR L	VFR SSEP	N/A	PS TO 30"	U AT 30"+ (NEED BACKHOE)	N/A	PS TO 30" 0.25 NEED BACKHOE
		2-30	WABK C	FR SS/SP SSEP					
		30+	CLAY ROCK/SAP	MIX					
2	SLIGHT H 42	0-4	GR L	VFR SSEP	N/A	S	N/A	N/A	PS 0.3
		4-48	WABK C	FR SS/SP SSEP					
3									
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	III	III
Site LTAR	0.3	0.25

OTHER FACTORS (.1946): NONE
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: S. HEDRICK
OTHER(S) PRESENT: K. NECIMORE

COMMENTS: REPAIR AREA IS SHALLOW PLACEMENT

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	Si (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiCL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			**MOIST**	**WET**
S (Shoulder Slope)		SiL (Silt Loam)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SiC (Silty Clay)			FI (Firm)	S (Sticky)
		C (Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None	None	EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

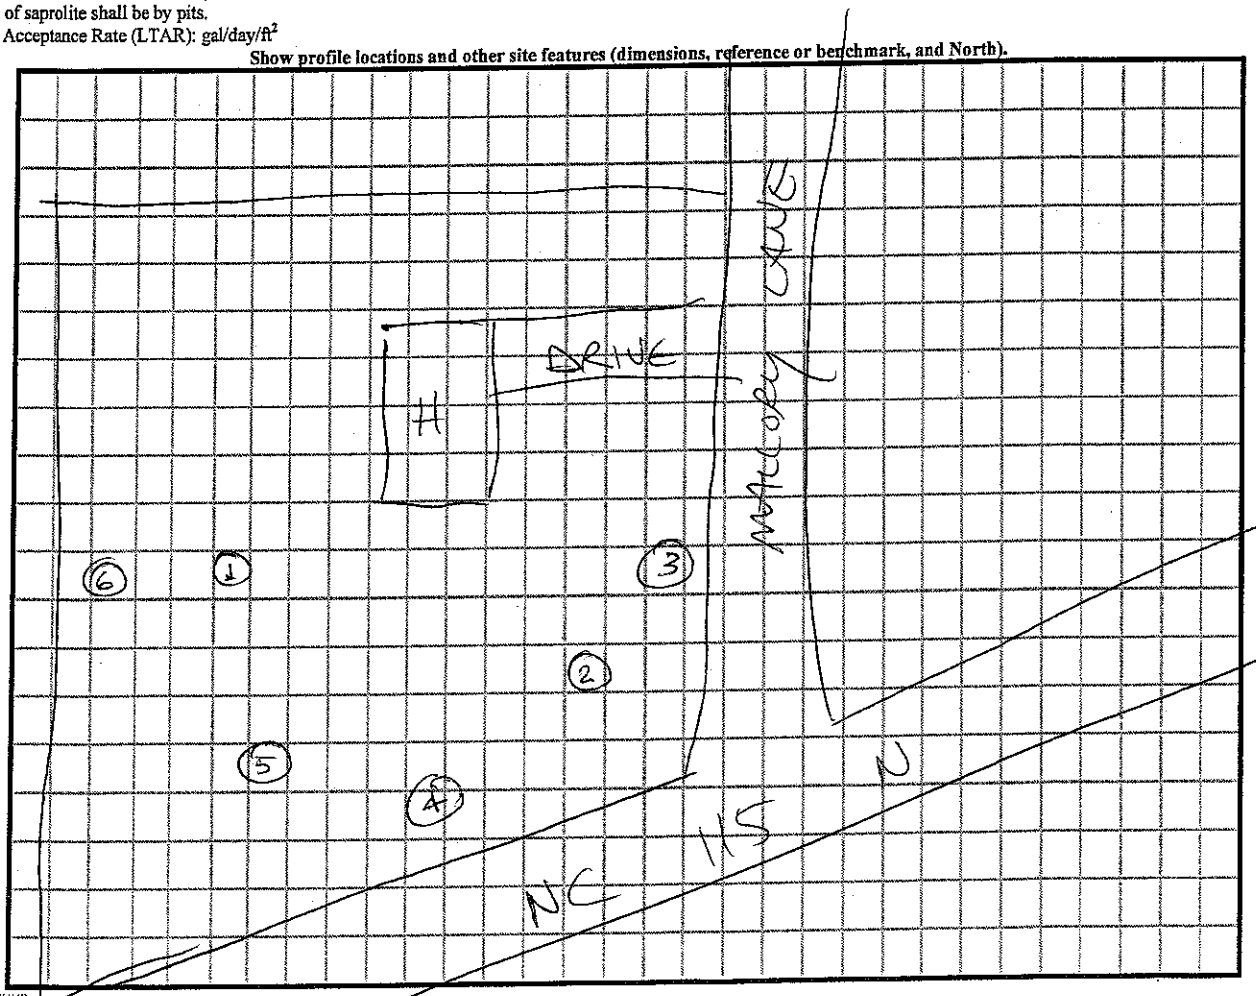

DENR (######)
Review (######)

DENR/DEH

ON-SITE WASTEWATER SECTION

Sheet 2 of 2
PROPERTY ID #: 4727-71-6460
COUNTY: IREDELL

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: MARTIN HENDRICKS — APPLICATION DATE: 3/21/11
ADDRESS: 346 NEW STERLING RD STONY POINT, NC 28678 — DATE EVALUATED: 4/6/11
PROPOSED FACILITY: 3 BR H W/CS — PROPOSED DESIGN FLOW (.1949): 360 — PROPERTY SIZE: 0.69 ACRE
LOCATION OF SITE: RED CHIMNEY MEADOWS LOT #1 — PROPERTY RECORDED: _____
WATER SUPPLY: • Private • Public • Well • Spring • Other _____
EVALUATION METHOD: ✓ Auger Boring • Pit • Cut — TYPE OF WASTEWATER: ✓ Sewage • Industrial Process • Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
3	L 4%	0-3	GR L	VFR SEAP	N/A	S	~~N/A~~	N/A	PS 0.3
		3-48	WABK C	FR SS/SP SEAP					
4	L	0-3	GR L	VFR SEAP	N/A	S	N/A	N/A	PS 0.3
		3-40	WABK C	FR SS/SP SEAP					
		40-48	WSBK SC	FR SEAP					
5	L	0-2	GR L	VFR SEAP	N/A	S	N/A	N/A	PS 0.3
		2-42	WABK C	FR SS/SP SEAP					
		42-48	WSBK SC	FR SEAP					
6	L	0-2	GR L	VFR SEAP	N/A	PS TO 42"	U @ 42"+	N/A	PS TO 42" 0.25
		2-42	WABK C	FI SS/SP SEAP					
		42+	ROCK/SAP	MIX —					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	III	III
Site LTAR	0.3	0.3

OTHER FACTORS (.1946): NONE
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: S. HEDRICK
OTHER(S) PRESENT: K. MCELMORE

COMMENTS: REPAIR AREA IS SHALLOW PLACEMENT

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope) CV (Convex Slope) D (Drainage Way) DS (Debris Slump) FP (Flood Plain) FS (Foot Slope) H (Head Slope) L (Linear Slope) N (Nose Slope) R (Ridge) S (Shoulder Slope) T (Terrace)	I	S (Sand) LS (Loamy Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive) SEXP (Slightly Expansive) EXP (Expansive)	G (Single Grain) M (Massive) CR (Crumb) GR (Granular) SBK (Subangular Blocky) ABK (Angular Blocky) PL (Platy) PR (Prismatic)
	II	SL (Sandy Loam) L (Loam)	0.8 - 0.6	0.4 - 0.3		
	III	Si (Silt) SiCL (Silty Clay Loam) CL (Clay Loam) SCL (Sandy Clay Loam) SiL (Silt Loam)	0.6 - 0.3	0.3 - 0.15		
	IV	SC (Sandy Clay) SiC (Silty Clay) C (Clay)	0.4 - 0.1	0.2 - 0.05		
		O (Organic)	None	None		

MOIST	WET
VFR (Very Friable)	NS (Non-sticky)
FR (Friable)	SS (Slightly Sticky)
FI (Firm)	S (Sticky)
VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
EFI (Extremely Firm)	NP (Non-plastic)
	SP (Slightly Plastic)
	P (Plastic)
	VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

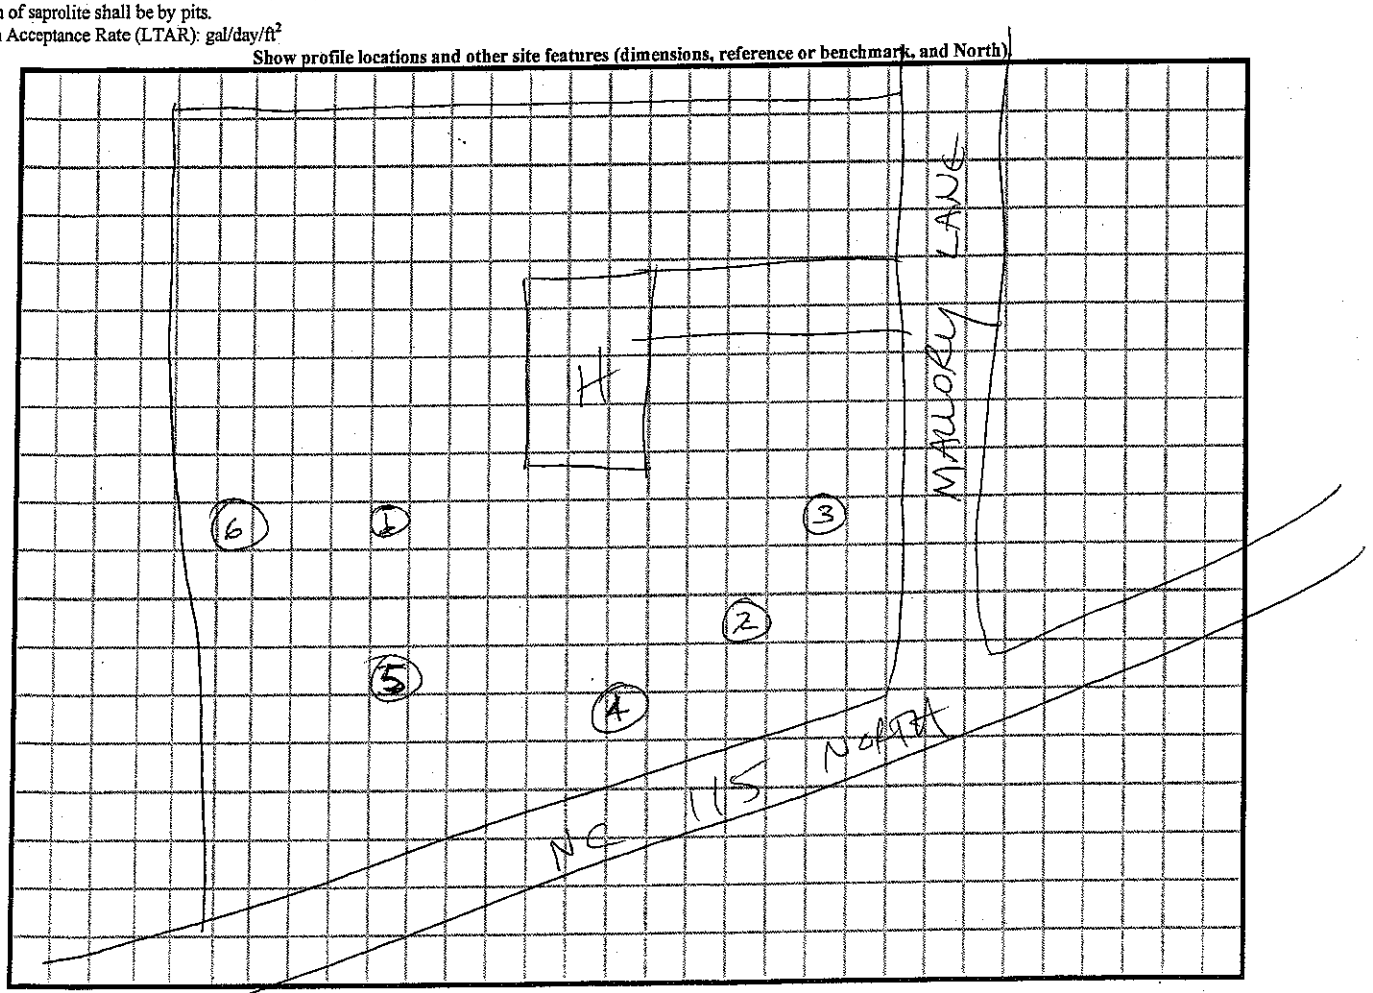

DENR (######)
Review (#####)